Waste Management Division PO Box 95, 29 Hazen Drive Concord, NH 03302

Type of Submittal (Check One-Most Applicable)

☐ Work Scope ☐ Reimbursement Request	Remedial Action Remedial Action Plan Bid Plans and Specifications
☐ UST Facility Report ☐ AST Facility Report	■ Remedial Action Implementation Report □ Treatment System and POE O&M □ Activity and Use Restriction
☐ Emergency/Initial Response Action ☐ Groundwater Quality Assessment	☐ Temporary Surface Water Discharge Permit
☐ Initial Site Characterization ☐ Site Investigation • Site Investigation Report • Supplemental Site Investigation Report • GMZ Delineation • Source Area Investigation • Data Submittal • Annual Summary Report ☐ Unsolicited Phase I Environmental Site Assessment ☐ Closure Documentation	☐ Groundwater Management Permit • Permit Application • Renewal Application • Deed Recordation Documentation • Abutter Notification Documentation • Release of Recordation ☐ Data Submittal ☐ Annual Summary Report

PHASE I ENVIRONMENTAL SITE ASSESSMENT

Turchin Estate 180 East Main Street Tilton, New Hampshire DES#199311019

Prepared For:


Lakes Region Planning Commission 103 Main Street, Suite #3 Meredith, NH 03253 Phone: (603) 279-8171 Contact: Mr. Kimon Koulet

Prepared By:

CREDERE ASSOCIATES, LLC

776 Main Street Westbrook, ME 04902 Phone: (207) 828-1272 ext. 35 Contact: Rip Patten, PE


September 23, 2010

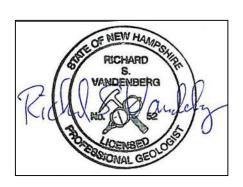

Recommended Risk Category (check one)			
1. Immediate Human Health Risk (Impacted water supply well, etc.)	4. Surface Water Impact	7. Alternate Water Available/Low Level Groundwater Contamination (<1,000 X	
2. Potential Human Health Risk (Water supply well within 1,000' or Site within SWPA) 3. Free Product or Source Hazard	 □ 5. No Alternate Water Available/No Existing Wells in Area □ 6. Alternate Water Available/High Level Groundwater Contamination (>1,000 X AGQS) 	AGQS) 8. No AGQS Violation/No Source Remaining Closure Recommended	





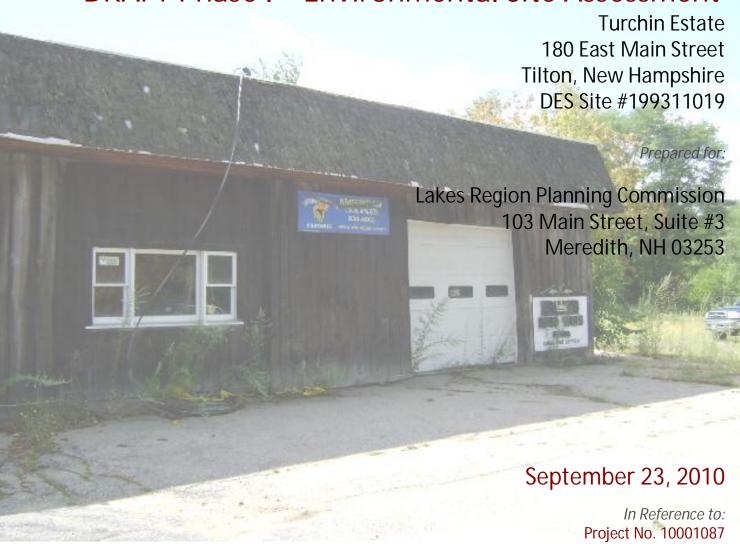

Submitted by: Credere Associates, LLC 776 Main Street Westbrook, ME 04092



CREDERE ASSOCIATES, LLC

776 Main Street Westbrook, Maine 04092 Phone: 207-828-1272 Fax: 207-887-1051

September 23, 2010

Mr. Kimon Koulet, Executive Director Lakes Region Planning Commission 103 Main Street, Suite #3 Meredith, NH 03253

Subject: DRAFT Phase I Environmental Site Assessment

Turchin Estate Property

180 East Main Street, Tilton, NH

Dear Mr. Koulet:

Enclosed is a copy of the **DRAFT** Phase I Environmental Site Assessment (ESA) Report completed for the Turchin Estate property located at 180 East Main Street in Tilton, New Hampshire. This report was completed in accordance with the American Society of Testing Materials (ASTM) Standard Practice E 1527-05 for Phase I ESAs.

Please do not hesitate to contact us at (207) 828-1272 if you have any questions or comments.

Sincerely,

CREDERE ASSOCIATES, LLC

Silas Canavan, EI Primary Author

Enclosures – **DRAFT** Phase I ESA

cc: Joyce Fulweiler, Town of Tilton Carolyn Hurst, WRTA Jennifer Marts, NHDES Jerry Minor-Gordon, USEPA

Call Control of the C

Richard S. Vandenberg, PG Senior Project Manager

TABLE OF CONTENTS

TURCHIN ESTATE 180 EAST MAIN STREET, TILTON, NEW HAMPSHIRE

Section 1 itle		Page No
EXE	CUTIVE SUMMARY	ES-1
1. I	INTRODUCTION	1-1
2. U	USER PROVIDED INFORMATION	2-1
2.1 2.2 2.3 2.4 2.5 2.6	Reason For Performing Phase I Specialized Knowledge Commonly Known or Reasonably Ascertainable Information Title Records Environmental Liens or Activity Use Limitations Reduction of Valuation for Environmental Issues	2-1 2-1 2-1
3. §	SITE DESCRIPTION	3-1
3.1 3.2 3.3 3.4 3.5 3.6	Site Ownership and Location Site Description and Operations Site Utilities Surface Water Topography and drainage Geological Characteristics	3-1 3-2 3-2
4. \$	SUMMARY OF PRIOR ENVIRONMENTAL DOCUMENTS.	4- 1
5. \$	SITE RECONNAISSANCE	5-1
5.1 5.2 5.3 5.4 5.5 5.6	General Site Setting	5-2 5-3 5-4 5-5
6. 8	SUBJECT PROPERTY RECORDS REVIEW	6-1
6.1 6.2 6.3 6.4 6.5	Historical Use Records State Environmental Review Federal Environmental Review Environmental Liens Institutional Controls	6-5 6-7 6-8
7. A	AREA RECORDS REVIEW	7-1
7 1	Historical Use Records	7-1

Septem	hber 23, 2010	DRAFT
7.2 7.3	State Environmental ReviewFederal Environmental Review	
8. I	NTERVIEWS	8-1
8.1 8.2 8.3	Past and Present User(s), Owner(s), and Occupant(s) State and/or Local Government Officials Local Residents	8-2
9. A	ADDITIONS, EXCEPTIONS, AND DEVIATIONS	9-1
10. A	ASTM NON-SCOPE CONSIDERATIONS	10-1
10.2 10.3 10.4	Asbestos	10-1 10-1 10-2
11. I	DATA GAPS	11-1
12. I	FINDINGS AND OPINIONS	12-1
13. (CONCLUSIONS	13-1
14. I	RECOMMENDATIONS	14-1
15. I	REFERENCES	15-1
16. I	LIMITATIONS	16-1
17. S	SIGNATURES OF ENVIRONMENTAL PROFESSIONALS	17-1

LIST OF FIGURES

Figure 1 – Site Location Plan

Figure 2 – Detailed Site Plan



LIST OF APPENDICES

Appendix A – Resumes of Key Personnel

Appendix B – Scope of Work

Appendix C – User Questionnaires

Appendix D – Site Photographs

Appendix E – FirstSearch® Database Report

Appendix F – Tank Closure Report

Appendix G – Historical Documentation



EXECUTIVE SUMMARY

Credere Associates, LLC (Credere) performed a Phase I Environmental Site Assessment (ESA) of the property known as the Turchin Estate (the subject property) located at 180 East Main Street in Tilton, NH. The Phase I ESA was completed in conformance with the American Society of Testing Materials (ASTM) Standard Practice E 1527-05 for Phase I ESAs, which meets the requirements of the U.S. Environmental Protection Agency (EPA) Standards and Practices for All Appropriate Inquiries (AAI); Final Rule (40 CFR Part 312). Based on Credere's review of local, state, and federal records and files, property historical records, interviews, and observations during the site reconnaissance visit on August 26, 2010, the following highlights the findings of this ESA:

The subject property is composed of one 0.8-acre parcel of land located at 180 East Main Street in Tilton, New Hampshire which is situated adjacent to the Winnipesaukee River. The subject property is currently occupied by a garage building and a cottage which are currently vacant and in disrepair. Both buildings were constructed prior to 1951, but the exact dates are not known. The subject property is currently owned by the Anthony Turchin Estate. Although exact dates were not determined, the subject property was formerly operated as gas station from approximately 1939 until the 1970s. An automobile body shop, used automobile repair shop, automobile salvage yard, used automotive sales, and a U-Haul truck rental business have also reportedly occupied the subject property.

The developed portions of the subject property which are not covered by the above mentioned structures are occupied by asphalt-paved and gravel parking areas, and an overgrown lawn and vegetated area located along the eastern and southern property lines. The subject property is bound to the east by a residential property, to the south by the Winnipesaukee River, to the west by a vacant gravel lot, and to the north by the Tilton Police Department.

One (1) heating oil above ground storage tank (AST) was observed outside on the south side of the garage building. According to available records, three (3) 1,000-gallon gasoline underground storage tanks (USTs) and one 1,000-gallon waste oil UST were removed from the subject property in 1993.

Potable water is provided to the subject property by the Tilton-Northfield Water District. The water service is located between East Main Street and the north side of the buildings. According to representatives of the Tilton-Northfield Water District, all properties in the vicinity of the subject property are served by the public water supply. The subject property was connected to the municipal sewer system in 1983. Prior to connection, the wastewater disposal method is unknown, though the subject property likely discharged wastewater to an on-site septic system. Electricity is available to the subject property via overhead lines from Public Services of New Hampshire. Heat is provided to the subject property by a forced hot air heating system which is serviced by a fuel oil-fired furnace located in the garage building. Surficial observations indicate that heat was provided to the cottage building via ducts from the same furnace.



This assessment has revealed the following evidence of *recognized environmental conditions* (REC):

- REC-1 The former use of the subject property as a gas station between 1939 and the 1970s represents a REC because past and present bulk storage and past distribution of petroleum products during this time frame may have resulted in releases of petroleum which may have impacted the environmental conditions of the subject property.
- REC-2 The documented release of petroleum discovered on September 16, 1993 during the closure of three (3) 1,000-gallon gasoline USTs and one (1) 1,000-gallon waste oil UST represents a REC because Credere's research indicates that additional environmental work was required by the New Hampshire Department of Environmental Services (NHDES) to document if impacted environmental media remain at the subject property following the UST closures. To Credere's knowledge, this work has not been completed.
- REC-3 The former use of the subject property as an auto repair facility between the approximate dates of 1939 and 1978 represents a REC because hazardous materials and petroleum products were likely stored, used, and may have been disposed of on the subject property and may have impacted the environmental conditions of the subject property.
- REC-4 At least one floor drain was observed within the garage bay with an unknown discharge point. This condition represents a REC because the drain is a potential conduit to the environment whereby releases of petroleum products and hazardous substances from former activities may have impacted the environmental conditions at the subject property.
- REC-5 A suspected dump and fill area was observed along the southern portion of the subject property including items such as, but not limited to, urban fill, automobile parts, and utility pole sections. Petroleum products and/or hazardous substances associated with these materials may have been released and impacted the environmental conditions at the subject property.
- REC-6 Stressed vegetation was observed below a pole mounted electrical transformer located along the northern subject property boundary. This condition represents a REC because it could be indicative of a release of petroleum-based and/or polychlorinated biphenyl (PCB)-containing dielectric fluid that may have impacted the environmental conditions of the subject property.

Additionally, Credere identified three (3) *de minimis* environmental conditions (DMEC) at the subject property.

• DMEC-1 – Oil staining observed on the floor of the cottage represents a DMEC because it is evidence of a release; however, a pathway to the environment is not likely.



- DMEC-2 Multiple containers of oil, gasoline, and automotive lubricants and cleaning materials represent a DMEC because of the poor conditions in which they were stored; however, a pathway to the environment is not likely.
- DMEC-3 Multiple stains observed on the gravel parking lot represent a DMEC because they are evidence of small petroleum releases which may have impacted surficial soil at the subject property. However, based on observed conditions, it is not likely that these small spills have significantly impacted environmental media at the subject property.

The following four (4) ASTM *Non-Scope environmental conditions* (NECs) were also noted during this Phase I ESA:

- NEC-1 Based on the age of the subject property buildings, potential asbestos-containing materials may be present on the interior and exterior of the buildings.
- NEC-2 Based on the age of the subject property buildings, lead-based paint may be present on the interior and exterior of the buildings.
- NEC-3 Based on the age of the subject property buildings, PCB-containing bulk products may be present on the interior and exterior of the buildings.
- NEC-4 Based on the condition of the subject property buildings and the collapsed roof of the garage, mold may be present in the buildings.

To confirm or dismiss the RECs described above, Credere recommends the following additional work:

- Phase II investigation activities are recommended to confirm or dismiss the above RECs and/or other documented bulk storage or releases of petroleum products and/or hazardous substances that may have impacted the environmental conditions at the subject property.
- An asbestos, lead-based paint, and PCB-containing hazardous building materials survey should be completed to confirm or dismiss the presence of hazardous building materials within the buildings.
- A universal and hazardous waste survey should be completed to inventory universal and hazardous waste which may be present at the subject property.
- If the buildings will be re-used, a mold survey should be completed to identify the presence of hazardous molds within the subject property buildings.



1. INTRODUCTION

Credere Associates, LLC (Credere) performed a Phase I Environmental Site Assessment (ESA) of the property known as the Turchin Estate (the subject property) located at 180 East Main Street in Tilton, New Hampshire. The Phase I ESA was completed in conformance with the American Society of Testing Materials (ASTM) Standard Practice E 1527-05 for Phase I ESAs, which meets the requirements of the U.S. Environmental Protection Agency (EPA) Standards and Practices for All Appropriate Inquiries (AAI); Final Rule (40 CFR Part 312).

This report was completed on behalf of the Lakes Region Planning Commission of Meredith, New Hampshire as part of the Brownfields Assessment Program. The report was completed by Mr. Silas Canavan, EI, and Mr. Richard S. Vandenberg, PG, of Credere. Resumes of Mr. Canavan and Mr. Vandenberg are included in **Appendix A**.

No Phase I ESA can wholly eliminate uncertainty regarding the potential for *recognized* environmental conditions (RECs)¹ in connection with a property. Performance of this practice is intended to reduce, but not eliminate, uncertainty regarding the potential for RECs in connection with the property, and this practice recognizes reasonable limits of time and cost. To the extent possible, this Phase I ESA presents a concise summary that qualitatively identifies potential environmental liability and provides Credere's professional opinions relative to the identified RECs so that informed business decisions may be made regarding the subject property. If the findings from this Phase I ESA indicate or reasonably imply that environmentally regulated materials are affecting the subject property, then the need for additional testing to evaluate the scope, location, source, and nature of any release or threat of release is included as a recommendation. In contrast, the Phase I ESA may also conclude that the likelihood of environmental problems is not significant and that there is no evidence of RECs in connection with the subject property. The benefit of the completed Phase I ESA is that any new owner would be eligible for the "bona fide prospective purchaser's" liability protection.

Appendix B contains a detailed description of Credere's Scope of Work for Phase I ESA's, which can be divided into the following broad categories: Records Review; Site Reconnaissance; Interviews; and Reporting. However, the following report is subdivided further so that it conforms to the recommended report format provided in ASTM E 1527-05.



¹ A *Recognized Environmental Condition* - the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, past release, or material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property. The term includes hazardous substances or petroleum products even under conditions in compliance with the law

2. USER PROVIDED INFORMATION

In accordance with ASTM E 1527-05, the *users* of this report were interviewed concerning their responsibilities under ASTM E 1527-05 Chapter 6. A copy of the 'User Questionnaires' completed by Ms. Carolyn Hurst of the Winnipesaukee River Trails Association (WRTA) and Mr. Kimon Koulet of the Lakes Region Planning Commission are included in **Appendix C**. The following subsections summarize the information that the *users* of this report provided to meet their responsibilities under ASTM E 1527-05.

2.1 REASON FOR PERFORMING PHASE I

The WRTA, in partnership with the Town of Tilton Conservation Commission, is considering purchasing the subject property and converting it into a trailhead for the Winnipesaukee River Trail system.

2.2 SPECIALIZED KNOWLEDGE

Ms. Hurst and Mr. Koulet both reported no specialized knowledge of the subject property for the purpose of identifying recognized environmental conditions.

Ms. Hurst and Mr. Koulet do not have experience with real estate transactions involving environmental contamination. Ms. Hurst and Mr. Koulet are not commercial brokers of real estate or real estate professionals. Ms. Hurst and Mr. Koulet report that they do not have experience acting as secured creditors on commercial real estate. Ms. Hurst and Mr. Koulet do not have professional experience in detecting or remedying environmental contamination.

2.3 COMMONLY KNOWN OR REASONABLY ASCERTAINABLE INFORMATION

Ms. Hurst indicated that she is aware of rumors of environmental issues at the subject property, but she does not know specific details.

Mr. Koulet reported no knowledge of environmental issues at the subject property.

2.4 TITLE RECORDS

A comprehensive chain-of-title search was not completed as part of this ESA, nor were title records provided by the users. It is Credere's opinion that an adequate history of the subject property was able to be developed from other historic sources.

2.5 ENVIRONMENTAL LIENS OR ACTIVITY USE LIMITATIONS

A third party, such as a state or federal governmental agency, may place environmental liens on a property in order to recover clean-up costs that were incurred by the party. The existence of a recorded environmental clean-up lien on a property is an indication that environmental



conditions either currently exist or previously existed on a property. Activity or land use restrictions for a property may be placed on the property deed to prevent exposure to hazardous or contaminated materials. The existence of an environmental clean-up lien or activity/land use restrictions could be considered an indicator of potential environmental concerns, and could be a basis for additional environmental investigations on the subject property to determine the potential existence of ongoing or continued releases of hazardous substances or petroleum products.

Ms. Hurst and Mr. Koulet reportedly have no knowledge of any environmental liens that may apply to the subject property under federal, tribal, state, or local law, or Activity and Land Use Limitations for the subject property such as institutional controls or engineering controls to limit exposure to hazardous substances or petroleum products. See **Sections 6.4** and **6.5** for records review of environmental liens and institutional or engineering controls associated with the subject property.

2.6 REDUCTION OF VALUATION FOR ENVIRONMENTAL ISSUES

Ms. Hurst is not aware of the purchase price of other similar properties in the area and therefore cannot compare the purchase price of the subject property to fair market value.

Mr. Koulet reports no knowledge of the purchase price of the subject property.



3. SITE DESCRIPTION

3.1 SITE OWNERSHIP AND LOCATION

Parcel Identification: Map U-04, Lot 71

Site Owner(s): Anthony Turchin Estate, c/o Dennis Belair

Site Occupants: Vacant

Date of Ownership: June 21, 1982 to present

Site Location: 180 (formerly 90) East Main Street, Tilton, New

Hampshire

Zoning: Mixed Use (MU)

County: Belknap

USGS Quadrangle: Northfield, New Hampshire 7.5 Minute Quadrangle Latitude and Longitude: 43° 26' 43" Lat., -71° 34' 59" Long. (Approximate) NAICS Code: 811111 – General Automotive Repair (former use)

3.2 SITE DESCRIPTION AND OPERATIONS

The subject property is composed of one 0.8-acre parcel of land located at 180 East Main Street in Tilton, New Hampshire at the intersection of East Main Street and Copeland Road, and situated adjacent to the Winnipesaukee River. The subject property is referred to by the Town of Tilton as Map U-04, Lot 71 and is currently owned by the Anthony Turchin Estate. The subject property is zoned Mixed Use (MU).

The subject property is currently occupied by a garage building and a cottage which are vacant and in disrepair. Both buildings were constructed prior to 1951, but the exact dates are not known. The garage has a footprint of approximately 2,200 square feet and the cottage has a footprint of approximately 500 square feet. The developed portions of the subject property which are not covered by the above mentioned structures are occupied by asphalt-paved and gravel parking areas, and an overgrown lawn and vegetated area located along the eastern and southern property lines. The subject property is bound to the east by a residential property, to the south by the Winnipesaukee River, to the west by a vacant gravel lot, and to the north by the Tilton Police Department.

Although exact dates were not determined, the subject property was formerly operated as gas station from approximately 1939 until the 1970s. An automobile body shop, used automobile repair shop, automobile salvage yard, used automotive sales, and a U-Haul truck rental business have also reportedly occupied the subject property.

Figure 1 locates the subject property on the Northfield, New Hampshire 7.5 minute quadrangle prepared by the United States Geological Survey (USGS).



3.3 SITE UTILITIES

Potable water is provided to the subject property by the Tilton-Northfield Water District. The water service is located between East Main Street and the north side of the buildings. According to representatives of the Tilton-Northfield Water District, all properties in the vicinity of the subject property are served by the public water supply.

Wastewater from the subject property is currently discharged to the municipal sewer system located between East Main Street and the north side of the buildings. The subject property was connected to the municipal sewer system in 1983. Prior to connection, the wastewater disposal method is unknown, though the subject property likely discharged wastewater to an on-site septic system.

Electricity is available to the subject property via overhead lines from Public Services of New Hampshire. The utility lines to the garage were noted to have been cut. Heat is provided to the subject property by a forced hot air heating system which is serviced by a fuel oil-fired furnace located in the garage building. Surficial observations indicate that heat was provided to the cottage building via ducts from the same furnace. This furnace is supplied by a 275-gallon fuel oil aboveground storage tank (AST).

3.4 SURFACE WATER

No surface water was identified within the boundaries of the subject property. The Winnipesaukee River is located directly adjacent to the subject property to the south, and an unnamed stream is located approximately 65-feet west of the subject property at its closest point.

3.5 TOPOGRAPHY AND DRAINAGE

Based upon a review of the 1987 Northfield, NH 7.5 minute Quadrangle, the subject property is between 440 and 460 feet above mean sea level (MSL). Topography at the subject property generally slopes in two directions. The north side of the subject property slopes gently to the northwest, while the south side tends to slope radially to the south and west. Stormwater on the north side of the subject property likely follows surficial topography resulting in a northwesterly flow which terminates at a catch basin located in the northwestern corner of the subject property. This catch basin reportedly discharges via a culvert into a drainage ditch. The ultimate outfall of this drainage ditch is the Winnipesaukee River. Stormwater on the south side of the subject property generally follows the topography radially to the south and west and flows directly into the Winnipesaukee River.

Regional topography within a 0.5-mile radius of the subject property consists of rolling hills sloping towards the Winnipesaukee River ranging from 400 to 600 feet above MSL.



3.6 GEOLOGICAL CHARACTERISTICS

3.6.1 Surficial Geology

According to the *Geohydrology and Groundwater Quality Data of Stratified-Drift Aquifers in the Winnipesaukee River Basin, Central New Hampshire*, United States Geological Survey (USGS), Water-Resources Investigations Report 94-4150, by Joseph D. Ayotte (1997), the surficial geology at the subject property consists of glacial till over bedrock.

3.6.2 Bedrock Geology

According to the *Generalized Bedrock Geologic Map of New Hampshire* compiled by the USGS, the subject property is underlain primarily metamorphic rocks of the Silurian age, consisting of aluminous schist, quartzite, calc-silicate granofels, and bimodal metavolcanic rocks. According to the USGS, the average depth to bedrock is 35-feet bgs, but can be up to 200-feet below ground surface (bgs) in localized areas.

3.6.3 Groundwater Characteristics

Although the localized topography slopes in two directions, it is likely that groundwater flows in a southerly direction towards the Winnipesaukee River. It should be noted that local groundwater flow may be highly varied due to precipitation events, stormwater runoff, infiltration/recharge, the presence of subsurface structures and utilities, and varying subsurface hydrogeologic conditions.

According to the *Geohydrology and Groundwater Quality Data of Stratified-Drift Aquifers in the Winnipesaukee River Basin, Central New Hampshire*, USGS, Water-Resources Investigations Report 94-4150, by Joseph D. Ayotte (1997), the subject property is located over the Gardners Grove aquifer (a portion of the Tri-Town Aquifer), which is classified as a major aquifer by the USGS and a groundwater protection district by the New Hampshire Department of Environmental Services (NHDES). Drilled wells within the vicinity of the subject property encountered groundwater at depths ranging from 8-feet to 20-feet bgs.



4. SUMMARY OF PRIOR ENVIRONMENTAL DOCUMENTS

During interviews and the review of historical documentation, three pertinent previous environmental investigation documents were identified.

A letter dated August 23, 1967, reports that an inspection of the subject property was made by the Town of Tilton to investigate the reported filling of a swamp area which adjoined the Winnipesaukee River. The letter reports that the fill extended approximately 100-feet along the shoreline. The Town was concerned that the fill would act as a dam during times of high flow. No further information was found in regards to this incident. The information obtained from this letter is evidence that wetlands along the bank of the Winnipesaukee River were filled. A copy of this letter is included as **Appendix G** of this report.

A UST closure report was obtained from the NHDES Onestop online database for the subject property. This information is discussed further in **Section 6.2** of this report.

A Phase I ESA was completed for the westerly abutting property (190 East Main Street) on January 15, 2009 by A&D Klumb Environmental, LLC of Webster, New Hampshire. No evidence of RECs was identified on this abutting property during the performance of the A&D Klumb Environmental, LLC ESA.



5. SITE RECONNAISSANCE

On August 26, 2010, Credere representatives conducted a site visit to the subject property to determine the physical characteristics of the subject property and the potential presence of RECs. The subject property is currently occupied by two buildings which are not in use. Access to the subject property was provided by Ms. Carolyn Hurst. Ms. Hurst informed the owner of the site visit prior to Credere's arrival. Pursuant to ASTM E 1527-05 Chapter 12.3, resumes for Mr. Vandenberg and Mr. Canavan are attached as **Appendix A** to demonstrate their qualifications to perform this work. **Appendix D** contains photographs taken during the site visit. **Figure 2** is a site plan based on observations made during Credere's site visit and subject property records.

5.1 GENERAL SITE SETTING

5.1.1 Current Use of the Property

The subject property currently contains two vacant buildings.

5.1.2 Current Uses of Adjoining Properties

The subject property is located in a mixed use area of Tilton. Adjoining properties include the following:

North: The subject property is bordered to the north by the intersection of East Main Street and Copeland Road (up-gradient). Beyond East Main Street to the east of Copeland road is the Tilton police station. To the west of Copeland Road is an undeveloped wooded lot.

East: The subject property is bordered to the east by a residence (upgradient to cross-gradient).

South: The subject property is bordered to the south by the Winnipesaukee River (downgradient).

West: The subject property is bordered to the west by a vacant gravel lot (cross-gradient).

References to upgradient, downgradient, and cross-gradient indicate the perceived location of these features relative to the direction of shallow groundwater flow at the subject property, which has been inferred to flow in a southerly direction.



5.2 EXTERIOR OBSERVATIONS

The exterior of the subject property was observed visually during the August 26, 2010, site visit by walking the perimeter of the subject property, by observing the subject property from East Main Street, and by walking the subject property in a grid-like fashion. Weather conditions on this day included sunny skies with temperatures in the 80's.

The subject property consists of an irregularly shaped parcel of land. The buildings are located in the northeast portion of the subject property (**Picture 1**). Developed areas of the subject property near the buildings are occupied by asphalt-paved parking areas on the north and west sides of the buildings, gravel parking areas on the west side of the garage (**Picture 2**), and an overgrown lawn area on the south side of the buildings (**Picture 3**). A pavement patch where the former fueling island was reported to be located was observed on the north side of the buildings (**Picture 4**). The east and southern portions of the subject property are wooded along the property lines. The surrounding properties are a mix of residential, municipal, and commercial uses.

One (1) 55-gallon drum with unknown contents was observed adjacent to the southern exterior wall of the garage (**Picture 5**).

One (1) 275-gallon AST was observed adjacent to the southern exterior wall of the garage (**Picture 6**). The tank was corroded on the outside. There was no surficial visual evidence of a release on the AST. The concrete base below the tank was discolored, possibly indicative of a previous release of petroleum; however, the observed potential staining may have been the result of the previous day's rain event.

Several debris piles were observed throughout the subject property. A surficial visual inspection of these piles identified scrap metal, discarded automobile parts, plastic, tires, scrap wood, and general household refuse (**Picture 7**). One (1) discarded automobile gas tank was observed in the debris pile located outside of the southwestern corner of the garage (**Picture 8**). One (1) discarded pickup truck bed (**Picture 9**) and one (1) pile of approximately 15 wooden utility pole sections (**Picture 10**) were observed in the wooded southeastern portion of the subject property.

The southern portion of the subject property was observed from the surface to have been filled with material containing gravel, brick, cinder block, pavement, and concrete (**Picture 11**). A mound in the southeast corner of the subject property appears to consist of similar fill material and waste asphalt (**Picture 12**).

Several small stains were observed on the gravel parking area on the west side of the subject property (**Picture 13**). Though additional investigation would be required to define the extent of the identified stained areas, based on observed conditions it is likely that these stains are associated with oil and gas dripping from automobiles that were parked on the subject property and not the result of a sudden release of oil and/or hazardous materials.



One (1) electrical transformer was observed mounted on the utility pole located in the northwest portion of the subject property (**Picture 14**). Stressed vegetation was observed below the transformer. No labeling indicating the polychlorinated biphenyl (PCB) concentration, if any, of dielectric fluid contained within this transformer was observed.

Approximately nine (9) fluorescent light bulbs and one (1) fluorescent light ballast were observed stacked against the south side of the cottage.

One (1) discarded car battery was observed on the ground on the north side of the cottage (**Picture 15**).

No evidence of drywells, pits, or lagoons was observed on exterior portions of the subject property. No evidence of leachate or seeps was observed on the subject property. No evidence of petroleum exploration, abstraction, or refinery was observed on the subject property. Aside from staining and stressed vegetation mentioned above, no other evidence of a potentially significant release of oil and/or hazardous materials was observed on the exterior portions of the subject property during the site visit.

5.3 INTERIOR OBSERVATIONS

The accessible portions of the interior of the two buildings on the subject property were observed visually during the August 26, 2010 site visit.

The garage was constructed with a concrete slab foundation on the western portion, a dirt floor crawl space basement on the eastern portion, a wooden and concrete block structure, a wood shingle roof, and vertical wood siding. Lighting for the garage consists of ceiling mounted fluorescent light fixtures. The roof of the garage building has collapsed in multiple locations. The interior of the garage building consists of a garage bay with two bay doors, three separate rooms, and a closet.

The garage bay consists of a concrete slab floor, painted and unpainted wooden panel and concrete block walls, and a sheetrock ceiling. The ceiling in the garage bay has collapsed (**Picture 16**). A floor drain was observed in the garage bay (**Picture 17**). Though additional investigation is needed to determine the outfall of this floor drain, it is likely that it is connected to the municipal sewer system. Water leaking onto the floor from the collapsed roof prevented identification of staining around the floor drain. However, staining was observed on the floor in other areas of the garage bay (**Picture 18**). Multiple small volume automotive fluid containers were also observed in the garage bay (**Pictures 19 and 20**). No evidence of the use of hydraulic equipment was identified during the site visit. However, tax records indicate that a hydraulic lift was present in the garage in 1978 (see **Sections 6.1** and **12**).



The three remaining rooms and the closet were characterized by carpeted floors, painted sheetrock and unpainted wooded walls, and paneled ceilings (**Pictures 21 and 22**). Insulation was observed protruding from the walls and the ceilings in all rooms. The room adjacent to the garage bay contained shelves with multiple small volume automotive cleaning, lubricating, and maintenance fluid and aerosol containers (**Picture 23**). A furnace was also located in this room (**Picture 24**). The age of the furnace was not known. A General Electric refrigerator was observed in the closet (**Picture 25**).

The dirt floor crawl space basement is located under the eastern side of the garage building. An insulated pipe was observed going into the ground from the eastern side wall of the crawlspace (**Picture 26**). Though additional investigation is required to determine the nature of this pipe, it is unlikely that it is associated with the bulk storage or release of oil and/or hazardous materials. This feature may potentially be a sewer pipe coming from the cottage located adjacent to the garage building.

No visual surficial evidence of bulk storage or a significant release of oil and/or hazardous materials was noted within observed interior portions of the garage.

The exterior of the cottage consists of an asphalt shingle roof, painted and unpainted wood siding, and a concrete slab foundation (**Picture 27**). The interior consists of two rooms and a bathroom. The entire cottage is in poor structural condition with a significant amount of refuse spread about the floor. The bathroom contained wood flooring and wood walls (**Picture 28**). The two additional rooms contained wood flooring and wood panel walls. Approximately 20 fluorescent light ballasts were observed in the cottage (**Picture 29**). Approximately five (5) fivegallon containers of unknown contents were observed in the cottage (**Picture 30**). Staining on the floor of the cottage was observed near the entrance (**Picture 31**). One (1) gas canister of unknown contents was observed near the entrance of the cottage (**Picture 32**).

No visual surficial evidence of bulk storage or a significant release of oil and/or hazardous materials was noted within observed interior portions of the cottage.

5.4 UNDERGROUND AND ABOVEGROUND STORAGE TANKS

One (1) 275-gallon AST was observed adjacent to the southern exterior wall of the garage (**Picture 6**). The tank was corroded on the outside. There was no surficial visual evidence of a release on the AST. The concrete base below the tank was discolored, possibly indicative of a previous release of petroleum; however, the observed potential staining may have been the result of the previous day's rain event.

No evidence of existing USTs was observed during the site visit. However, according to DES documents, four USTs were reportedly removed from the subject property in 1993. These USTs are discussed in **Section 6.2** of this report.



5.5 PCB-CONTAINING ELECTRICAL AND HYDRAULIC EQUIPMENT

ASTM Standards for Phase I ESAs specifically exclude fluorescent lighting fixtures that may contain PCBs from electrical equipment unless they are observed in waste form. Multiple used fluorescent light ballasts were observed in waste form along the interior and exterior of the subject property. Fluorescent lighting fixtures that were not in waste form were also observed on the interior of the subject property and are discussed as a non-scope consideration in **Section 10.4**.

One pole-mounted electrical transformer was observed on the northern portion of the subject property. No labeling indicating the PCB concentration, if any, of dielectric fluid contained within this transformer was observed. As such, Public Services of New Hampshire (PSNH) was contacted to determine if the electrical transformer contained PCBs. Although PSNH did not know if the transformer contained PCBs, they reported that it was manufactured in 1960. Based on the manufacture date of this transformer, it is possible that the associated dielectric fluid contains concentrations of PCBs.

No evidence of the use of hydraulic equipment was identified during the site visit. However, tax records indicate that a hydraulic lift was present in the garage in 1978 (see **Sections 6.1** and **12**).

5.6 SITE RECONNASSIANCE LIMITATIONS

The ASTM Standards for Phase I ESAs require the identification of limitations that were encountered that may affect the ability to identify potential environmental conditions on the property, and to provide an opinion as to the significance of the limitation with regard to the ability to identify potential environmental conditions onsite.

Due to the collapsed roof in the garage bay, the floor was wet around the area of the floor drain. The wet floor prevented Credere personnel from discerning the nature of staining observed in the vicinity of the floor drain.

Due to the poor condition of the building, the basement on the east side of the garage was not entered. Not entering the basement prevented the identification of evidence of potential RECs that could not be seen from the entrance to the basement.



6. SUBJECT PROPERTY RECORDS REVIEW

Files at the Tilton Fire Department, NHDES Onestop online database, and the United States Environmental Protection Agency (USEPA) Region 1 were reviewed to obtain information concerning the bulk storage and releases of petroleum products and/or hazardous substances at the subject property. In addition, a FirstSearch® environmental database search was conducted on August 30, 2010, and is included as **Appendix E**.

The purpose of these searches is to identify potential RECs in connection with the subject property. This research should not be considered inclusive of all regulatory records, but only those records that were publicly available, practically reviewable, and reasonably ascertained.

6.1 HISTORICAL USE RECORDS

ASTM standards for Phase I ESAs require that historical records on the subject property be searched for information on the subject property dating back to the subject property's earliest development or 1940, whichever is earliest, based on available documentation. All standard historical sources, as defined by ASTM E 1527-05, were ascertained and reviewed as part of this ESA, with the exception that a full title search was not provided by the *users*. Credere does not consider the lack of title information a significant data gap as a clear record of historical ownership and subject property usage was provided by personnel familiar with the subject property and by deed research performed by Credere.

The earliest record found specifically for the subject property was a deed reference from May 3, 1939. The deed mentions the subject property was subdivided from the G.H. Tilton & Son Company property and sold to the Hampshire Oil Company by Elmer and Lillian Tilton. According to a 1929 Sanborn Map, the G.H. Tilton & Son Company was a paper box producing factory. The box factory was located approximately 400-feet west of the subject property.

It is assumed that the subject property was used as a gas station after it was purchased by the Hampshire Oil Company. The property was later sold to Forrest Glines on June 25, 1947, and then to Robert and Joanne Jordan on November 11, 1967. A letter dated 1967 from the Town of Tilton concerning filling within the Winnipesaukee River at the subject property mentions that the subject property was also being used as a Gulf gas station at the time. The subject property was sold to Gladys and George Rafaelly on November 8, 1973. A tax card dated January 5, 1978, indicated the use of the property as an auto repair and body shop, but not a gas station. It can therefore be inferred that the use of the subject property as a gas station was ceased sometime between 1967 and 1978. The same tax card indicated that the garage contained an oil furnace, a wood stove, and a hydraulic lift. The subject property was sold again to Richard and Joan Downs on July 19, 1978. A building permit was issued to Mr. Downs in 1980 to remodel the cottage.



The Iona Savings Bank acquired the subject property in 1981 and then sold it to Anthony Turchin in 1982. According to a taxpayer's appeal form submitted in 1992, the owner states that the salvage yard (the subject property) was subject to litigation for several years regarding allegations by the State of New Hampshire of potential pollution problems, thereby rendering the property substantially valueless (**Appendix G**). Further documentation of this claim was not obtained. The form also states that a fire previously destroyed a portion of the garage building. The date of the fire was not disclosed. A tax form dated 1992 indicated that the subject property was being used as a used car lot named Ernie's Used Cars by renter Ernest McPhail. A letter dated 1997 indicated that the use of the subject property as a truck rental (U-Haul) facility was not an acceptable use according to the zoning regulations. Mr. McPhail reported in an interview that the subject property has been vacant since he stopped operating his business in approximately 2002.

There are no town records available indicating the date of construction of the buildings, but the earliest aerial photo available indicated that at least one building was present in 1951. It is assumed that the subject property was developed sometime between 1939 and 1951.

Although there are gaps in the historical usage of the subject property identified in historical documents, interviews conducted provided additional evidence of historical usage. For a summary of interviews conducted see **Section 8**.

Specific descriptions of the historical records that were reviewed for the subject property are presented below.



Historical USGS Maps

Historical USGS maps dated 1927, 1956, and 1987 were reviewed relative to the subject property. Copies of these historic USGS maps are included with the FirstSearch® report located in **Appendix E.**

Historical USGS Map (Year)	Land Use	Visual Evidence of RECs and/or Bulk Storage or Release of Petroleum Products or Hazardous Substances
1927	Subject property does not appear to be developed.	None
1956	One building appears to be present on the subject property.	none
1987	One building is present on the subject property. Fill appears to have been placed in the Winnipesaukee River.	Filling in the areas adjacent to the Winnipesaukee River.

Aerial Photographs

Historical aerial photographs of the subject property and surrounding area dated 1951, 1956, 1985, 1998, and 2009 were reviewed relative to the subject property. Copies of these historic aerial photographs are included in the FirstSearch® report located in **Appendix E.**

Aerial Photograph (Year)	Land Use	Visual Evidence of RECs and/or Bulk Storage or Release of Petroleum Products or Hazardous Substances
1951	Subject property appears to be developed with at least one building present.	None
1956	Subject property is developed with two buildings present.	None
1985	Subject property is developed with two buildings present. Fill appears to have been placed in the Winnipesaukee River.	Filling in the areas adjacent to the Winnipesaukee River.
1998	Subject property is developed with two building present.	Multiple automobiles appear to be present on the subject property.
2009	Subject property is developed with two buildings present.	None



Ownership Records

Ownership records were examined at the Tilton Town Hall and online at the Belknap Country Registry of Deeds website.

Owner	Date	Evidence of RECs and/or Bulk Storage or Release of Petroleum Products or Hazardous Substances
G.H. Tilton & Son Company	Unknown	Unknown
Elmer & Lillian Tilton	Unknown to 5/3/1939	Unknown
Hampshire Oil Company	5/3/1939 to 6/25/1947	Likely used as a gas station
Forrest Glines	6/25/1947 to 11/16/1967	Unknown
Robert & Joan Jordan	11/16/1967 to 11/8/1973	Unknown
Gladys & George Rafaelly	11/8/1973 to 7/19/1978	Unknown
Richard & Joan Downs	7/19/1978 to 6/26/1981	Unknown
Iona Savings Bank	6/26/1981 to 6/21/1982	Unknown
Anthony Turchin (Estate)	6/21/1982 to present	Auto Repair

Town Directories

Town Directories dated 1961, 1966, 1992, 1995, 2000, 2004, 2006, and 2010 were reviewed for the subject property. The Town Directory summary is included in the FirstSearch® report, which is located in **Appendix E**.

Historical Directory (Year)	Property Occupants	Evidence of RECs and/or Bulk Storage or Release of Petroleum Products or Hazardous Substances
1961	Chretien's Grocery*	
1966	Vacant*	
1992		None
1995	Subject Property not Listed.	
2000		
2004	Ernie's Used Car Sales & Service	Use of property as an auto sales and repair shop.
2006	Subject Property not listed	None
2010	Subject Property not listed.	None

^{*}It should be noted that Town Directories from 1961 and 1966 list the subject property address as Main Street, not East Main Street. It is likely that the Town Directory for these two years is referring to a property other than the subject property.



Sanborn Fire Insurance Maps

Sanborn fire insurance maps dated 1923, 1929, 1937, and 1948 were reviewed for the subject property. Copies of these historic maps are included in the FirstSearch[®] report, which is located in **Appendix E**.

Sanborn Map (Year)	Land Use	Evidence of RECs and/or Bulk Storage or Release of Petroleum Products or Hazardous Substances
1923		
1929	Vacant	None
1937		None
1948		

6.2 STATE ENVIRONMENTAL REVIEW

The NHDES maintains an online OneStop Environmental Site Information database, which includes information for USTs, ASTs, solid waste facilities, inactive asbestos disposal sites, hazardous waste generators, uncontrolled hazardous waste sites, remedial programs, and remediation and initial response spill sites. The following provides the results of the State of New Hampshire database search for the subject property.

Site Remediation and Initial Response Spill Sites

The State of New Hampshire, through the NHDES, maintains a list of all petroleum and hazardous material remediation and initial response spill sites. The subject property is listed in the site remediation database as NHDES Site #199311019. The risk level associated with the site is listed as "no sources/no ambient groundwater quality standard (AGQS) violations". The site eligibility is listed as "not eligible (admin. action)", which was determined on January 1, 1960.

Underground or Aboveground Storage Tanks Listing

The subject property is listed on the NHDES UST database as Facility ID #0114478. According to records, four USTs were registered with the NHDES on August 11, 1993. Consistent with documents provided by the NHDES, three (3) 1,000-gallon gasoline USTs and one (1) 1,000-gallon waste oil UST were removed from the subject property on September 15, 1993. A sketch provided with the tank closure report form indicated that the gasoline USTs were located under the pavement in the northeast corner of the subject property and the waste oil UST was located next to the northeast corner of the garage building. The report indicated that groundwater was encountered during tank removal. A photoionization detector (PID) reading of 165 ppm was reportedly recorded during tank removal. Approximately 30 cubic yards of contaminated soil was removed from the subject property and the UST graves were backfilled. According to the report, all four tanks had holes in them when they were removed. The report indicates that



limited soil samples were collected at the time of tank removal because future site characterization was to be requested. No documentation was found regarding additional characterization of the subject property. The available UST documentation is included in **Appendix F**.

In addition, though not listed on the OneStop Environmental Site Information database, one 275-gallon fuel oil AST was observed on the subject property during the August 26, 2010, site visit. The reported location of the former USTs and the location of the existing AST are depicted on **Figure 2**.

State Brownfields Program

Brownfields sites are defined under the federal Brownfields law, known as the Brownfields Revitalization Act of 2002, as "real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant." The law further defines the term to include a site that is: "contaminated by a controlled substance; contaminated by petroleum or a petroleum product excluded from the definition of 'hazardous substance'; or mine-scarred land."

NHDES has several Brownfields initiatives including the NH Brownfields Covenant Program, the NH Brownfields Assessment program, and the NH Brownfields Cleanup Revolving Loan Fund.

Under these three programs, NHDES maintains lists of active Brownfields sites, closed Brownfields sites, and sites participating in the Brownfields Covenant Program. According to information obtained from the NHDES Brownfields Program website, "active" Brownfields sites are sites contained in the contaminated sites inventory that meet the definition of a Brownfields site under the federal Brownfields Revitalization Act of 2002. In addition, some sites included on the active list have entered the program by being assessed through participation in one of the many other EPA-funded Brownfields programs throughout New Hampshire. Sites denoted as active are not yet cleaned up to NHDES satisfaction. Closed Brownfields sites are sites contained in the contaminated sites inventory that have been cleaned up and brought to resolution under the site cleanup program, and have participated in one or more NHDES Brownfields initiatives or generally meet the definition of a Brownfields site. Sites participating in the Brownfields Covenant program are seeking covenants "not-to-sue" from the State of New Hampshire.

This Phase I ESA is currently being completed as part of the Lakes Region Planning Commission's Brownfields Program. While the subject property is not listed on the State's list of Active or Closed Brownfields Sites as of the date of this report, it will likely be listed as an Active Brownfields Site following the completion of this Phase I ESA.



Solid Waste Facilities

According to the NHDES OneStop database, the subject property is not listed as a solid waste facility.

6.3 FEDERAL ENVIRONMENTAL REVIEW

The EPA maintains a number of databases that track properties and facilities that are regulated under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA), the Resource Conservation and Recovery Act (RCRA), the Emergency Response Notification System (ERNS), and the Federal Institutional Control/Engineering Control (IC/EC) database.

CERCLA Sites

CERCLA is a federally established program that created a fund to identify hazardous waste sites for remediation. The fund is known as Superfund. The Comprehensive Environmental Response, Compensation Information System (CERCLIS) list is a compilation of known and/or suspected uncontrolled or abandoned hazardous waste sites that are eligible for funding under Superfund. The Superfund program includes Federal Facility sites, short- and long-term cleanup sites, National Priority Listing (NPL) sites, delisted NPL sites, Sites Awaiting NPL Decisions (SAND), and No Further Remedial Action Plan (NFRAP) sites. These are defined below.

- Federal Facility sites are hazardous waste sites where the Department of Defense is the lead agency in the investigation or remediation of the site.
- Hazardous waste sites that do not require a long-term cleanup process are considered short-term cleanups, or "removal actions". Although the cleanup process for these sites may not be as lengthy as for long-term cleanups, these sites may still affect the health and environment of those who live near the site.
- Long-term clean-up sites are often caused by years of polluting and may take several years, even decades, to remediate. The most serious uncontrolled or abandoned hazardous waste sites identified as candidates for long-term clean up are listed on the NPL.
- The database of delisted NPL sites lists those sites where no further response is appropriate and the site may be deleted from the NPL.
- SAND sites have had site assessments performed, but a decision regarding NPL proposal has
 not been recorded. SAND sites include sites that have been assessed by the Superfund
 program, are now being addressed under state program authorities, or are in various stages of
 assessment and cleanup by federal or state agencies.
- The No Further Remedial Action Plan (NFRAP) list is a database of archive designated CERCLA sites that, to the best of the EPA's knowledge, assessment has been completed and the EPA has determined that no further steps will be taken to list that site on the NPL.



According to the FirstSearch[®] report, the subject property is not listed as an NPL, Federal Facility, SAND, CERCLA or NFRAP facility.

RCRA Sites

Sites listed in the EPA RCRA database are sites that are hazardous waste treatment, storage, and disposal (RCRA TSD) facilities, or generate small or large quantities of hazardous wastes (RCRA GEN).

Accidents or other activities at RCRA facilities can result in the release of hazardous waste or hazardous constituents to the environment. The RCRA Corrective Action program (CORRACT) requires these facilities to conduct investigations and cleanup actions as necessary. Facilities under the CORRACTs program need to implement necessary corrective action as part of the process to obtain a permit to treat, store, or dispose of hazardous waste.

According to the FirstSearch® report, the subject property is not listed as a RCRA generator facility, RCRA TSD facility, or a CORRACT facility.

ERNS Sites

The Emergency Response Notification System (ERNS) was a database used to store information on notifications of petroleum product discharges and hazardous substances releases. The ERNS program is a cooperative data sharing effort among the EPA Headquarters, the New Hampshire Department of Transportation (NH DOT) Research and Special Programs Administration's John A. Volpe National Transportation Systems Center, other NH DOT program offices, the ten EPA Regions, and the National Response Center (NRC). The ERNS website was redesigned and the data now resides at the NRC. The primary function of the NRC is to serve as the sole national point of contact for reporting all oil, chemical, radiological, and biological discharges into the environment anywhere in the United States and its territories.

The subject property is not listed as an NRC/ERNS facility.

Federal IC/EC

The Federal Institutional Control/Engineering Control (Federal IC/EC) is a database of Superfund sites that have either an engineering or institutional control to limit exposure to contamination remaining on a site.

According to the FirstSearch® report, the subject property is not listed as a Federal IC/EC site.

6.4 ENVIRONMENTAL LIENS

A third party, such as a state or federal government agency, may place environmental liens on a property in order to recover clean-up costs that were incurred by that third party. The existence of a recorded environmental clean-up lien on a property is an indication that environmental



conditions either currently exist or previously existed on a property. The existence of an environmental clean-up lien could be considered an indicator of potential environmental concerns, and could be a basis for additional environmental investigations on the subject property to determine the potential existence of ongoing or continued releases of petroleum products and/or hazardous substances.

The records review and user interviews conducted as part of this Phase I ESA identified no environmental liens for the subject property.

6.5 INSTITUTIONAL CONTROLS

Institutional controls or environmental-related covenants for a property are put in place to minimize the potential for human exposure to existing environmental conditions on that property by limiting land or resource use. Types of institutional controls may be referred to as land-use controls, or activity and use limitations, and these controls may be in the form of deed restrictions, zoning restrictions, building or excavation permits, well drilling prohibitions, easements, or covenants. A property owner wishing to maintain liability protections under state or federal law must comply with any existing land use restrictions and maintain any existing institutional control employed at the site in connection with a response action.

The local, state, and federal records reviews and user interviews conducted as part of this Phase I ESA identified no institutional controls/engineering controls for the subject property.



7. AREA RECORDS REVIEW

Files at the Tilton Fire Department, NHDES Onestop online database, and the USEPA Region 1 were reviewed to obtain information concerning incidents involving releases of petroleum products or hazardous substances in the area of the subject property. In addition, a FirstSearch® environmental database search was conducted on August 30, 2010, and is included as **Appendix** E. This research should not be considered inclusive of all regulatory records, but only those records that were publicly available, practically reviewable and reasonably ascertained.

7.1 HISTORICAL USE RECORDS

ASTM standards for Phase I ESAs require that historical records for surrounding properties be searched for information concerning adjacent land use.

Historical USGS Maps

Historical USGS maps dated 1927, 1956, and 1987 were reviewed relative to the surrounding area. These maps indicate the area surrounding the subject property has been developed since at least 1927. The use of the area appears to be mixed residential, commercial, and undeveloped. No evidence of bulk storage or releases of petroleum products and/or hazardous substances was observed on these maps. Based on information presented on these maps, potential filling of wetlands on the westerly abutting property may have occurred between 1957 and 1987. Copies of these historic USGS maps are included with the FirstSearch® report located in **Appendix E**.

Aerial Photographs

Historical aerial photographs of the surrounding area dated 1951, 1956, 1985, 1998, and 2009 were reviewed relative to the surrounding area. These photos characterize the usage of the area surrounding the subject property as mixed residential and commercial. No evidence of bulk storage or release of petroleum products and/or hazardous substances was observed in these photographs. Potential filling of wetlands on the westerly abutting property may have occurred between 1956 and 1985. Copies of these historic aerial photographs are included with the FirstSearch® report located in **Appendix E**.

Sanborn Fire Insurance Maps

Sanborn maps dated 1889, 1994, 1899, 1904, 1912, 1923, 1929, 1937, and 1948 were reviewed relative to the surrounding area. No evidence of bulk storage and/or release of petroleum products and/or hazardous substances was observed on these maps. Copies of the Sanborn maps are included with the FirstSearch® report in **Appendix E**.

Town Directories

Town Directories dated 1961, 1966, 1992, 1995, 2000, 2004, 2006, and 2010 are available for Tilton. According to the directories, surrounding property occupants have historically been residential and commercial. No typical high-risk uses of area properties are listed in the Town



Directory with the exception of the Cumberland Farms gas station and convenience store located at 235 Main Street. Upon review of the location of the store, it is situated downgradient from the subject property and; therefore, there is a low potential that conditions associated with this filling station have affected the environmental conditions of the subject property. The Town Directory summary is included in the FirstSearch® report located in **Appendix E**.

7.2 STATE ENVIRONMENTAL REVIEW

State Spill Sites

According to the FirstSearch® report and review of the NHDES Onestop database, three (3) spills were reported to the NHDES for properties in the vicinity of the subject property. Upon review of the location of the spills, only one of the spills was located within the 0.50-mile approximate minimum search distance. The spill is identified as the Hillside Mobile Home Park in Northfield, NH (NHDES#199908028). On March 14, 2007, approximately 150-gallons of No. 2 fuel oil was reportedly released from an aboveground storage tank. Absorbents were used to collect the free product and approximately 11.8 tons of contaminated soil was removed from the property. This spill is hydraulically separated from the subject property by the Winnipesaukee River and it is unlikely that this release has impacted environmental conditions at the subject property.

Master Underground Storage Tanks Listing

According to FirstSearch® report and NHDES Onestop online database, there are no registered USTs located adjacent to the subject property.

Leaking Underground Storage Tanks Listing

According to FirstSearch[®] report and NHDES Onestop online database, there are three properties located within the 0.50-mile approximate minimum search distance which have documented leaking USTs. These properties are listed below:

Cumberland Farms, 235 East Main Street, Tilton, NH (1,100-ft (SW))

DES Site Number: 199801011 DES Facility ID: 0111506

Big Apple Convenience Store, 148 Main Street, Tilton, NH (1,800-ft (SW))

DES Site Number: 199106008 DES Facility ID: 011848

Tilton School, School Street, Tilton, NH (1,500-ft (W))

DES Site Number: 199408027 DES Facility ID: 0112577



It is not anticipated that leaking USTs on these properties have impacted the environmental conditions of the subject property because they are either located downgradient of the subject property or are hydraulically separated from the subject property by the Winnipesaukee River.

State Brownfields Program

According to the NHDES lists of Brownfields sites reviewed on-line during this Phase I ESA, no active, closed, or Brownfields covenant sites are located within the 0.5 mile approximate minimum search distance of the subject property.

Solid Waste Facilities

Based on a review of the NHDES Onestop online database of solid waste facilities, no solid waste facilities are located within a 0.5-mile radius of the subject property.

Hazardous Waste Generators

Based on a review of the NHDES Onestop online database of hazardous waste generators, no hazardous waste generators are located adjacent to the subject property.

7.3 FEDERAL ENVIRONMENTAL REVIEW

CERCLA Sites

According to EPA database information, no properties located within the 1.0-mile approximate minimum search distance of the subject property are currently listed on the NPL. No CERCLA sites are located within a 0.5-mile approximate minimum search distance of the subject property.

RCRA and RCRA CORRACTs

According to EPA database information, no RCRA TSD facilities are located within the 0.5-mile approximate minimum search distance of the subject property. No CORRACT facilities are located within the 1.0-mile approximate minimum search distance of the subject property. No RCRA Hazardous Waste Generators have been, or are currently located adjacent to the subject property.



8. INTERVIEWS

In accordance with ASTM E 1527-05 Chapters 10 and 11, interviews with past and present owners, operators, and occupants of the facility were conducted, for the purpose of gathering information regarding the potential for RECs at the site. The following presents summary of the findings of these interviews.

8.1 PAST AND PRESENT USER(S), OWNER(S), AND OCCUPANT(S)

8.1.1 Users

Winnipesaukee River Trails Association

Ms. Carolyn Hurst, a representative of a *user* of this Phase I ESA, was interviewed to obtain information about the *user's* knowledge of the subject property in regards to identifying RECs. Ms. Hurst indicated that she is aware of rumors of environmental concerns at the subject property, but she does not have firsthand knowledge of any environmental issues.

Lakes Region Planning Commission

Mr. Kimon Koulet, a representative of a *user* of this Phase I ESA was interviewed to obtain information about the *user's* knowledge of the subject property in regards to identifying RECs. Mr. Koulet indicated that he has no knowledge of environmental issues at the subject property.

8.1.2 Past Owners, Operators, and Occupants/Key Site Manager

The previous two owners of the subject property are deceased and the current executor of the estate declined to discuss the subject property. Mr. Ernest Mcphail was the last occupant of the subject property when it was used as a used car sales lot (Ernie's Used Cars). Mr. Mcphail was identified as the key site manager and was interviewed to obtain information concerning the subject property in regards to identifying RECs. Mr. Mcphail occupied the subject property in the late 1990s and early 2000s. He reported that he only used the outside lot and did not use the buildings, which were in poor condition at the time. Mr. Mcphail reported that he rented the subject property from Mr. Anthony Turchin and that the subject property was used as an auto repair shop prior to his occupancy. He reported that a gas station occupied the subject property many years ago and that the gasoline tanks have been removed from the subject property. Mr. Mcphail reported that the tanks did not leak when they were removed (however this was contradicted by the tank removal report). Mr. Mcphail reported that the subject property was used for dumping of miscellaneous debris (including auto parts and tires) and solid waste by local residents. At one time a large quantity of waste tires had reportedly accumulated on the subject property. According to Mr. Mcphail, many of the tires have since been removed. Mr. Mcphail reported that he left the subject property in 2002 and believes it has been vacant since.



8.2 STATE AND/OR LOCAL GOVERNMENT OFFICIALS

Town of Tilton Assessors and Code Enforcement Office

A clerk at the Town of Tilton Tax Assessor's Office provided records specific to the ownership of the subject property. Current tax cards and tax payer's appeals forms were obtained. Tax cards indicated that the subject property was used as an automobile sales and repair shop and that the garage contained an oil furnace, a woodstove, and a hydraulic lift. A tax payer's appeals form dated 1992 indicated that the subject property was used as an automobile salvage yard and that it was subject to litigation for several years regarding allegations by the State of New Hampshire of potential pollution problems, therefore rendering the subject property substantially valueless. No further information regarding this claim was found.

The Town of Tilton Code Enforcement Officer, Mr. Al LaPlante, was interviewed on August 31, 2010, to obtain information about historic use of the subject property as it concerns identification of RECs. Mr. LaPlante was born and raised in Tilton and remembers that a Gulf gasoline station occupied the subject property until approximately the early 1970's. Mr LaPlante also remembers the subject property being used as a car dealership when the gas station closed. According to Mr. LaPlante, the former stream running along the western side of the subject property was filled approximately six years ago. Mr. LaPlante reports that it is likely that the filled areas adjacent to the stream were at one time wetlands.

Town of Tilton Conservation Commission

The Chairman of the Tilton Conservation Commission, Mr. Chuck Mitchell, was interviewed on September 10, 2010, to obtain information about historic uses of the subject property as they relate to the identification of RECs. Mr. Mitchell has been a resident of Tilton since 1976. He remembers that a gas station and repair shop operated on the subject property in the 1970s. He reports that a lift was present in the garage. Mr. Mitchell reported that USTs were present on the subject property. He had heard from Town officials that at least some of the tanks have been removed, but he is not sure that all tanks have been removed. Mr. Mitchell expressed concerns of environmental contamination at the subject property due to the documented history of the Turchin family improperly disposing of waste at other properties in Tilton.

Town of Tilton Fire Department

The Tilton Fire Department was contacted on August 31, 2010, to provide information concerning current and historical bulk storage and/or releases of petroleum products and/or hazardous substances at the subject property and at the properties in the vicinity. According to personnel of the department, no files were found in their database indicating any environmental incidents at the subject property. The fire department provided no information regarding bulk storage, USTs, or ASTs on the subject property or at properties within the vicinity of the subject property. No record of the fire which reportedly occurred at the subject property, as referenced in documents obtained from the Town of Tilton Assessors and Code Enforcement Office, was obtained from the Tilton Fire Department.



DRAFT

8.3 LOCAL RESIDENTS

Owner of Neighboring Property

On August 31, 2010, Mr. Bill Jocelyn was interviewed to obtain information concerning past and present uses of the subject property in regards to identifying RECs. Mr. Jocelyn has lived in close proximity to the subject property for many years. He reported that he has firsthand knowledge that cars and car parts have been buried on the subject property. No additional pertinent information was provided by Mr. Jocelyn.



9. ADDITIONS, EXCEPTIONS, AND DEVIATIONS

According to Chapter 12.13 of ASTM E 1527-05, all additions and deviations from this practice shall be listed individually in detail. This includes any client-imposed constraints. In this regard, the following additions and deviations to this practice were identified:

Additions

The following ASTM Non-Scope considerations were added (see **Section 10**) to Credere's scope of work as a part of this Phase I ESA:

- Radon
- Asbestos
- Lead Based Paint
- PCB-Containing Equipment
- Wetlands

These were included as a part of this Phase I ESA because they are deemed to add value for assessments conducted under the LRPC Brownfields Program.

Exceptions and Deviations

No exceptions or deviations were made during the creation of this report.



10. ASTM NON-SCOPE CONSIDERATIONS

The following is a discussion of findings made during this Phase I ESA as it relates to items not included within the scope of ASTM E 1527-05.

10.1 ASBESTOS

Asbestos is a heat-resistant, naturally occurring mineral that breaks into fibers. Asbestos is the generic term for six different types of minerals. Some forms of asbestos are highly toxic by inhalation of dust particles. Past uses of asbestos include pipe and boiler insulation, fire and soundproofing, brakes, gaskets, floor tiles, roofing materials, window caulk, cement products, curtains, and water pipes.

A formal asbestos survey was <u>not</u> included in Credere's scope of services for this Phase I ESA. Asbestos containing materials are not included within requirements of ASTM E 1527-05 for the Phase I ESA process, unless the asbestos containing material is found in its waste form. However, recognizing the age of the buildings on the subject property, which were both constructed prior to 1978, the potential exists for asbestos to be present. In addition, it should be noted that potential asbestos containing materials including ceiling tiles, roof shingles, and insulation were observed in both buildings during the site reconnaissance.

10.2 LEAD-BASED PAINT

Lead is toxic by ingestion and inhalation of dust or fumes. Health effects are generally correlated with blood test levels. Infants and young children absorb ingested lead more readily than older children and young adults. Primary exposure routes include lead paint, lead solder and pipes in drinking water lines, and air quality in inner Town settings. Lead paint testing is typically warranted for residential properties constructed prior to 1978 and properties where children spend a significant amount of time, such as a daycare facility.

A formal lead-based paint survey is <u>not</u> within the scope of services; however, recognizing the age of the buildings on the subject property, which were both constructed prior to 1978, the potential exists for lead-based paint to be present.

10.3 RADON

Credere has included the general information pertaining to radon for informational purposes only. The US Environmental Protection Agency (EPA) has prepared a map to assist National, State, and local organizations to target their resources and to implement radon-resistant building codes. The map divides the country into three Radon Zones. Zone 1 is those areas with the average predicted indoor radon concentration in residential dwellings exceeding the EPA Action limit of 4.0 Pico Curies per Liter (pCi/L), Zone 2 is where average predicted radon levels are between 2.0 and 4.0 pCi/L, and Zone 3 is where average predicted radon levels are less than 2.0 pCi/L.



It is important to note that the EPA has found homes with elevated levels of radon in all three zones, and the EPA recommends site specific testing in order to determine radon levels at a specific location. However, the map does give a valuable indication of the propensity of radon gas accumulation in structures.

Review of the EPA Map of Radon Zones places the subject property in Zone 2, where average predicted radon levels are between 2.0 and 4.0 pCi/L/. A subgrade crawlspace is present under the garage building. The crawlspace is open to the outside and the building is currently vacant; therefore, radon is not expected to be a concern at the subject property at this time. Recognizing that the subject property lies in Zone 2, but gets potable water from the public water supply which is tested for radon, the presence of radon in drinking water is not expected to be a concern at this time.

10.4 NON-SCOPE PCB-CONTAINING EQUIPMENT AND MATERIALS

During the site reconnaissance, Credere noted the following non-scope equipment/materials on or adjacent to the subject property that either likely contain PCBs, or are known to possibly contain PCBs:

• Prior to 1978, fluorescent light ballasts were commonly manufactured with PCBs in the capacitor oil and in a tar-like substance that surrounds ballast components called "potting compound." Ballasts made after 1978 are usually marked "Non-PCB." Fluorescent light fixtures were observed to be installed inside both of the garage building and stored inside the cottage. An additional lighting fixture was observed on the ground outside of the cottage. Based on the apparent age of the structure, the potential exists for PCBs to be present in the lighting fixtures observed at the subject property.

10.5 WETLANDS

A formal wetland survey was <u>not</u> included in the scope of work for this Phase I ESA. However, the US Fish and Wildlife Services National Wetlands Inventory locates a wetland at the southern edge of the subject property (the Winnipesaukee River), identified as Riverine, Lower Perennial, Unconsolidated Bottom, and Permanently Flooded. Due to reported filling on the south and west sides of the subject property, it is possible that wetlands adjacent to the Winnipesaukee River have been destroyed at the subject property. According to the USGS topographical map dated 1987, a stream was present on the adjacent property to the west. According to interviews, the stream was filled and rerouted via the 48-inch diameter culvert in approximately 2004. Although the stream was not located within the boundary of the subject property, it is possible that wetlands adjacent to the stream were located within the subject property boundary and may have been filled.



11. DATA GAPS

ASTM E 1527-05 Chapter 12.7 requires the identification of data gaps that may affect our ability to identify potential environmental conditions on the subject property, to further identify the sources of information consulted to attempt to fill these data gaps, and the significance of the data gap with regard to the ability to identify potential environmental conditions onsite.

Specific information on the use of the subject property from historical records review was not obtained for five year intervals from 1939 to 1967 and from 1967 to 1978, representing data gaps. However, these data gaps are not considered data failure because interviews indicate that the use of the subject property as a gas station remained the same during the 1939 to 1967 interval and the use of the subject property as an automobile repair shop remained the same between 1967 and 1978.

The basement of the garage was not entered because of the poor structural condition of the building, representing a data gap. This data gap represents data failure because evidence of RECs that may have been present in the basement was not able to be identified.

A representative of the current owner of the subject property declined to be interviewed as a part of this Phase I ESA which represents a data gap. However, as the current owner is reportedly not familiar with the subject property, it is Credere's opinion that this lack of interview does not represent a significant data gap. Furthermore, other interviews provided an adequate history of the subject property.



12. FINDINGS AND OPINIONS

The following is a summary of relevant environmental findings concerning the subject property, and Credere's professional opinion concerning these findings:

- Based on DES records, three (3) 1,000-gallon gasoline USTs and one (1) 1,000-gallon waste oil UST were previously removed from the subject property. Tank closure reports indicate that the tanks had holes in them and that soil around the tanks was contaminated. Approximately 30 cubic yards of contaminated soil was reportedly removed from the subject property during the tank removal. The report indicated that groundwater was encountered during tank removal, but the condition of the groundwater was not discussed. Based on these circumstances and due to the lack of adequate environmental data concerning soil and groundwater conditions following the removal, there is a possibility that environmental conditions at the subject property have been impacted from these former USTs.
- Based on interviews and the review of local and state documents, the subject property was
 used as a gas station during the estimated time frame of 1939 to the 1970s. It is possible that
 environmental conditions at the subject property have been affected by this former use.
 Furthermore, there is an increased potential for adverse environmental impacts associated
 with gas stations which operated during this timeframe (i.e. prior to current regulatory
 guidance and best practices).
- Based on interviews and the review of local and state documents, the subject property was
 previously used as an automotive repair shop and salvage yard. The historic use of the
 subject property as an automotive repair and salvage yard, including the operation of a
 hydraulic lift, may have impacted environmental conditions at the subject property because
 petroleum products and hazardous substances were likely stored, used, and may have been
 disposed of on the subject property.
- During the site visit one (1) floor drain was observed in the concrete floor of the garage bay. It is possible that the floor drain is connected to the municipal sewer system; however, the exact outlet for the floor drain is not known. This floor drain represents a potential conduit to the environment for petroleum products and/or hazardous substances which may have been released within the garage building. Based on the lack of information about the floor drain combined with the nature of the documented activities which historically occurred within the garage, the potential for soil and/or groundwater impact resulting from the floor drain system cannot be dismissed.
- Multiple small petroleum stains were observed during the site visit on the gravel parking lot.
 Though additional investigation would be required to define the extent of the identified
 stained areas, based on observed conditions it is likely that these stains are associated with
 oil and gas dripping from automobiles that were parked on the subject property and not the
 result of a sudden release of oil and/or hazardous materials.
- One (1) 55-gallon drum with unknown contents was observed on the subject property. As this drum is located outside in an uncontrolled access area and due to the lack of knowledge



of the handling, condition, and contents of the drum, the potential for a release from the drum to the environment cannot be dismissed.

- Multiple debris piles were observed throughout the subject property. These piles included discarded items such as car parts, tires, appliances, plastic, scrap metal, automobile batteries, oil containers, household trash, scrap wood, and wooden utility pole sections. These conditions indicate that the subject property has been used as a dumping area for a significant period. It is Credere's opinion that the potential for a release of petroleum products and/or hazardous substances from materials contained within the debris piles cannot be dismissed.
- The southern portion of the subject property appears to have been filled with material consisting of waste concrete, brick, pavement, and gravel. Documents obtained from the Town of Tilton confirm that filling took place along the bank of the Winnipesaukee River in the 1960s. It is Credere's opinion that, due to the lack of knowledge of the contents, source, and extent of the fill material, the potential for contamination associated with this fill cannot be dismissed.
- According to tax records, a fire destroyed a portion of the garage prior to 1992. No evidence
 of a release of petroleum products or hazardous substances associated with a fire was
 observed during the site visit. The Tilton Fire Department did not have any records of the
 incident on file.
- One pole-mounted electrical transformer was observed on the subject property. No labeling
 indicating the PCB concentration, if any, of dielectric fluid contained within this transformer
 was observed. According to PSNH, the transformer was manufactured in 1960. Based on
 the manufacture date of this transformer, it is possible that the associated dielectric fluid
 contains concentrations of PCBs. Stressed vegetation was observed below the transformer
 and may have been caused by a release from the transformer.



13. CONCLUSIONS

We have performed this Phase I ESA in conformance with the scope and limitations of the ASTM Practice E 1527-05 of the Turchin Estate Property located at 180 East Main Street, Tilton, New Hampshire. Any exceptions to, or deletions from, this process were described in **Section 9** of this report. This assessment has revealed no evidence of *recognized environmental conditions* in connection with the *subject property* except for the following:

- REC-1 The former use of the subject property as a gas station between 1939 and the 1970s represents a REC because past and present bulk storage and past distribution of petroleum products during this time frame may have resulted in releases of petroleum which may have impacted the environmental conditions of the subject property.
- REC-2 The documented release of petroleum discovered on September 16, 1993, during the closure of three (3) 1,000-gallon gasoline USTs and one (1) 1,000-gallon waste oil UST represents a REC because Credere's research indicates that additional environmental work is required by the New Hampshire Department of Environmental Services (NHDES) to document if impacted environmental media remain at the subject property following the UST closures.
- REC-3 The former use of the subject property as an auto repair facility between the approximate dates of 1939 and 1978 represents a REC because hazardous materials and petroleum products were likely stored, used, and may have been disposed of on the subject property and may have impacted the environmental conditions of the subject property.
- REC-4 At least one (1) floor drain was observed within the garage bay with an unknown discharge point. This condition represents a REC because the drain is a potential conduit to the environment whereby releases of petroleum products and hazardous substances from former activities may have impacted the environmental conditions at the subject property.
- REC-5 A suspected dump and fill area was observed along the southern portion of the subject property including items such as, but not limited to, urban fill, automobile parts, and utility pole sections. Petroleum products and/or hazardous substances associated with these materials may have been released and impacted the environmental conditions at the subject property.
- REC-6 Stressed vegetation was observed below the pole mounted electrical transformer located along the northern subject property boundary. This condition represents a REC because it could be indicative of a release of petroleum-based and/or polychlorinated biphenyl (PCB)-containing dielectric fluid that may have impacted the environmental conditions of the subject property.

Additionally, Credere identified three (3) *de minimis* environmental conditions (DMEC) at the subject property.



- DMEC-1 Oil staining observed on the floor of the cottage represents a DMEC because it is evidence of a release; however, a pathway to the environment is not likely.
- DMEC-2 Multiple containers of oil, gasoline, and automotive lubricants and cleaning materials represent a DMEC because of the poor condition in which they were stored; however, a pathway to the environment is not likely.
- DMEC-3 Multiple stains observed on the gravel parking lot represent a DMEC because they are evidence of small petroleum releases which may have impacted surficial soil at the subject property. However, based on observed conditions, it is not likely that these small spills have significantly impacted environmental media at the subject property.

The following four (4) ASTM *Non-Scope environmental conditions* (NECs) were also noted during this Phase I ESA:

- NEC-1 Based on the age of the subject property buildings, potential asbestos-containing materials may be present on the interior and exterior of the buildings.
- NEC-2 Based on the age of the subject property buildings, lead-based paint may be present on the interior and exterior of the buildings.
- NEC-3 Based on the age of the subject property buildings, PCB-containing bulk products may be present on the interior and exterior of the buildings.
- NEC-4 Based on the condition of the subject property buildings and the collapsed roof of the garage, mold may be present in the buildings.



14. RECOMMENDATIONS

The ASTM Standards require that the environmental professional determine the degree of obviousness of the presence or likely presence of contamination, releases, or other environmental conditions onsite, and the ability to detect that contamination. Based on the findings of this Phase I ESA, obvious conditions that are indicative of potential contamination or past releases are present at the subject property. In order to maintain *Bona Fide prospective purchaser* liability protection under CERCLA, the seller or purchaser must demonstrate appropriate care, which typically will entail the completion of the following recommendations:

To confirm or dismiss the RECs described above, Credere recommends the following additional work:

- Phase II investigation activities are recommended to confirm or dismiss the above RECs and/or other documented bulk storage or releases of petroleum products and/or hazardous substances that may have impacted the environmental conditions at the subject property.
- An asbestos, lead-based paint, and PCB-containing hazardous building materials survey should be completed to confirm or dismiss the presence of hazardous building materials within the buildings.
- A universal and hazardous waste survey should be completed to inventory universal and hazardous waste which may be present at the subject property.
- If the buildings will be re-used, a mold survey should be completed to identify the presence of hazardous molds within the subject property buildings.



15. REFERENCES

LOCAL RESOURCES

- Town of Tilton Official Website: http://www.tiltonnh.org/
- Town of Tilton Assessors and Code Enforcement Office: Interview, August 30, 2010.
- **Town of Tilton Fire Department:** Interview, August 30, 2010
- **Belknap County Registry of Deeds:** Online database search, August 30, 2010. http://www.nhdeeds.com/belknap/BeIndex.html

NHDES RESOURCES

• NHDES OneStop Environmental Site Information Online Database: http://www2.des.state.nh.us/onestop/

EPA RESOURCES

- **CERCLIS Hazardous Waste Sites:** Information obtained from USEPA website. http://cfpub.epa.gov/supercpad/cursites/srchsites.cfm
- **CERCLIS NFRAP:** Information obtained from USEPA website. http://cfpub.epa.gov/supercpad/cursites/srchrslt.cfm?start=1&CFID=481008&CFTOKEN =69470108&jsessionid=363045257c645c143453TR
- **RCRIS Database:** Information obtained from USEPA website. http://www.epa.gov/enviro/html/rcris/rcris_query_java.html
- **EPA Enforcement and Compliance History Online (ECHO):** http://www.epa-echo.gov/echo/index.html
- **Superfund Database:** NPL, SAND, and SHORT sites. Information obtained from USEPA website. *http://yosemite.epa.gov/R1/npl_pad.nsf/*

ADDITIONAL RESOURCES

- US Fish and Wildlife Service National Wetlands Inventory Wetlands Mapper. http://wetlandsfws.er.usgs.gov/NWI/index.html
- Geological Information:
 - o Geohydrology and Water Quality of Stratified-Drift Aquifers in The Winnipesaukee River Basin, Central New Hampshire, (J.D. Ayotte, 1997)
 - o http://tin.er.usgs.gov/geology/state/state.php?state=NH
- Historical USGS Maps of New England



16. LIMITATIONS

This report has been prepared as part of an agreement between Credere Associates, LLC and LRPC. This agreement was established in order to provide LRPC with information upon which they can rely concerning the existence or likely existence of various environmental contaminants on or adjacent to the subject property.

The report does not provide sufficient information to unequivocally determine that no hazardous waste contamination is present at the subject property. Additional work beyond that completed for this study would be necessary to provide such information. Further, this report is not an audit for regulatory compliance or a detailed condition survey for the presence of asbestos, lead paint, PCBs, radon or any other pollutant specific compound.

Our conclusions regarding the subject property are based on Credere's interpretation of subject property historical land use and on observations of existing subject property conditions during our field reconnaissance visits. The results of this study must be qualified in that no borings, soil or groundwater sampling or chemical testing was conducted as part of this study. Therefore, our conclusions regarding the condition of the subject property do not represent a warranty that the facility, parking areas, adjacent properties, etc., are of the same quality as may be inferred from observable property conditions and readily available property history files.

Credere Associates, LLC performed this Phase I ESA in conformance with the ASTM Standard Practice E 1527-05 and ASTM Standards. No exceptions or significant deviations were made to this practice during the completion of the Phase I ESA.



17. SIGNATURES OF ENVIRONMENTAL PROFESSIONALS

The following individuals performed this Phase I ESA in conformance with ASTM Standard Practice E 1527-05 and AAI Standards. Any work completed on this Phase I ESA by an individual who is not considered an environmental professional was completed under the supervision or responsible charge of the environmental professional listed after the Environmental Professionals Statement provided below.

Silas Canavan, EI Civil Engineer


Environmental Professionals Statement


I declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in §312.10 of 40 CFR 312 and I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set for in 40 CFR Part 312.

Richard S. Vandenberg, CG, PG

Senior Project Manager





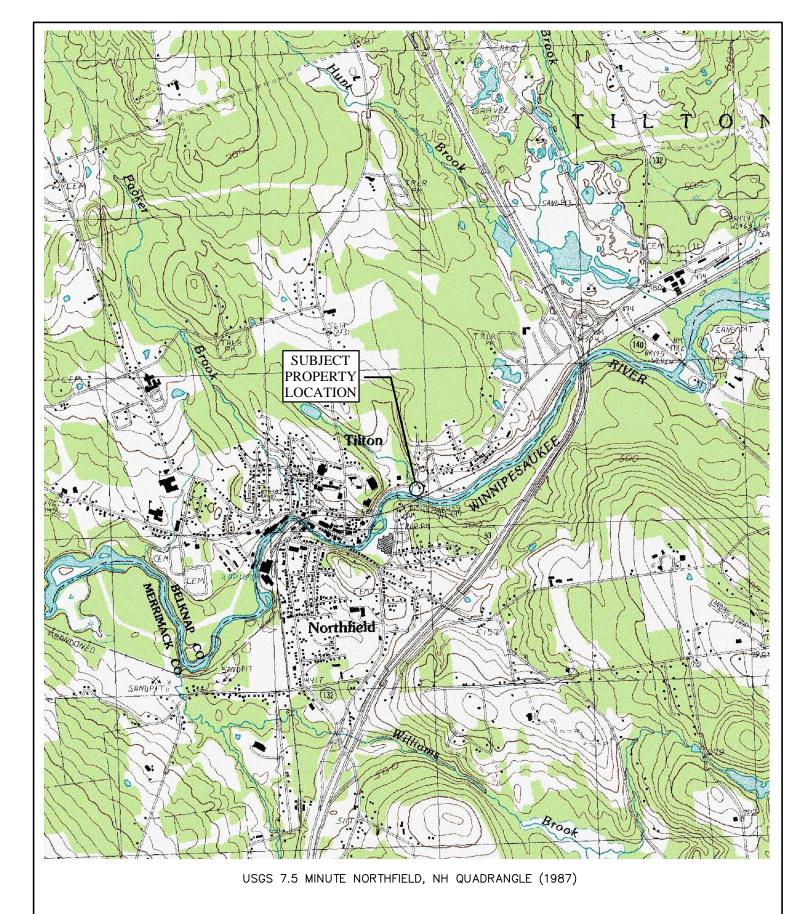


DRAWN BY: SWC DATE: 8/30/10 CHECKED BY: RSV/JSS PROJECT: 10001087


> Credere Associates, LLC 776 Main Street Westbrook, Maine 04092 Tel. (207) 828—1272 www.crederellc.com

FIGURE 1 - SITE LOCATION PLAN

TURCHIN ESTATE
180 EAST MAIN STREET
TILTON, NH
NH DES #199311019

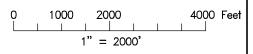



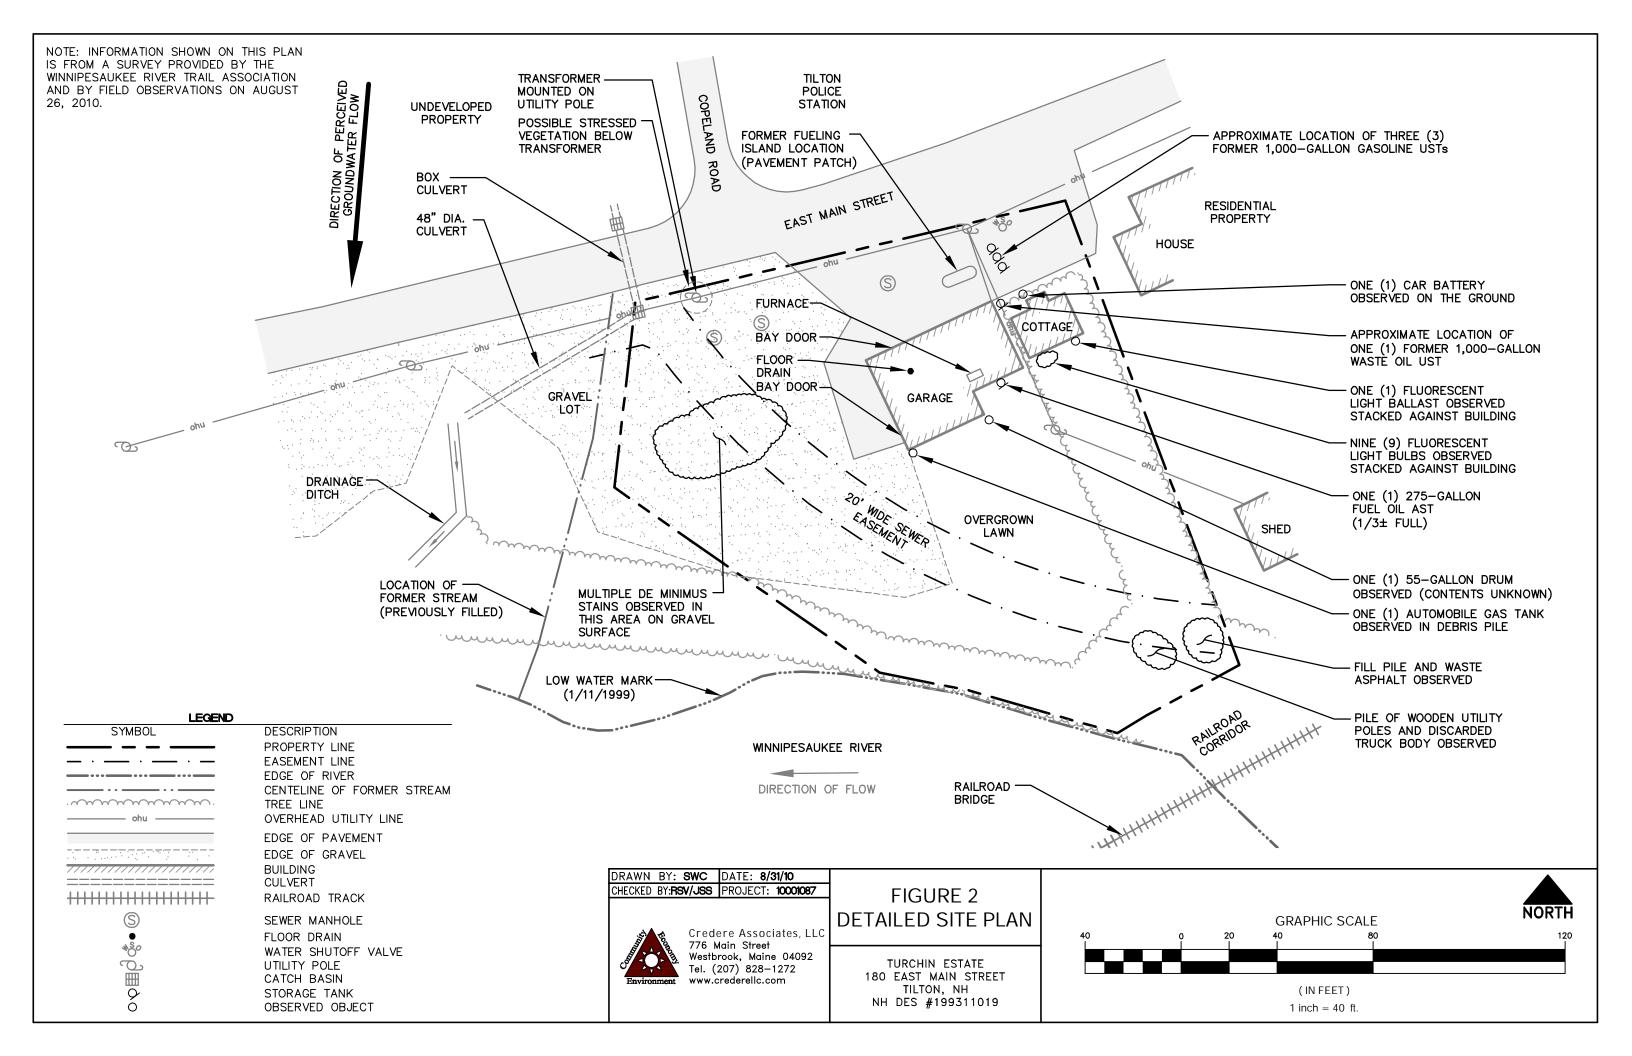

APPENDIX A RESUMES OF KEY PERSONNEL



Richard S. Vandenberg CG,PG Senior Hydrogeologist/Senior Geologist

Credere Associates LLC

PROFESSIONAL REGISTRATIONS

Professional Geologist:

ME #GE452

NH #52

AIPG#9627

TRAINING

- 40 hour, OSHA 29 CFR 1910.120 Hazardous Waste Health and Safety Course and Refresher Course
- 8 hour, OSHA 29 CFR 1910.120 Hazardous Waste Supervisor Health and Safety Course

EDUCATION & PROFESSIONAL ACTIVITIES

- Bachelor of Arts in Geology/chemistry. University of Maine, Farmington, Maine, 1987.
- Graduate work toward Master's of Science in Geology. Fort Hays State University, Hays, Kansas 1987 to 1989.
- New Hampshire Geologist Society Member
- American Institute of Professional Geologist Member

HIGHLIGHTS OF EXPERIENCE

Mr. Vandenberg is a Senior Hydrogeologist with Credere Associates, LLC with over 18 years experience in assessment, investigation, remediation and disposal of petroleum and hazardous wastes, and water related projects. Mr. Vandenberg has managed numerous compliance, assessment, investigation, and remediation projects including Phase I and Phase II environmental site assessments (ESAs), remedial investigations, remedial action planning, 3-D groundwater flow and contaminant transport modeling, groundwater extraction and treatment system design, soil vapor extraction design, soil removals, and insitu chemical oxidation projects for clients across New England. In addition, Mr. Vandenberg has developed water supplies for communities and commercial/industrial water users in New Hampshire, Vermont, and Massachusetts.

ENVIRONMENTAL PROJECTS:

Brownfields

Mr. Vandenberg has conducted Phase I and Phase II assessment and investigation activities for the USEPA-funded Brownfields commercial redevelopment and revitalization program and review Quality Assurance Project Plan Addendums detailing all investigation, sampling, and analytical testing activities that were submitted to, and approved by the Maine DEP and USEPA. Additional activities at Brownfields sites included the development of conceptual site models, completion of redevelopment feasibility studies, and the characterization and remediation of contaminated media. Mr. Vandenberg has managed projects for Southern Maine Regional Planning Commission, Nashua Regional Planning Commission, Rockingham Planning Commission (New Hampshire), and City of Westbrook, Maine. Mr. Vandenberg has been involved with the following projects:

Rockingham Regional Planning Commission Brownfields Assessment Program – So. New Hampshire

Project Manager for the Rockingham Planning Commission (RPC) Brownfields Assessment Program. Project included the inventory of over 400 potential Brownfield sites located within the region, prioritization and selection of sites for Environmental Assessment activities, and completion of Phase I and Phase II investigations, remediation planning, reuse planning, and implementation of remedial actions. Tasks have included development of scope of work, senior technical review of reports, project coordination, property owner education, facilitation of stakeholder meetings, regulatory agency interface, site reconnaissance visits, site master planning, and remedial alternative oversight. Properties assessed or currently being assessed as part of program include the following:

- Hampton Landfill, Hampton, New Hampshire
- Former Shoe Factory, Epping, New Hampshire
- Hammond Auto, Freemont, New Hampshire

Nashua Regional Planning Commission Brownfields Assessment Program – So. New Hampshire

Project Manager for the Nashua Regional Planning Commission (NRPC) Petroleum Brownfields Assessment Program. Project included the inventory of over 300 potential Brownfield sites located within the region, prioritization and selection of sites for Environmental Assessment activities, and completion of Phase I and Phase II investigations, remediation planning, reuse planning, and implementation of remedial actions. Tasks have included development of scope of work, senior technical review of reports, project coordination, property owner education,

Rick Vandenberg, CG, PG Senior Project Manager

Page 2

facilitation of stakeholder meetings, regulatory agency interface, site reconnaissance visits, site master planning, and remedial alternative oversight. Mr. Patten also assisted NRPC in obtaining one additional EPA Brownfields Assessment Grant (\$200k hazardous material) and an EPA Brownfields Cleanup Grant (\$200k for the Nashua Manufacturing Boiler House). Properties assessed or currently being assessed as part of the program include the following:

• Nashua Manufacturing Boiler House, Nashua

Majestic Motors Junkyard, Merrimack

Southern Maine Regional Planning Commission Brownfields Assessment Program – York County, Maine

Senior Technical Reviewer for the Southern Maine Regional Planning Commission (SMRPC) Brownfields Assessment Program. Project included the inventory of over 200 potential Brownfield sites located within the region, prioritization and selection of sites for Environmental Assessment activities, and completion of Phase I and Phase II investigations, remediation planning, reuse planning, and implementation of remedial actions. Tasks have included development of scope of work, senior technical review of reports, project coordination, property owner education, regulatory agency interface, site reconnaissance visits, site master planning, and remedial alternative oversight. Properties assessed or currently being assessed as part of program includes the following:

• Lincoln Mill, Biddeford, Maine

Stenton Trust Mill, Sanford, Maine

• North Dam Mill, Biddeford, Maine

• Riverdam Mill, Biddeford, Maine

Westbrook Brownfields Assessment Program – City of Westbrook, Maine

Project Manager for the Westbrook Brownfields Assessment Program. Project included the inventory of over 50 potential Brownfield sites located within the city, prioritization and selection of sites for Environmental Assessment activates, and completion of Phase I and Phase II investigations, remediation planning, reuse planning, and implementation of remedial actions. Properties assessed or currently being assessed as part of program includes the following:

Larson's Junkyard site

Miscellaneous Brownfields Environmental Assessments and Remedial Investigations

Mr. Vandenberg has performed all phases of environmental site assessments and remedial investigations for the projects mentioned below. Tasks completed include development of scope of work, senior technical review of reports, project coordination, records review for federal, state, and local authorities, site reconnaissance visits, soil and groundwater sampling, and summary report preparation. Representative projects include:

- Global Timber, Hartland, Vermont
- Barre Coal Tar, Montpelier, Vermont







Credere Associates LLC

PROFESSIONAL REGISTRATIONS

Engineering Intern: VT #017.0003271

TRAINING

- △ 40-hour OSHA 29 CFR 1910.120 HAZWOPER Course
- 8-hour OSHA 29 CFR 1910.120 HAZWOPER Refresher (April 2010)

EDUCATION

 B.S. Civil Engineering, 2005 University of Vermont

HIGHLIGHTS OF EXPERIENCE

Mr. Silas Canavan is a Civil Engineer for Credere Associates with over 5 years of professional experience in civil design projects; utility design; local and state project permitting; construction oversight; surveying; hydrologic stormwater modeling; stormwater management, and recent experience with Phase I and Phase II Environmental Site Investigations.

PROJECT EXPERIENCE INCLUDES:

Environmental Site Assessments and Subsurface Investigation

Mr. Canavan has assisted with multiple Phase I Environmental Site Assessments for a variety of commercial, residential and undeveloped sites in Maine and New Hampshire. His responsibilities include performing Phase I and Phase II site investigations, working with federal, state, and local regulatory agencies as part of the regulatory records review, conducting historical research, implementing hazardous waste inventories, and writing reports that specify environmental liabilities. Phase II investigations included release of chlorinated organic compounds, petroleum products, pollutant metals, PCBs, and pesticides to soil and groundwater. Investigation activities conducted and supervised by Mr. Canavan have included soil test pitting, boring, and logging; monitoring well installation; geophysical investigations; environmental field screening and sampling of surficial soils, subsurface soils, and groundwater; and data analysis and interpretation. Mr. Canavan is also proficient in presentation of site data, including Computer Aided Drafting (CAD) and graphical work.

Brownfields

Mr. Canavan has conducted Phase I and Phase II environmental site assessment and investigation activities for USEPA-funded Brownfields sites. Mr. Canavan works closely with Brownfields grant recipients, property owners, developers, and other stakeholders as part of the Brownfields process. Mr. Canavan has worked on Brownfields programs with the Southern Maine Regional Planning Commission, Rockingham Planning Commission, Southern New Hampshire Planning Commission, Greater Portland Council of Governments, Nashua Regional Planning Commission, and Lakes Region Planning Commission.

Representative Brownfields projects include:

- Fred's Auto Site, Candia, NH
- Former Public Works Garage, Windham, ME
- Main Street Fire Station, Gray, ME
- Chapman Junkyard, Brownfield, ME
- Nashua Boiler House, Nashua, NH
- Turchin Estate, Tilton, NH
- Mica Building, Bristol, NH

APPENDIX B CREDERE'S PHASE I SCOPE OF WORK

Credere's LRPC Brownfields Scope of Work

The following is Credere's scope of work for completion of this Phase I ESA conducted in accordance with the ASTM Standard Practice for Environmental Site Assessments: Phase I Process (ASTM 1527-05). The ASTM Standard Practice for Environmental Site Assessments: Phase I Process (ASTM 1527-05) meets the requirements of the Environmental Protection Agency (EPA) Standards and Practices for All Appropriate Inquiries (AAI); Final Rule (40 CFR Part 312).

The objective of conducting a Phase I ESA is to provide a concise liability assessment in order that informed environmental business decisions may be made regarding the subject property. To accomplish this goal, our reports contain a summary that focuses on potential liabilities and presents conclusions and recommendations for confirming or dismissing the concerns and Recognized Environmental Conditions (RECs) identified during the Phase I ESA.

Our Phase I ESA process consists of the following four tasks: (1) records review, (2) site reconnaissance, (3) interviews, and (4) report. Each of these tasks is described in detail below.

Records Review

The purpose of the records review was to obtain and review reasonably ascertainable¹ records that help identify recognized environmental conditions in connection with the property. The following state and federal environmental record sources, with the minimum search distances used for each, are reviewed from USEPA websites, the Maine Department of Environmental Protection (MDEP) online databases, and an environmental records report for the property from FirstSearch Technology Corp:

Source	Minimum Search Distance (mi)
	Search Distance (IIII)
Federal NPL Site List	1.0
Federal CERCLIS List	0.5
Federal RCRA TSD	1.0
Facilities List	
Federal RCRA Generators	Property and Adjoining
List	Properties
Federal ERNS List	Property Only
State Leaking UST Sites	0.5
State Registered UST Sites	Property and Adjoining
	Properties

These records are reviewed for database listings associated with activities identified on the target property, or nearby sites that may have the potential to impact the target

Information that is 1) publicly available, 2) obtainable from its source within reasonable time and cost constraints, and 3) practically reviewable

property. Additional state and local records sources are reviewed to enhance or supplement the federal and state sources identified above. These include:

- Lists of Landfill/Solid Waste Disposal Sites
- Records of Emergency Release Reports
- USGS 7.5 Minute Topographic Map
- Department of Natural Resources Publications
- State Geologic Surveys and Reports
- Fire Department
- County Health Department

Historical records for the subject property and surrounding area are reviewed to determine the previous uses or occupancies of the property and surrounding area to identify those uses or occupancies that are likely to have led to recognized environmental conditions in connection with the property. The following historical records are reviewed:

- Ownership/Lease-Right History
- Aerial Photographs
- Historical USGS Topographic Maps
- Historical City Directories
- Historical Fire Insurance Maps
- Historical Property Tax Assessor, Code Enforcement, and Zoning/Land Use Records
- Previous Environmental Investigations

Historical information contained in any previous environmental site assessments is reviewed, incorporated, and referenced as appropriate.

Site Reconnaissance

The site reconnaissance is performed to obtain information indicating the likelihood of identifying recognized environmental conditions in connection with the target property. The site reconnaissance includes visual and physical observations noted while observing the periphery of the property, the periphery of all structures on the property, all interior spaces of the structure, including maintenance and repair areas, common areas, storage areas, and boiler rooms. Credere notes the presence or absence of the following:

- Storage tanks
- Odors
- Pools of liquid
- Drums
- Identified and/or unidentified substance containers
- Likely PCB-containing transformers or window caulk
- Heating/cooling sources

- Interior stains or corrosion
- Drains and sumps
- Pits, ponds, lagoons
- Stained soil or pavement
- Stressed vegetation
- Solid waste
- Wastewater
- Wells
- Septic systems

Any visual or physical indications of past uses of the property that are likely to involve the use, treatment, storage, disposal, or generation of hazardous substances or petroleum products are noted. Current and/or past uses of adjoining properties and/or the surrounding area to the extent visually or physically observed which are likely to indicate RECs in connection with the adjoining property or property are also noted.

Interviews

Interviews with current and former owners and occupants are conducted to obtain information indicating RECs in connection with the property. The content of questions to be asked shall attempt to obtain information about uses and conditions of items noted during the site reconnaissance and to obtain any environmentally pertinent documents or any threatened, pending, or past: litigation, administrative actions, or notices of violation relevant to hazardous substances or petroleum products in, on, or from the property. Reasonable attempts will be made to interview the property owner, occupant, and/or key site manager.

Interviews with local government officials are conducted to obtain information indicating RECs in connection with the subject property. Reasonable attempts are made to interview a staff member of the following types of local government agencies: fire department, tax assessor, code enforcement officer, health agencies, and/or local/regional office of state agency having jurisdiction over hazardous waste disposal or other environmental matters in the area in which the property is located.

Report

Our report for the Phase I ESA will generally follow the recommended report format presented in ASTM E 1527-05. The report will include documentation to support the analysis, opinions, and conclusions presented in the report, as well as the credentials of the environmental professional(s) responsible for the Phase I ESA. The report will include the environmental professional's opinion of the impact of recognized environmental conditions in connection with the property. If the assessment reveals no evidence of RECs, then a statement to this effect will be made in the report.

Non-ASTM-Scope Considerations

The following non-ASTM-scope considerations are added to the Credere's scope of work as a part of this Phase I:

- Radon
- Asbestos
- Lead Based Paint
- Polychlorinated Biphenyls (PCBs) Containing Equipment
- Wetlands

These are included as a part of this Phase I ESA because they are deemed to add value for assessments conducted under the LRPC Brownfields Program.

APPENDIX C USER QUESTIONNAIRES

ASTM E-1527-05 USER QUESTIONNAIRE

In order to qualify for the protection offered under the EPA All Appropriate Inquiry (AAI) Standard, the **User** (entities seeking to use the ASTM E1527-05 Practice to complete an environmental site assessment of the property) must provide the following information (if available) to the environmental professional. Failure to provide this information could result in a determination that AAI is not complete. This information should be the collective knowledge of the entities relying on the Phase I. **Please note that you are not being asked to evaluate the property, but rather to provide your knowledge of information on the property.**

Site Name/Address: <u>Turchin Estate, 180 East Main Street, Tilton, NH</u>		
Person Completing Questionnaire/Title: Mr. Kimon Koulet, Executive Director, Lakes Region Planning Commission		
Date: September 9, 2010		
(1) User's "Specialized Knowledge" (40 CFR 312.28)		
Does User have any specialized knowledge of the subject property, the area surrounding the subject property, the current or past uses of adjoining properties, conditions of adjoining properties, and any other experience relevant to the inquiry, for the purpose of identifying conditions indicative of releases or threatened releases at the subject property? No		
Does User have any expertise and experience with real estate transactions and environmental contamination? None that include both RE transactions and environmental contamination. No		
<u>No</u>		
Is User a commercial broker of real estate or a real estate professional? No		
Does User have experience acting as a secured creditor on commercial real estate? No		
Does User have experience in detecting or remedying environmental contamination? On a academic basis only.		

(2)	User's "Reasonably	Ascertainable"	Knowledge of the	Property (40)	CFR 312 30)
١	4	User's reasonably	Ascertamable	Milowicuge of the	LIOPCILY (TO	CI K 312.30)

Does User have any independent knowledge of the environmental condition of the subject property, except as supplied by User's review of this environmental site assessment? Does User have reason to believe that there are *recognized environmental conditions* (as defined in ASTM E-1527-05) on the property at this time? If Yes, please explain. These should include, but are not limited to:

- Past and current uses of the subject property.
- Specific chemicals or petroleum products that are or have been stored or used on the subject property.
- Actual or threatened spills or releases of chemicals or petroleum products on the subject property.

Environmental investigations and/or clean ups of the subject property No
If so has Haar assessed the obviousness of releases throatened releases and the obility to dates
If so, has User assessed the obviousness of releases, threatened releases, and the ability to detect contamination by appropriate investigation considering all information User is aware of, whether noted above or not? Are there any obvious indicators that User is aware of that point to the presence or likely presence of contamination at the property? N/A
(3) Purchase Price (40 CFR 312.29)
Does the purchase price for the subject property reasonably reflect the fair market value of the subject commercial property, without discount for environmental issues or possible undisclosed hazardous substance or petroleum releases? <u>Don't know</u>
If No, please explain.

(4) Environmental Liens (40 CFR 312.25)

Does User have any knowledge of any environmental liens that may apply to the subject property under federal, tribal, state or local law? If Yes, please explain. (**Note:** If unknown, a

	w of title records or an environmental lien search is recommended, and is the User's nsibility under ASTM E-1527-05)
(5)	Activity and Land Use Limitations (40 CFR 312.26)
contree that n admir poten on the respon health or fac produ	User have any knowledge of any Activity and Land Use Limitations such as <i>institutional</i> ols or <i>engineering controls</i> to limit exposure to hazardous substances or petroleum products hay relate to the subject property? (<i>Institutional Controls</i> are defined as a legal or histrative restriction on the use of, or access to, a site or facility to 1) reduce or eliminate the tial for exposure to hazardous substances or petroleum products in the soil or ground water exproperty, or 2) to prevent activities that could interfere with the effectiveness of a hase action, in order to ensure maintenance of a condition of no significant risk to public for the environment. <i>Engineering Controls</i> are defined as physical modifications to a site ility to reduce or eliminate the potential for exposure to hazardous substances or petroleum acts in the soil or ground water on the property). If yes, please explain.

ASTM E-1527-05 USER QUESTIONNAIRE

In order to qualify for the protection offered under the EPA All Appropriate Inquiry (AAI) Standard, the **User** (entities seeking to use the ASTM E1527-05 Practice to complete an environmental site assessment of the property) must provide the following information (if available) to the environmental professional. Failure to provide this information could result in a determination that AAI is not complete. This information should be the collective knowledge of the entities relying on the Phase I. **Please note that you are not being asked to evaluate the property, but rather to provide your knowledge of information on the property.**

Site Name/Address: Turchin Estate, 180 East Main Street, Tilton, NH
Person Completing Questionnaire/Title: <u>Ms. Carolyn Hurst, President of Winnipesaukee River Trails Association</u>
Date: September 1, 2010
(1) User's "Specialized Knowledge" (40 CFR 312.28)
Does User have any specialized knowledge of the subject property, the area surrounding the subject property, the current or past uses of adjoining properties, conditions of adjoining properties, and any other experience relevant to the inquiry, for the purpose of identifying conditions indicative of releases or threatened releases at the subject property? Ms. Hurst reports limited knowledge of the subject property or the surrounding area. She knows is was once used as a gas station and then as an auto repair facility.
Does User have any expertise and experience with real estate transactions and environmental contamination? Ms. Hurst does not report expertise in real estate transactions, but has been
involved with many personal real estate transactions.
Is User a commercial broker of real estate or a real estate professional? No.
Does User have experience acting as a secured creditor on commercial real estate? No.
Does User have experience in detecting or remedying environmental contamination? No.

(2)	User's "Reasonabl	v Ascertainable"	Knowledge of the	Property (4	0 CFR 312.30)
(-)		<i>J</i>		[] (.	,

Does User have any independent knowledge of the environmental condition of the subject property, except as supplied by User's review of this environmental site assessment? Does User have reason to believe that there are *recognized environmental conditions* (as defined in ASTM E-1527-05) on the property at this time? If Yes, please explain. These should include, but are not limited to:

- Past and current uses of the subject property.
- Specific chemicals or petroleum products that are or have been stored or used on the subject property.
- Actual or threatened spills or releases of chemicals or petroleum products on the subject property.
- Environmental investigations and/or clean ups of the subject property

 Ms. Hurst reports no knowledge of environmental conditions of the subject property.

 If so, has User assessed the obviousness of releases, threatened releases, and the ability to detect contamination by appropriate investigation considering all information User is aware of, whether noted above or not? Are there any obvious indicators that User is aware of that point to the presence or likely presence of contamination at the property?

 N/A

(3) Purchase Price (40 CFR 312.29)

Does the purchase price for the subject property reasonably reflect the fair market value of the subject commercial property, without discount for environmental issues or possible undisclosed hazardous substance or petroleum releases?

Ms. Hurst is not aware of the market value of other properties in the vicinity of the subject property. She reports that she has heard from people in town that it is both overvalued and undervalued land.

If No N/A _	, please explain.
(4)	Environmental Liens (40 CFR 312.25)
prope review respo	User have any knowledge of any environmental liens that may apply to the subject rty under federal, tribal, state or local law? If Yes, please explain. (Note: If unknown, a w of title records or an environmental lien search is recommended, and is the User's nsibility under ASTM E-1527-05) Hurst is not aware of any environmental liens on the subject property.
(5)	Activity and Land Use Limitations (40 CFR 312.26)
that n admir poten on the respo health or fac produ	User have any knowledge of any Activity and Land Use Limitations such as <i>institutional</i> ols or <i>engineering controls</i> to limit exposure to hazardous substances or petroleum products hay relate to the subject property? (<i>Institutional Controls</i> are defined as a legal or histrative restriction on the use of, or access to, a site or facility to 1) reduce or eliminate the tial for exposure to hazardous substances or petroleum products in the soil or ground water exproperty, or 2) to prevent activities that could interfere with the effectiveness of a hase action, in order to ensure maintenance of a condition of no significant risk to public for the environment. <i>Engineering Controls</i> are defined as physical modifications to a site ility to reduce or eliminate the potential for exposure to hazardous substances or petroleum acts in the soil or ground water on the property). If yes, please explain. Hurst is not aware of any activity and land use restrictions on the subject property.

APPENDIX D SITE PHOTOGRAPHS



Picture 1
Representative
view of the subject
property from East
Main Street.



Picture 2
Representative view of gravel parking lot from East Main Street.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 3
Representative
view of lawn area
on the south side of
the garage.



Picture 4
View of pavement patch where former fueling island was located.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 5
View of the 55gallon drum with
unknown contents.



Picture 6
View of the 275gallon AST
observed outside
on the south side of
the garage.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 7

Representative view of a debris pile located on the east side of the subject property.



Picture 8

View of the discarded automobile gasoline tank observed in a debris pile on the subject property.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





View of the discarded pickup truck bed observed in the southeast corner of the subject property.



Picture 10

Representative view of the pile of wooden utility poles observed in the southeast corner of the subject property.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Representative view showing fill material used on the subject property.



Picture 12

Representative view of the mound of discarded asphalt located in the southeastern corner of the subject property.

(Note the black asphalt through the vegetation.)

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Representative
view showing one
of the multiple
stained gravel areas
on the subject
property.



Picture 14

View of the pole mounted electrical transformer observed on the subject property.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





View of the discarded car battery observed in a debris pile on the north side of the subject property.



Picture 16

Representative view of the garage bay and collapsed roof and ceiling.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019






• Picture 17
• View of the floor drain in the garage bay.



Picture 18 Representative view of staining observed in the garage bay.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019



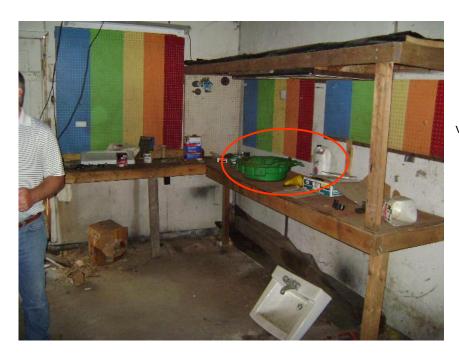

Representative view of automotive fluid containers observed in the garage bay.



Picture 20

Representative view of automotive fluid containers observed in the garage bay.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 21
Representative
view of additional
room in the garage

building.



Picture 22

Representative view of additional room in the garage building.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Representative
view of shelves
containing
automotive
cleaning,
lubricating, and
maintenance fluids
and aerosol
containers.



Picture 24

Representative view of the furnace in the garage building.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





View of the refrigerator observed in the closet of the garage building.



Picture 26

Representative view of the crawlspace below the garage building.

(Note the insulated pipe on the right side.)

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 27
Representative
view of the south
side of the cottage.



Picture 28
Representative view of the bathroom in the cottage.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 29
View of the fluorescent light ballasts observed in

the cottage.



Picture 30

Representative view of one of the five 5-gallon containers of unknown contents observed in the cottage.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019





Picture 31
Representative
view of the stains
observed on the
floor of the cottage.



Picture 32
View of the gas
canister with
unidentified
contents observed
in the cottage.

Phase I Environmental Site Assessment Turchin Estate 180 East Main Street, Tilton, NH NHDES #199311019



APPENDIX E FirstSearch® REPORT

FirstSearch Technology Corporation

Environmental FirstSearchTM **Report**

Target Property: ERNIES USED CARS

180 EAST MAIN ST

TILTON NH 03276

Job Number: 10001087

PREPARED FOR:

Credere Associates, LLC
776 Main Street
Westbrook, ME 04092

08-30-10



Tel: (781) 551-0470

Fax: (781) 551-0471

Environmental FirstSearch Search Summary Report

Target Site: 180 EAST MAIN ST TILTON NH 03276

FirstSearch Summary

Database	Sel	Updated	Radius	Site	1/8	1/4	1/2	1/2>	ZIP	TOTALS	
NIN	3 7	00 01 10	1.00	0	0	0	0	0	0	0	
NPL	Y	08-01-10	1.00	0	0	0	0	0	0	0	
NPL Delisted	Y	08-02-10	0.50	0	0	0	0	-	0	0	
CERCLIS	Y	07-02-10	0.50	0	0	0	0	-	0	0	
NFRAP	Y	07-02-10	0.50	0	0	0	0	-	0	0	
RCRA COR ACT	Y	07-14-10	1.00	0	0	0	0	0	0	0	
RCRA TSD	Y	07-14-10	0.50	0	0	0	0	-	0	0	
RCRA GEN	Y	07-14-10	0.25	0	0	0	-	-	1	1	
Federal Brownfield	Y	07-06-10	0.50	0	0	0	0	-	0	0	
ERNS	Y	07-23-10	0.12	0	0	-	-	-	0	0	
Tribal Lands	Y	12-01-05	1.00	0	0	0	0	0	1	1	
State/Tribal Sites	Y	05-27-10	1.00	0	0	0	6	7	5	18	
State Spills 90	Y	05-27-10	0.12	0	0	-	-	-	3	3	
State/Tribal SWL	Y	06-01-07	0.50	0	0	0	0	-	2	2	
State/Tribal LUST	Y	05-27-10	0.50	0	1	1	3	_	0	5	
State/Tribal UST/AST	Y	05-27-10	0.25	0	1	1	_	_	1	3	
State/Tribal EC	Y	NA	0.50	0	0	0	0	_	0	0	
State/Tribal IC	Y	05-01-10	0.25	0	0	0	_	_	0	0	
State/Tribal VCP	Y	NA	0.50	0	0	0	0	_	0	0	
State/Tribal Brownfields	Y	08-01-10	0.50	0	0	0	0	_	0	0	
FI Map Coverage	Y	08-25-10	0.12	1	0	_	_	_	0	1	
Federal IC/EC	Y	08-26-10	0.50	0	0	0	0	-	0	0	
- TOTALS -				1	2	2	9	7	13	34	

Notice of Disclaimer

Due to the limitations, constraints, inaccuracies and incompleteness of government information and computer mapping data currently available to FirstSearch Technology Corp., certain conventions have been utilized in preparing the locations of all federal, state and local agency sites residing in FirstSearch Technology Corp.'s databases. All EPA NPL and state landfill sites are depicted by a rectangle approximating their location and size. The boundaries of the rectangles represent the eastern and western most longitudes; the northern and southern most latitudes. As such, the mapped areas may exceed the actual areas and do not represent the actual boundaries of these properties. All other sites are depicted by a point representing their approximate address location and make no attempt to represent the actual areas of the associated property. Actual boundaries and locations of individual properties can be found in the files residing at the agency responsible for such information.

Waiver of Liability

Although FirstSearch Technology Corp. uses its best efforts to research the actual location of each site, FirstSearch Technology Corp. does not and can not warrant the accuracy of these sites with regard to exact location and size. All authorized users of FirstSearch Technology Corp.'s services proceeding are signifying an understanding of FirstSearch Technology Corp.'s searching and mapping conventions, and agree to waive any and all liability claims associated with search and map results showing incomplete and or inaccurate site locations.

Environmental FirstSearch Site Information Report

Request Date:08-30-10Search Type:COORDRequestor Name:Silas CanavanJob Number:10001087

Standard: AAI PACKAGE Filtered Report

Target Site: 180 EAST MAIN ST

TILTON NH 03276

Demographics

Sites: 34 Non-Geocoded: 13 Population: NA

Radon: NA

Site Location

	Degrees (Decimal)	Degrees (Min/Sec)		<u>UTMs</u>
Longitude:	-71.583102	-71:34:59	Easting:	290972.202
Latitude:	43.445209	43:26:43	Northing:	4813282.183
Elevation:	476		Zone:	19

Comment

Comment:

Additional Requests/Services

Adjacent ZIP Codes:	0 Mile(s)	Services:
		, I -

ZIP Code	City Name	ST	Dist/Dir	Sel		Requested?	Date
					Fire Insurance Maps	Yes	08-30-10
					Aerial Photographs	Yes	08-30-10
					Historical Topos	Yes	08-30-10
					City Directories	Yes	08-30-10
					Title Search/Env Liens	No	
					Municipal Reports	No	
					Online Topos	Yes	08-30-10

Environmental FirstSearch Sites Summary Report

180 EAST MAIN ST TILTON NH 03276 **JOB:** 10001087 **Target Property:**

NON GEOCODED: 13 SELECTED: 1 TOTAL: 34 GEOCODED: 21

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	ElevDiff	Page No.
1	FIMAP	FIRE INSURANCE MAP NH-FS-29/SANBORN	TILTON NH	0.00	N/A	1
2	LUST	ERNIES AUTO SALES 199311019/CLOSED	90 E MAIN ST TILTON NH 03276	0.11 SW	- 12	3
2	UST	ERNIES AUTO SALES 0114478/UST	9 E MAIN ST TILTON NH 03276	0.11 SW	- 12	6
3	UST	CUMBERLAND FARMS 2801 0111506/UST	235 E MAIN ST TILTON NH 03276	0.24 SW	- 25	8
3	LUST	CUMBERLAND FARMS 2801 199804011/KARNAUKH-S	235 E MAIN ST TILTON NH 03276	0.24 SW	- 25	10
4	STATE	WHITE MOUNTAIN RENTALS 200703032/GW HAZ INV - CLOSED	35 GRANITE ST TILTON NH 03276	0.27 SW	+ 10	12
5	STATE	WYMAN-GORDON INV CASTINGS INC 200006031/GW HAZ INV	GRANITE ST TILTON NH 03276	0.27 SW	+ 7	12
6	STATE	HILLSIDE MOBILE HOME PARK 199908028/GW HAZ INV	25 GRANITE ST TILTON NH 03276	0.28 SW	+ 10	13
7	STATE	BIG APPLE CONVENIENCE STORE 199106008/GW HAZ INV	148 MAIN ST TILTON NH 03276	0.34 SW	- 27	13
7	LUST	BIG APPLE CONVENIENCE STORE 199106008/CLOSED	148 MAIN ST TILTON NH 03276	0.34 SW	- 27	15
8	LUST	TILTON SCHOOL 199408027/CLOSED	SCHOOL ST TILTON NH 03276	0.38 NW	+ 55	18
8	STATE	TILTON SCHOOL 199408027/GW HAZ INV - CLOSED	SCHOOL ST TILTON NH 03276	0.38 NW	+ 55	20
9	STATE	MOONEY RESIDENCE 199501038/GW HAZ INV - CLOSED	10 PROSPECT ST TILTON NH 03276	0.44 SW	- 19	20
10	LUST	TILTON-NORTHFIELD AQUEDUCT CO. 199007003/CLOSED	283 MAIN ST TILTON NH 03276	0.48 SW	- 28	22
11	STATE	LAKES REGION INVESTMENT PARTNE 200001037/GW HAZ INV - CLOSED	322 W MAIN ST TILTON NH 03276	0.56 SW	- 38	24
12	STATE	MARTIN GREVIOR RESIDENCE 200101020/GW HAZ INV - CLOSED	323 W MAIN ST TILTON NH 03276	0.56 SW	- 24	24
13	STATE	OLD PILLSBURY MILL SITE 200007025/GW HAZ INV - CLOSED	336 W MAIN ST TILTON NH 03276	0.64 SW	- 31	25
14	STATE	RENA LITTLE RESIDENCE 199902046/GW HAZ INV - CLOSED	11 COTTAGE ST TILTON NH 03276	0.75 SW	- 24	26
15	STATE	WILLIAM W FRANKS 199703045/GW HAZ INV - CLOSED	290 MAIN ST TILTON NH 03276	0.76 SW	- 2	26
16	STATE	SURRETTE BATTERY 198406016/GW HAZ INV	15 PARK ST TILTON NH 03276	0.87 SW	- 36	27
17	STATE	RUSSELL IRONS 200511003/GW HAZ INV - CLOSED	57 COLBY RD TILTON NH 03276	0.94 NW	+ 94	27

Environmental FirstSearch Sites Summary Report

180 EAST MAIN ST TILTON NH 03276 **JOB:** 10001087 **Target Property:**

NON GEOCODED: 13 TOTAL: 34 GEOCODED: 21 SELECTED: 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	ElevDiff	Page No.
	SWL	NHSW-TRAN-182/TRANSFER STATIONS	RTE 3 TILTON NH 03276	NON GC	N/A	28
	SPILLS	SUZUKI MARINE (FORMER SILVESTR 198806032/CLOSED	UNITED STATES HIGHWAY 3 TILTON NH 03276	NON GC	N/A	28
	SWL	NHSW-TRAN-137/TRANSFER STATIONS	33 SARGENT ST NORTHFIELD NH 03276	NON GC	N/A	29
	TRIBALLAND	BUREAU OF INDIAN AFFAIRS CONTA BIA-03276	UNKNOWN NH 03276	NON GC	N/A	29
	SPILLS	94-393	MAIN ST TILTON NH 03276	NON GC	N/A	30
	RCRAGN	EPTAM PLASTICS NHD510199615/VGN	2 RIVERSIDE TILTON NH 03276	NON GC	N/A	31
	STATE	BLAISE PROPERTY 200907054/GW HAZ INV - CLOSED	134 CROSS MILL RD TILTON NH 03276	NON GC	N/A	32
	STATE	CHARRON RESIDENCE 200910030/GW HAZ INV - CLOSED	7 HOLMES AVE TILTON NH 03276	NON GC	N/A	32
	STATE	FORMER QUIN-T PROPERTY 200501001/GW HAZ INV - CLOSED	MANVILLE RD TILTON NH	NON GC	N/A	33
	STATE	PARK DRIVE SITE (LOT 1-2) 199710037/GW HAZ INV	PARK DR TILTON NH 03276	NON GC	N/A	33
	STATE	STAPLES 200908029/GW HAZ INV - CLOSED	75 LACONIA RD TILTON NH 03276	NON GC	N/A	34
	SPILLS	PIKE INDUSTRIES 198404034/CLOSED	STATE ROUTE 140 TILTON NH 03276	NON GC	N/A	35
	UST	LOWES OF TILTON NH 2610 0000291/AST	MORRISON AVE TILTON NH	NON GC	N/A	36

Target Property: 180 EAST MAIN ST JOB: 10001087

 $TILTON\ NH\ 03276$

FIMAP

SEARCH ID: 21 **DIST/DIR:** 0.00 -- **ELEVATION: MAP ID:** 1

NAME: FIRE INSURANCE MAP

REV: 8/25/10

ADDRESS: ID1: NH-FS-29
TILTON NH ID2:

STATUS: SANBORN

CONTACT: PHONE: SOURCE: PUBLIC LIBRARY

SITE INFORMATION

SOURCE COLLECTION: SANBORN

NUMBER OF MAPS: UNDETERMINED

POSSIBLE MAP LOCATION

TILTON

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 18 DIST/DIR: 0.11 SW ELEVATION: 464 MAP ID: 2

 NAME:
 ERNIES AUTO SALES
 REV:
 5/27/10

 ADDRESS:
 90 E MAIN ST
 ID1:
 199311019

90 E MAIN ST ID1: 19931101
TILTON NH ID2:

BELKNAP STATUS:
CONTACT: PHONE:

CONTACT: PHONE: SOURCE: NHDES

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: (WORKLOAD PRIORITY:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 18 **DIST/DIR:** 0.11 SW **ELEVATION:** 464 MAP ID: 2

NAME: ERNIES AUTO SALES REV: 5/27/10 199311019 **ADDRESS:** 90 E MAIN ST ID1:

TILTON NH ID2:

BELKNAP STATUS: PHONE:

CONTACT:

SOURCE: NHDES

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS:

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY: WLP: 3

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REMEDIATION COMPLETE RISK LEVEL:

CLOSED PROJECT MANAGER: PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 18 DIST/DIR: 0.11 SW ELEVATION: 464 MAP ID: 2

 NAME:
 ERNIES AUTO SALES
 REV:
 5/27/10

 ADDRESS:
 90 E MAIN ST
 ID1:
 199311019

90 E MAIN ST ID1: 199311019
TILTON NH ID2:

BELKNAP STATUS:

CONTACT: PHONE: SOURCE: NHDES

SITE INFORMATION

PERMITS: 0

WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: (WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

- More Details Exist For This Site; Max Page Limit Reached -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

UST

SEARCH ID: 15 **DIST/DIR:** 0.11 SW **ELEVATION:** 464 **MAP ID:** 2

 NAME:
 ERNIES AUTO SALES
 REV:
 5/27/10

 ADDRESS:
 9 E MAIN ST
 ID1:
 0114478

TILTON NH ID2:

STATUS: UST

CONTACT: PHONE: SOURCE: NH DES

TOTAL NUMBER OF TANKS: 4

OWNER INFORMATION

OWNER NAME: A TURCHIN ESTATE C/O H BELAIR

OWNER ADDRESS: 9 PLEASANT ST TILTON NH 03276

SITE TRACKING NUMBER: 199311019

TANK INFORMATION

TANK NUMBER: 1

STORAGE CAPACITY: 1000 GALLONS SUBSTANCE STORED: GASOLINE

TANK TYPE: PIPE TYPE: UNKNOWN DOUBLE WALL TANK: N

DATE INSTALLED:

EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED: 01/01/1960

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 09/15/1993

DATE PERMANENTLY CLOSED: R

PERM CLOSURE ANALYSIS PERFORMED: 10/05/1993

DATE TEMPORARILY CLOSED: 10/05/1993 **CLOSURE TYPE:** REMOVED

TANK NUMBER: 2

STORAGE CAPACITY: 1000 GALLONS SUBSTANCE STORED: GASOLINE

TANK TYPE: PIPE TYPE: UNKNOWN DOUBLE WALL TANK: N

DATE INSTALLED:
EMERG SPILL ENCLOSURE INSTALLED:
EMERG OVERFILL ENCLOSURE INSTALLED:
01/01/1960

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 09/15/1993

DATE PERMANENTLY CLOSED: R

PERM CLOSURE ANALYSIS PERFORMED: 10/05/1993

DATE TEMPORARILY CLOSED: 10/05/1993 **CLOSURE TYPE:** REMOVED

TANK NUMBER:

STORAGE CAPACITY: 1000 GALLONS SUBSTANCE STORED: GASOLINE

TANK TYPE: PIPE TYPE: UNKNOWN

DOUBLE WALL TANK: N
DATE INSTALLED:

EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED: 01/01/1960

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 09/15/1993

DATE PERMANENTLY CLOSED: R

PERM CLOSURE ANALYSIS PERFORMED: 10/05/1993

DATE TEMPORARILY CLOSED: 10/05/1993 **CLOSURE TYPE:** REMOVED

180 EAST MAIN ST 10001087 **Target Property:** JOB:

TILTON NH 03276

UST

SEARCH ID: 15 **DIST/DIR:** 0.11 SW **ELEVATION:** 464 MAP ID: 2

NAME: **REV:** ERNIES AUTO SALES 5/27/10 **ADDRESS:** 9 E MAIN ST

0114478 ID1: TILTON NH ID2:

STATUS: UST

CONTACT: PHONE: **SOURCE:** NH DES

TANK NUMBER: 1000 GALLONS SUBSTANCE STORED: STORAGE CAPACITY:

USE TANK TYPE: PIPE TYPE: UNKNOWN

DOUBLE WALL TANK:

DATE INSTALLED: EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED: 01/01/1960

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 09/15/1993

DATE PERMANENTLY CLOSED:

PERM CLOSURE ANALYSIS PERFORMED: 10/05/1993

DATE TEMPORARILY CLOSED: 10/05/1993 **CLOSURE TYPE:** REMOVED

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

UST

SEARCH ID: 14 **DIST/DIR:** 0.24 SW **ELEVATION:** 451 **MAP ID:** 3

 NAME:
 CUMBERLAND FARMS 2801
 REV:
 5/27/10

 ADDRESS:
 235 E MAIN ST
 ID1:
 0111506

235 E MAIN ST ID1: 0111506
TILTON NH ID2:

STATUS: UST

CONTACT: PHONE: SOURCE: NH DES

TOTAL NUMBER OF TANKS: 6

OWNER INFORMATION
OWNER NAME: CUMBERLAND FARMS INC

OWNER ADDRESS: 100 CROSSING BLVD FRAMINGHAM MA 01702

SITE TRACKING NUMBER: 199804011

TANK INFORMATION

TANK NUMBER: 1

STORAGE CAPACITY: 8000 GALLONS SUBSTANCE STORED: GASOLINE

TANK TYPE: PIPE TYPE: STEEL

DOUBLE WALL TANK: N

DATE INSTALLED:

EMERG SPILL ENCLOSURE INSTALLED: 12/26/1997

EMERG OVERFILL ENCLOSURE INSTALLED:

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 04/07/1998

DATE PERMANENTLY CLOSED: R

PERM CLOSURE ANALYSIS PERFORMED: 05/27/1998

DATE TEMPORARILY CLOSED: 05/27/1998 **CLOSURE TYPE:** REMOVED

TANK NUMBER: 2

STORAGE CAPACITY: 8000 GALLONS SUBSTANCE STORED: GASOLINE TANK TYPE: STEEL

TANK TYPE:
DOUBLE WALL TANK:
N

DATE INSTALLED:
EMERG SPILL ENCLOSURE INSTALLED: 12/26/1997

EMERG OVERFILL ENCLOSURE INSTALLED:

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 04/07/1998

DATE PERMANENTLY CLOSED: R

PERM CLOSURE ANALYSIS PERFORMED: 05/27/1998

DATE TEMPORARILY CLOSED: 05/27/1998 **CLOSURE TYPE:** REMOVED

TANK NUMBER: 3

STORAGE CAPACITY: 8000 GALLONS SUBSTANCE STORED: GASOLINE

TANK TYPE: PIPE TYPE: STEEL

DOUBLE WALL TANK: N

DATE INSTALLED:

EMERG SPILL ENCLOSURE INSTALLED: 12/26/1997

EMERG OVERFILL ENCLOSURE INSTALLED:

LAST TIGHTNESS TEST DATE:

LINE LEAK DETECTION TEST DATE: 04/07/1998

DATE PERMANENTLY CLOSED: R

PERM CLOSURE ANALYSIS PERFORMED: 05/27/1998

DATE TEMPORARILY CLOSED: 05/27/1998 **CLOSURE TYPE:** REMOVED

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

UST

SEARCH ID: 14 **DIST/DIR:** 0.24 SW **ELEVATION:** 451 MAP ID: 3

NAME: **CUMBERLAND FARMS 2801** REV: 5/27/10

ADDRESS: 235 E MAIN ST ID1: 0111506 TILTON NH ID2:

STATUS: UST

CONTACT: PHONE: SOURCE: NH DES

TANK NUMBER:

SUBSTANCE STORED: STORAGE CAPACITY: 8000 GALLONS **GASOLINE**

TANK TYPE: PIPE TYPE: **FIBERGLASS**

DOUBLE WALL TANK:

DATE INSTALLED: 04/09/1998 EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED: LAST TIGHTNESS TEST DATE: 04/09/1998

LINE LEAK DETECTION TEST DATE: DATE PERMANENTLY CLOSED:

PERM CLOSURE ANALYSIS PERFORMED:

DATE TEMPORARILY CLOSED: CLOSURE TYPE:

TANK NUMBER:

STORAGE CAPACITY: 8000 GALLONS SUBSTANCE STORED: GASOLINE TANK TYPE: PIPE TYPE: PLC

DOUBLE WALL TANK:

DATE INSTALLED: 04/09/1998 EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED: LAST TIGHTNESS TEST DATE: 04/09/1998 LINE LEAK DETECTION TEST DATE: DATE PERMANENTLY CLOSED:

PERM CLOSURE ANALYSIS PERFORMED: DATE TEMPORARILY CLOSED: **CLOSURE TYPE:**

TANK NUMBER:

STORAGE CAPACITY: 8000 GALLONS SUBSTANCE STORED: **GASOLINE**

TANK TYPE: PIPE TYPE:

PLC

DOUBLE WALL TANK: DATE INSTALLED: 04/09/1998

EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED: LAST TIGHTNESS TEST DATE: 04/09/1998

LINE LEAK DETECTION TEST DATE: DATE PERMANENTLY CLOSED:

PERM CLOSURE ANALYSIS PERFORMED:

CLOSURE TYPE: DATE TEMPORARILY CLOSED:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 17 **DIST/DIR:** 0.24 SW **ELEVATION:** 451 MAP ID: 3

NAME: **CUMBERLAND FARMS 2801** REV: 5/27/10 199804011 **ADDRESS:** 235 E MAIN ST

ID1: TILTON NH ID2:

BELKNAP STATUS: KARNAUKH-S

CONTACT: PHONE: NHDES **SOURCE:**

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR RISK LEVEL:

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS:

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 17 **DIST/DIR:** 0.24 SW **ELEVATION:** 451 **MAP ID:** 3

 NAME:
 CUMBERLAND FARMS 2801
 REV:
 5/27/10

 ADDRESS:
 235 E MAIN ST
 ID1:
 19980401

235 E MAIN ST ID1: 199804011 TILTON NH ID2:

BELKNAP STATUS: KARNAUKH-S

CONTACT: PHONE:

SOURCE: NHDES

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS:

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 17 **DIST/DIR:** 0.24 SW **ELEVATION:** 451 **MAP ID:** 3

 NAME:
 CUMBERLAND FARMS 2801
 REV:
 5/27/10

 ADDRESS:
 235 E MAIN ST
 ID1:
 199804011

235 E MAIN S1 ID1: 1998040
TILTON NH ID2:

BELKNAP STATUS: KARNAUKH-S

CONTACT: PHONE:

SOURCE: NHDES

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY: 1

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS:

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 3 FREE PRODUCT OR HIGH LEVEL SOURCE PR

PROJECT MANAGER: KARNAUKH-S

- More Details Exist For This Site; Max Page Limit Reached -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 11 **ELEVATION: DIST/DIR:** 0.27 SW 486 **MAP ID:** 4

REV: NAME: WHITE MOUNTAIN RENTALS 5/27/10 **ADDRESS:** 35 GRANITE ST 200703032

ID1: NORTHFIELD NH ID2:

STATUS: MERRIMACK GW HAZ INV - CLOSED

CONTACT: PHONE:

SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 13 **DIST/DIR:** 0.27 SW **ELEVATION:** 483 MAP ID: 5

NAME: WYMAN-GORDON INV CASTINGS INC **REV:** 5/27/10 ADDRESS: GRANITE ST 200006031 ID1: NORTHFIELD NH ID2:

MERRIMACK STATUS: GW HAZ INV

CONTACT: PHONE:

SOURCE: NH DES

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: LAWRENCE

PERMITS:

PROJECT TYPE: HAZARDOUS LAWRENCE PROJECT MANAGER:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 2 **DIST/DIR:** 0.28 SW **ELEVATION:** 486 MAP ID: 6

REV: NAME: HILLSIDE MOBILE HOME PARK 1/17/08 ADDRESS: 25 GRANITE ST

199908028 ID1: NORTHFIELD NH ID2:

MERRIMACK STATUS: GW HAZ INV

CONTACT: PHONE: SOURCE:

PERMITS:

SPILL/RLS

PROJECT TYPE: PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 1 **DIST/DIR:** 0.34 SW **ELEVATION:** 449 MAP ID: 7

BIG APPLE CONVENIENCE STORE **REV:** NAME: 5/27/10 ADDRESS: 148 MAIN ST ID1: 199106008

TILTON NH ID2:

STATUS: GW HAZ INV BELKNAP

CONTACT: PHONE:

SOURCE: NH DES

PERMITS:

PROJECT TYPE: HAZARDOUS PROJECT MANAGER: WILLOUGHBY

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: WILLOUGHBY

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 16 **DIST/DIR:** 0.34 SW **ELEVATION:** 449 **MAP ID:** 7

 NAME:
 BIG APPLE CONVENIENCE STORE
 REV:
 5/27/10

 ADDRESS:
 148 MAIN ST
 ID1:
 199106008

148 MAIN ST ID1: 19910600 TILTON NH ID2:

BELKNAP STATUS: CONTACT: PHONE:

SOURCE: NHDES

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGO VIOLATIONS - REME

PROJECT MANAGER: PERMITS-MANAGEMENT

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 16 **DIST/DIR:** 0.34 SW **ELEVATION:** 449 **MAP ID:** 7

 NAME:
 BIG APPLE CONVENIENCE STORE
 REV:
 5/27/10

 ADDRESS:
 148 MAIN ST
 ID1:
 199106008

148 MAIN ST ID1: 1991060 TILTON NH ID2:

BELKNAP STATUS: CLOSED

CONTACT: PHONE:

SOURCE: NHDES

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 1 **WORKLOAD PRIORITY:** WLP: 3

RISK LEVEL: RISK LEVEL: 7 LOW CONCENTRATION, ALTERNATIVE WATER IS AVAILABLE

PROJECT MANAGER: PERMITS-MANAGEMENT

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

WORKLOAD PRIORIT

RISK LEVEL:

PROJECT MANAGER: PERMITS-MANAGEMENT

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1

WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: LEDGARD
PROJECT TYPE: LUST

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 16 **DIST/DIR:** 0.34 SW **ELEVATION:** 449 **MAP ID:** 7

 NAME:
 BIG APPLE CONVENIENCE STORE
 REV:
 5/27/10

 ADDRESS:
 148 MAIN ST
 ID1:
 199106008

148 MAIN ST ID1: 19910600 TILTON NH ID2:

BELKNAP STATUS:
CONTACT: PHONE:

CONTACT: PHONE: SOURCE: NHDES

SITE INFORMATION

PERMITS: 1 WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: PERMITS-MANAGEMENT

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: PERMITS-MANAGEMENT

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 7

PROJECT MANAGER: PERMITS-MANAGEMENT

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 1
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: LEDGARD
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 2 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 2
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

- More Details Exist For This Site; Max Page Limit Reached -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 19 **DIST/DIR:** 0.38 NW **ELEVATION:** 531 **MAP ID:** 8

 NAME:
 TILTON SCHOOL
 REV:
 5/27/10

 ADDRESS:
 SCHOOL ST
 ID1:
 199408027

SCHOOL ST ID1: 19940 TILTON NH ID2:

BELKNAP STATUS: CONTACT: PHONE:

CONTACT: PE

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 19 **DIST/DIR:** 0.38 NW **ELEVATION:** 531 MAP ID: 8

NAME: TILTON SCHOOL REV: 5/27/10 ADDRESS: SCHOOL ST ID1: 199408027

TILTON NH ID2:

STATUS: BELKNAP **CONTACT:** PHONE:

SOURCE: NHDES

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY: WLP: 3

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REMEDIATION COMPLETE RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL:

CLOSED PROJECT MANAGER: PROJECT TYPE: LUST

SITE INFORMATION

PERMITS:

WORKLOAD PRIORITY: WLP: 3 RISK LEVEL: RISK LEVEL: 8 PROJECT MANAGER: CLOSED

PROJECT TYPE: LUST

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

CLOSED

SEARCH ID: 19 **DIST/DIR:** 0.38 NW **ELEVATION:** 531 **MAP ID:** 8

 NAME:
 TILTON SCHOOL
 REV:
 5/27/10

 ADDRESS:
 SCHOOL ST
 ID1:
 199408027

SCHOOL ST ID1: 19940802 TILTON NH ID2:

BELKNAP STATUS: CONTACT: PHONE:

CONTACT: PHONE SOURCE: NHDES

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

- More Details Exist For This Site; Max Page Limit Reached -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 10 **DIST/DIR:** 0.38 NW **ELEVATION:** MAP ID: 531 8

REV: NAME: TILTON SCHOOL 5/27/10 ADDRESS: SCHOOL ST 199408027 ID1:

TILTON NH ID2:

STATUS: BELKNAP GW HAZ INV - CLOSED

CONTACT: PHONE: SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 5 **DIST/DIR:** 0.44 SW **ELEVATION:** 457 MAP ID: 9

NAME: MOONEY RESIDENCE **REV:** 5/27/10 ADDRESS: 10 PROSPECT ST 199501038 ID1:

TILTON NH ID2:

BELKNAP STATUS: GW HAZ INV - CLOSED CONTACT: PHONE:

SOURCE: NH DES

PERMITS: PROJECT TYPE:

ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 20 **DIST/DIR:** 0.48 SW **ELEVATION:** 448 MAP ID: 10

TILTON-NORTHFIELD AQUEDUCT CO. NAME: REV: 5/27/10 199007003 ADDRESS: 283 MAIN ST ID1:

ID2:

TILTON NH BELKNAP STATUS: CLOSED

CONTACT: PHONE:

NHDES **SOURCE:**

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

- Continued on next page -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 20 **DIST/DIR:** 0.48 SW **ELEVATION:** 448 **MAP ID:** 10

 NAME:
 TILTON-NORTHFIELD AQUEDUCT CO.
 REV:
 5/27/10

 ADDRESS:
 283 MAIN ST
 ID1:
 199007003

283 MAIN ST ID1: 199007 TILTON NH ID2:

BELKNAP STATUS: CLOSED

CONTACT: PHONE:

SOURCE: NHDES

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0

WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0 WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY: W

WORKLOAD PRIORITY: WLP: 3

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REMEDIATION COMPLETE

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED PROJECT TYPE: LUST

- Continued on next page -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

LUST

SEARCH ID: 20 **DIST/DIR:** 0.48 SW **ELEVATION:** 448 **MAP ID:** 10

 NAME:
 TILTON-NORTHFIELD AQUEDUCT CO.
 REV:
 5/27/10

 ADDRESS:
 283 MAIN ST
 ID1:
 199007003

283 MAIN ST ID1: 19900700 TILTON NH ID2:

BELKNAP STATUS: CLOSED

CONTACT: PHONE: SOURCE: NHDES

SITE INFORMATION

PERMITS: 0

WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: 8
RROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL:

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS:0WORKLOAD PRIORITY:WLP: 3RISK LEVEL:RISK LEVEL: 8PROJECT MANAGER:CLOSED

PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY: WLP: 3
RISK LEVEL: RISK LEVEL: 8
PROJECT MANAGER: CLOSED
PROJECT TYPE: LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

SITE INFORMATION

PERMITS: 0
WORKLOAD PRIORITY:

RISK LEVEL: RISK LEVEL: 8 NO SOURCES/ NO AGQ VIOLATIONS - REME

PROJECT MANAGER: CLOSED **PROJECT TYPE:** LUST

- More Details Exist For This Site; Max Page Limit Reached -

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 3 **ELEVATION: DIST/DIR:** 0.56 SW 438 **MAP ID:** 11

REV: NAME: LAKES REGION INVESTMENT PARTNER LLC 5/27/10 **ADDRESS:** 322 W MAIN ST 200001037

ID1: TILTON NH ID2:

BELKNAP STATUS: GW HAZ INV - CLOSED

CONTACT: PHONE: SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 4 **DIST/DIR:** 0.56 SW **ELEVATION:** 452 MAP ID: 12

MARTIN GREVIOR RESIDENCE NAME: **REV:** 5/27/10 200101020

ADDRESS: 323 W MAIN ST ID1: TILTON NH ID2:

BELKNAP STATUS: GW HAZ INV - CLOSED

CONTACT: PHONE: SOURCE: NH DES

PERMITS: PROJECT TYPE: ON PREM US

PROJECT MANAGER: CLOSED

PERMITS:

180 EAST MAIN ST 10001087 **Target Property: JOB:**

TILTON NH 03276

STATE

SEARCH ID: 6 **DIST/DIR:** 0.64 SW **ELEVATION:** 445 MAP ID: 13

NAME: **REV:** OLD PILLSBURY MILL SITE 5/27/10 ADDRESS: 336 W MAIN ST

200007025 ID1: TILTON NH ID2:

BELKNAP STATUS: GW HAZ INV - CLOSED

CONTACT: PHONE: SOURCE: NH DES

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: CLOSED-AUR

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: CLOSED-AUR

PERMITS:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 7 **ELEVATION: DIST/DIR:** 0.75 SW 452 **MAP ID:** 14

REV: NAME: RENA LITTLE RESIDENCE 5/27/10 ADDRESS: 11 COTTAGE ST

199902046 ID1: NORTHFIELD NH ID2:

STATUS: MERRIMACK GW HAZ INV - CLOSED

CONTACT: PHONE: SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 12 **DIST/DIR:** 0.76 SW **ELEVATION:** 474 MAP ID: 15

NAME: WILLIAM W FRANKS **REV:** 5/27/10 ADDRESS: 290 MAIN ST 199703045 ID1:

TILTON NH ID2:

BELKNAP STATUS: GW HAZ INV - CLOSED CONTACT: PHONE:

SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 9 **DIST/DIR:** 0.87 SW **ELEVATION:** MAP ID: 440 16

REV: NAME: SURRETTE BATTERY 5/27/10 ADDRESS: 15 PARK ST

198406016 ID1: NORTHFIELD NH ID2:

MERRIMACK STATUS: GW HAZ INV

CONTACT: PHONE: SOURCE: NH DES

PERMITS:

PROJECT TYPE: HAZARDOUS PROJECT MANAGER: WICKSON

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: WICKSON

STATE

SEARCH ID: **DIST/DIR:** 0.94 NW **ELEVATION:** 570 MAP ID: 17

NAME: RUSSELL IRONS **REV:** 5/27/10 ADDRESS: 57 COLBY RD 200511003 ID1:

TILTON NH ID2:

BELKNAP STATUS: GW HAZ INV - CLOSED PHONE:

CONTACT: SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

Target Property: 180 EAST MAIN ST **JOB:** 10001087

TILTON NH 03276

SWL

SEARCH ID: 32 DIST/DIR: NON GC ELEVATION: MAP ID:

NAME: REV: 06/01/06

ADDRESS: RTE 3 ID1: NHSW-TRAN-182

TILTON NH 03276 ID2:

CONTACT: TOWN OF TILTON

STATUS: TRANSFER STATIONS PHONE:

SOURCE:

SITE INFORMATION

PERMIT NUMBER: DES-SW-PN-01-009

OWNER/OPERATOR: TOWN OF TILTON

145 MAIN ST TILTON NH 03276

SERVICE AREA: TILTON

MSW DISPOSAL FACILITY: W-TO-E, CONCORD

FORMER LANDFILL: YES

COMMENTS: VOLUNTEER OPERATED RECYCLING CENTER; CURBSIDE PICKUP OF TRASH

SPILLS

SEARCH ID: 29 DIST/DIR: NON GC ELEVATION: MAP ID:

NAME:SUZUKI MARINE (FORMER SILVESTROS TIRE)REV:5/27/10ADDRESS:UNITED STATES HIGHWAY 3ID1:198806032

TILTON NH ID2:

STATUS: CLOSED

CONTACT: PHONE:

SOURCE: NH DES

PERMITS: 0

PROJECT TYPE: SPILL/RLS

PROJECT TYPE: SPILL/RLS
PROJECT MANAGER: CLOSED

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

SWL

SEARCH ID: 31 DIST/DIR: NON GC ELEVATION: MAP ID:

NAME: REV: 06/01/06

ADDRESS: 33 SARGENT ST ID1: NHSW-TRAN-137

NORTHFIELD NH 03276 ID2:

STATUS: TRANSFER STATIONS

CONTACT: TOWN OF NORTHFIELD PHONE: SOURCE:

SITE INFORMATION

PERMIT NUMBER: DES-SW-89-024

OWNER/OPERATOR: TOWN OF NORTHFIELD

21 SUMMER ST

NORTHFIELD NH 03276

SERVICE AREA:
MSW DISPOSAL FACILITY:
NORTHFIELD
W-TO-E, CONCORD

FORMER LANDFILL: NO

COMMENTS: SITE RECEIVES BULKY WASTE, CandD, AND RECYCLABLES ONLY; TOWN HAS

CURBSIDE PICKUP AND HAUL OF MSW TO W-TO-E, CONCORD

TRIBALLAND

SEARCH ID: 34 DIST/DIR: NON GC ELEVATION: MAP ID:

NAME: BUREAU OF INDIAN AFFAIRS CONTACT INFORMATION REV: 01/15/08
ADDRESS: UNKNOWN ID1: BIA-03276

UNKNOWN ID1: BIA-03276 NH 03276 ID2:

BELKNAP STATUS: CONTACT: PHONE:

SOURCE: BIA

BUREAU OF INDIAN AFFAIRS CONTACT INFORMATION

OFFICE: Eastern Regional Office

CONTACT: FRANKLIN KEEL, REGIONAL DIRECTOR

ADDRESS: 545 MARRIOTT DR, SUITE 700

Nashville TN 37214 **PHONE:** Phone: 615-564-6700 **FAX:** Fax: 615-564-6701

The Native American Consultation Database (NACD) is a tool for identifying consultation contacts for Indian tribes, Alaska Native villages and corporations, and Native Hawaiian organizations. The database is not a comprehensive source of information, but it does provide a starting point for the consultation process by identifying tribal leaders and NAGPRA contacts. This database can be accessed online at the following web address http://home.nps.gov/nacd/

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

			SPILLS		
SEARCH ID: 30	DIST/DIR:	NON GC	ELEVATION:		MAP ID:
NAME: ADDRESS: MAIN ST TILTON NH CONTACT: SOURCE:			REV: ID1: ID2: STATUS: PHONE:	01/01/98 94-393	
DATE OF SPILL:	11/25/94		TIME OF SPILL:		
CHEMICAL SPILLED: AMOUNT SPILLED:	Gasoline 2 Gals		HAZARD: TYPE OF SITE:	Flam Liq Tran	

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

RCRAGN

SEARCH ID: 22 DIST/DIR: NON GC ELEVATION: MAP ID:

NAME: EPTAM PLASTICS REV: 7/14/10

ADDRESS: 2 RIVERSIDE ID1: NHD510199615

NORTHFIELD NH 03276 ID2:

BELKNAP STATUS: VGN

CONTACT: PHONE: SOURCE: EPA

SITE INFORMATION

CONTACT INFORMATION: FRANK TRASK

PO BOX 267 TILTON NH 03276

PHONE: 6032868009

UNIVERSE INFORMATION:

SUBJECT TO CORRECTIVE ACTION (SUBJCA)

 SUBJCA:
 N - NO

 SUBJCA TSD 3004:
 N - NO

 SUBJCA NON TSD:
 N - NO

 SIGNIFICANT NON-COMPLIANCE(SNC):
 N - NO

BEGINNING OF THE YEAR SNC:

PERMIT WORKLOAD: ----CLOSURE WORKLOAD: ----POST CLOSURE WORKLOAD: ----PERMITTING /CLOSURE/POST-CLOSURE PROGRESS: ----CORRECTIVE ACTION WORKLOAD: N - NO

GENERATOR STATUS: CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS:

GENERATES LESS THAN 100 $\,$ KG/MONTH OF HAZARDOUS WASTE

INSTITUTIONAL CONTROL: N

HUMAN EXPOSURE: GW CONTROLS:

LAND TYPE: P

NAIC INFORMATION

326199 - ALL OTHER PLASTICS PRODUCT MANUFACTURING

ENFORCEMENT INFORMATION:

VIOLATION INFORMATION:

HAZARDOUS WASTE INFORMATION:

D001 - Ignitable waste D001 - Ignitable waste

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 23 **DIST/DIR:** NON GC **ELEVATION: MAP ID:**

REV: NAME: BLAISE PROPERTY 5/27/10 ADDRESS: 134 CROSS MILL RD 200907054

ID1: NORTHFIELD NH ID2:

STATUS: GW HAZ INV - CLOSED

CONTACT: PHONE: **SOURCE:** NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 24 **DIST/DIR:** NON GC **ELEVATION:** MAP ID:

NAME: CHARRON RESIDENCE **REV:** 5/27/10 ADDRESS: 7 HOLMES AVE 200910030 ID1:

NORTHFIELD NH ID2:

STATUS: GW HAZ INV - CLOSED CONTACT: PHONE:

SOURCE: NH DES

PERMITS:

PROJECT TYPE: ON PREM US PROJECT MANAGER: CLOSED

PERMITS:

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

STATE

SEARCH ID: 25 **ELEVATION: DIST/DIR:** NON GC **MAP ID:**

REV: NAME: FORMER QUIN-T PROPERTY 5/27/10 ADDRESS: MANVILLE RD

200501001 ID1: TILTON NH ID2:

STATUS: GW HAZ INV - CLOSED

CONTACT: PHONE: **SOURCE:** NH DES

PERMITS:

PROJECT TYPE: HAZARDOUS PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: CLOSED

STATE

SEARCH ID: 26 **DIST/DIR:** NON GC **ELEVATION:** MAP ID:

NAME: PARK DRIVE SITE (LOT 1-2) **REV:** 5/27/10 ADDRESS: PARK DR 199710037 ID1:

NORTHFIELD NH ID2: STATUS: GW HAZ INV

CONTACT: PHONE:

SOURCE: NH DES

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: CLOSED-AUR

PERMITS:

PROJECT TYPE: HAZARDOUS PROJECT MANAGER: CLOSED-AUR

Target Property: 180 EAST MAIN ST 10001087 **JOB:**

TILTON NH 03276

STATE

SEARCH ID: 27 **DIST/DIR:** NON GC **ELEVATION:** MAP ID:

NAME: STAPLES **REV:** 5/27/10 ADDRESS: 75 LACONIA RD 200908029

ID1: TILTON NH ID2:

STATUS: GW HAZ INV - CLOSED

CONTACT: PHONE: **SOURCE:** NH DES

PERMITS:

PROJECT TYPE: HAZARDOUS PROJECT MANAGER: CLOSED

PERMITS:

PROJECT TYPE: **HAZARDOUS** PROJECT MANAGER: CLOSED

Target Property: 180 EAST MAIN ST **JOB:** 10001087

TILTON NH 03276

SPILLS

SEARCH ID: 28 DIST/DIR: NON GC ELEVATION: MAP ID:

 NAME:
 PIKE INDUSTRIES
 REV:
 5/1/08

 ADDRESS:
 STATE ROUTE 140
 ID1:
 198404034

NORTHFIELD NH ID2:
STATUS: CLOSED

CONTACT: STATUS: C

SOURCE: NH DES

SITE INFORMATION

INCIDENT DATE: 7/12/2006
PROJECT TYPE: IRSPILL
SPILL ORIGIN: AST OTHER
SUBSTANCE: OTHER
AMOUNT (GAL): 2800
WELL HEAD PROTECT AREA: NO

RISK LEVEL: NO SOURCES/NO AGQS VIO S FROM ONSITE

REIMBURSEMENT ELIGIBLE: UNKNOWN

DATE ELIGIBLE:

WORKLOAD PRIORITY: LOW PROJECT MANAGER: EVANS

SITE INFORMATION

INCIDENT DATE: 7/12/2006
PROJECT TYPE: IRSPILL
SPILL ORIGIN: AST OTHER
SUBSTANCE: OTHER
AMOUNT (GAL): 2800
WELL HEAD PROTECT AREA: NO

RISK LEVEL: NO SOURCES/NO AGQS VIO S FROM ONSITE

REIMBURSEMENT ELIGIBLE: UNKNOWN

DATE ELIGIBLE:

WORKLOAD PRIORITY: LOW PROJECT MANAGER: EVANS

Target Property: 180 EAST MAIN ST JOB: 10001087

TILTON NH 03276

UST

SEARCH ID: 33 DIST/DIR: NON GC ELEVATION: MAP ID:

 NAME:
 LOWES OF TILTON NH 2610
 REV:
 5/27/10

 ADDRESS:
 MORRISON AVE
 ID1:
 0000291

TILTON NH ID2:

STATUS: AST

CONTACT: MELISSA M CALL
SOURCE: NH DES

336-658-2181

OWNER INFORMATION

OWNER NAME: LOWES HOME CENTERS INC

OWNER ADDRESS:

SITE TRACKING NUMBER: 200505080

TANK INFORMATION

TANK NUMBER:

STORAGE CAPACITY: 1500 GALLONS SUBSTANCE STORED: DIESEL

TANK TYPE: PIPE TYPE:

DOUBLE WALL TANK: DATE INSTALLED:

EMERG SPILL ENCLOSURE INSTALLED:

EMERG OVERFILL ENCLOSURE INSTALLED:

LAST TIGHTNESS TEST DATE: LINE LEAK DETECTION TEST DATE:

DATE PERMANENTLY CLOSED:

 $\label{eq:permitted} \textbf{PERM CLOSURE ANALYSIS PERFORMED:}$

DATE TEMPORARILY CLOSED: CLOSURE TYPE:

Environmental FirstSearch Street Name Report for Streets within .25 Mile(s) of Target Property

180 EAST MAIN ST TILTON NH 03276 **JOB:** 10001087 **Target Property:**


Street Name	Dist/Dir	Street Name	Dist/Dir
Chase Rd	0.23 SE		
Copeland Rd	0.01 NE		
Dean Jeffries Ln	0.23 NW		
E Main St	0.00		
Edward St	0.10 NE		
Granite St	0.13 SW		
Grant St	0.22 NE		
Joscelyn Ln	0.11 NE		
Knapp Rd	0.10 NE		
Moore St	0.15 NE		
Morrison Ave	0.22 NE		
Riverside Dr	0.16 SE		
State Route 11	0.00		
United States Highwa	0.00		



.12 Mile Radius
Historical Fire Insurance Coverage Map



180 EAST MAIN ST, TILTON NH 03276

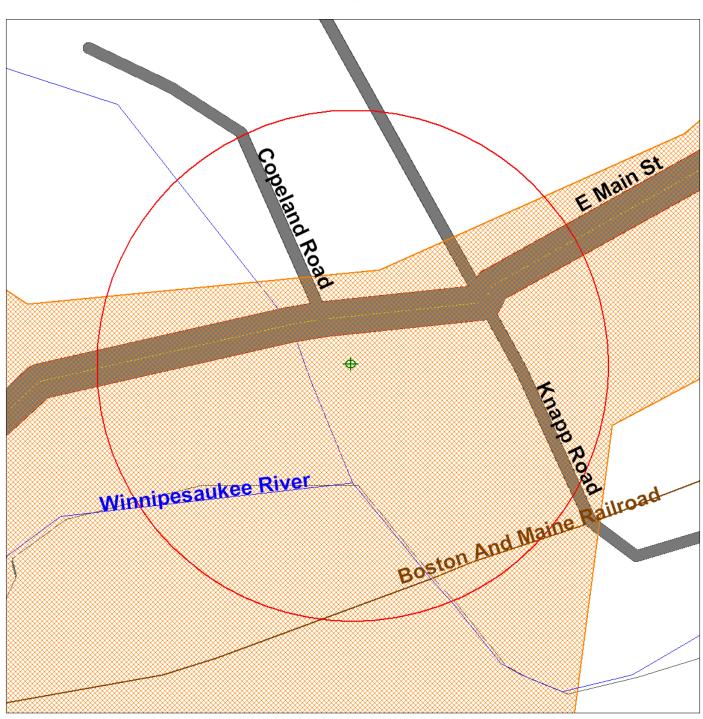

Source: 2005 U.S. Census TIGER Files






1 Mile Radius ASTM Map: NPL, RCRACOR, STATE Sites



180 EAST MAIN ST, TILTON NH 03276

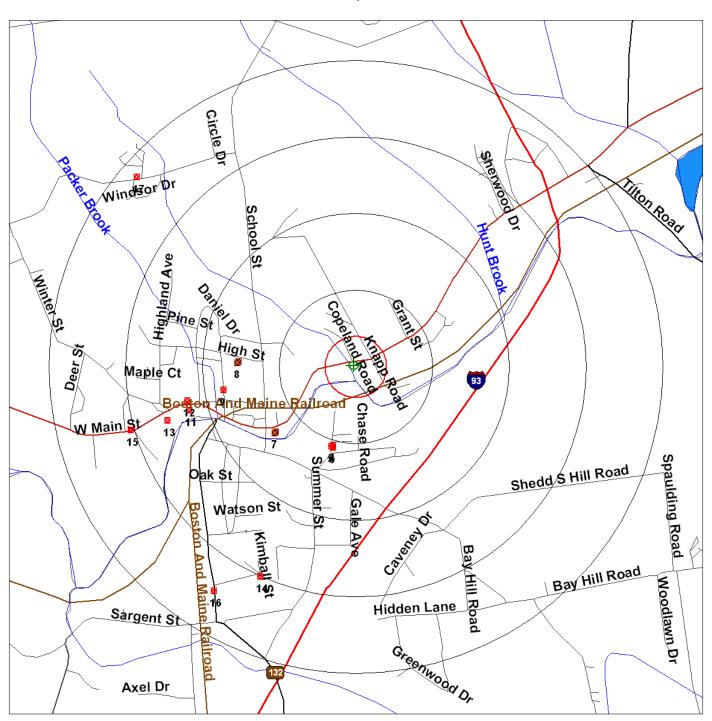

Source: 2005 U.S. Census TIGER Files










.5 Mile Radius ASTM Map: CERCLIS, RCRATSD, LUST, SWL



180 EAST MAIN ST, TILTON NH 03276

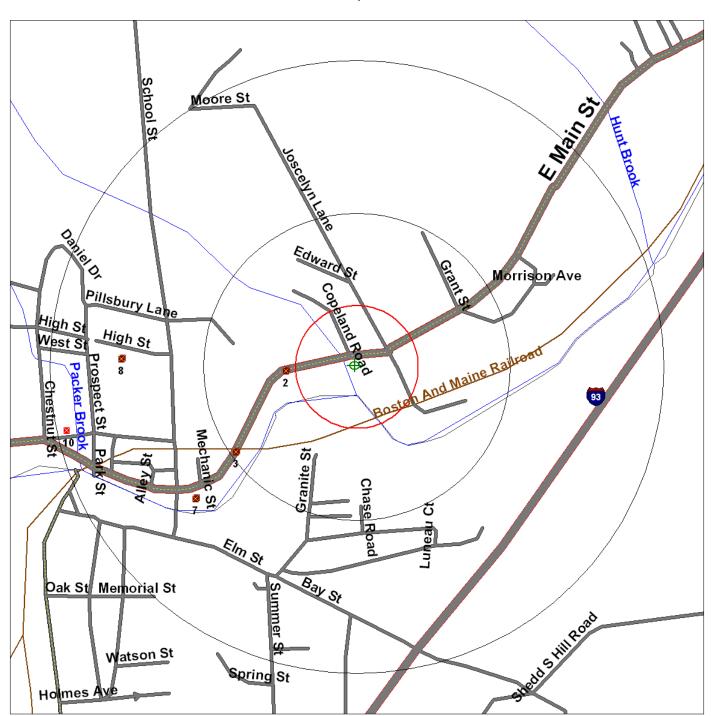

Source: 2005 U.S. Census TIGER Files










.25 Mile Radius ASTM Map: RCRAGEN, ERNS, UST, FED IC/EC, METH LABS



180 EAST MAIN ST, TILTON NH 03276

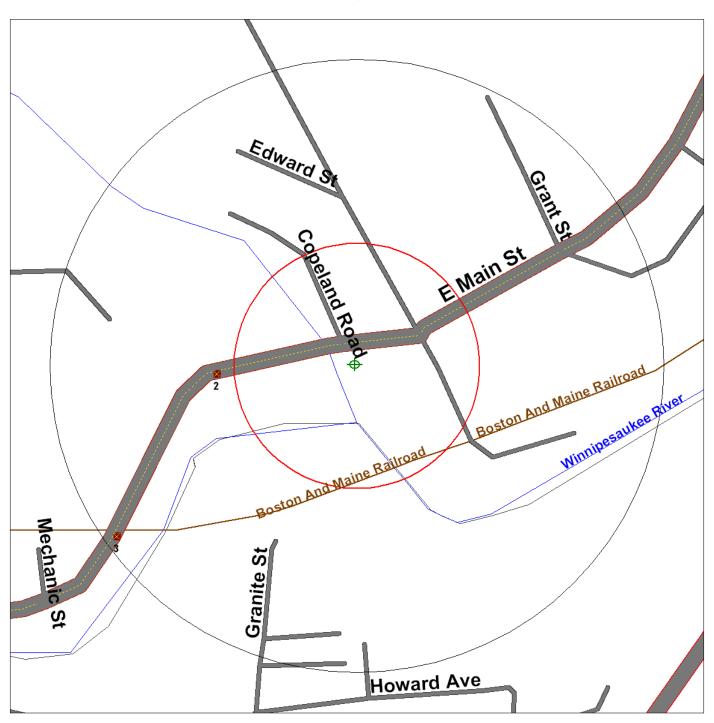

Source: 2005 U.S. Census TIGER Files










.25 Mile Radius Non-ASTM Map: No Sites Found



180 EAST MAIN ST, TILTON NH 03276

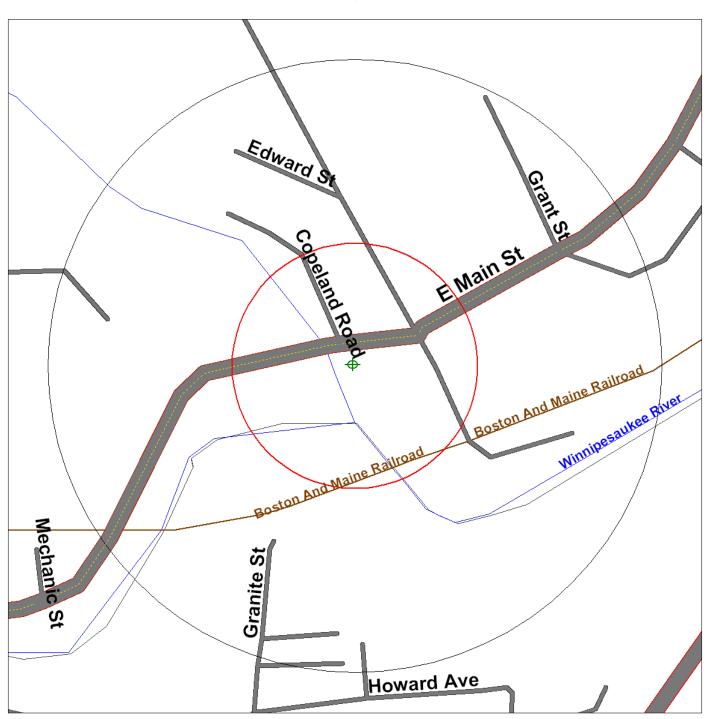

Source: 2005 U.S. Census TIGER Files











N & E


Environmental FirstSearch

Historical Topographic Map




Quad Name: Northfield, NH Year: 1987 Original Map Scale: 1: 24000

180 EAST MAIN ST, TILTON, NH

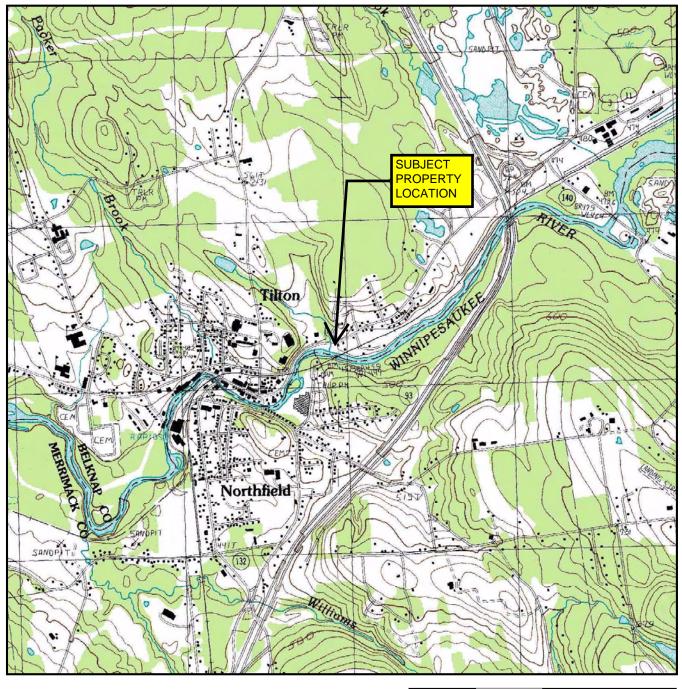

Job Number: 10001087

Target Site: -71.583102, 43.445209

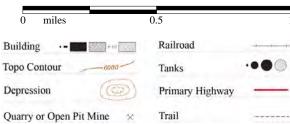

M. F.


Environmental FirstSearch

Historical Topographic Map




Quad Name: Penacook, NH Year: 1956 Original Map Scale: 1: 62500

180 EAST MAIN ST, TILTON, NH

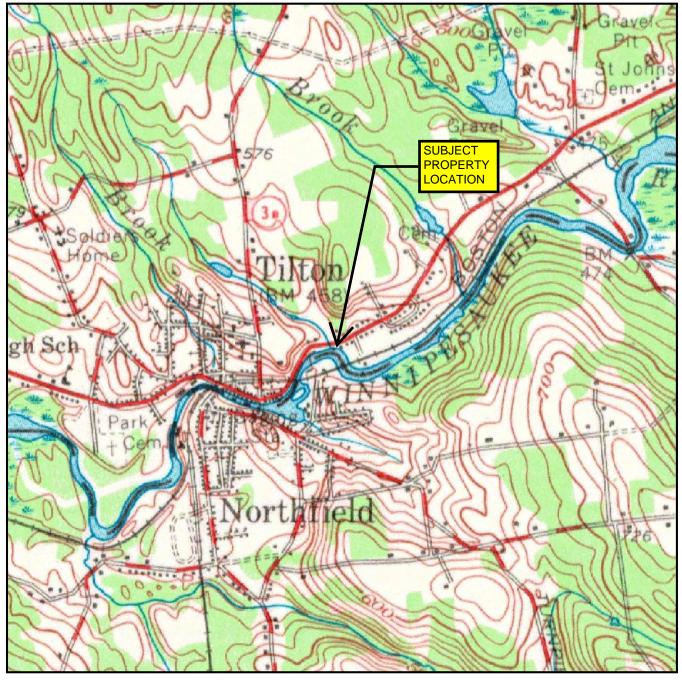

Job Number: 10001087

Target Site: -71.583102, 43.445209

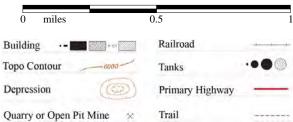

M. F.


Environmental FirstSearch

Historical Topographic Map




Quad Name: Penacook, NH Year: 1927 Original Map Scale: 1: 62500

180 EAST MAIN ST, TILTON, NH

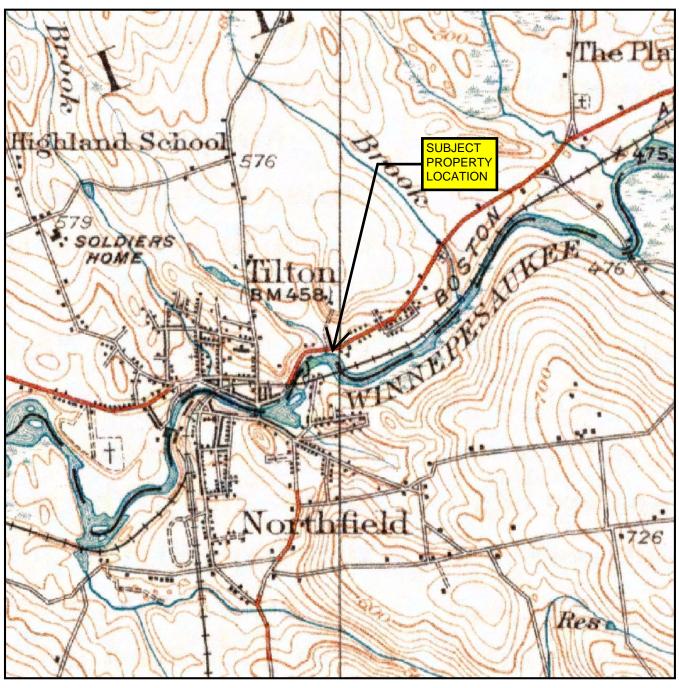

Job Number: 10001087

Target Site: -71.583102, 43.445209

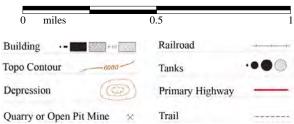




Historical Aerial Photo 2009



180 EAST MAIN ST, TILTON NH 03276

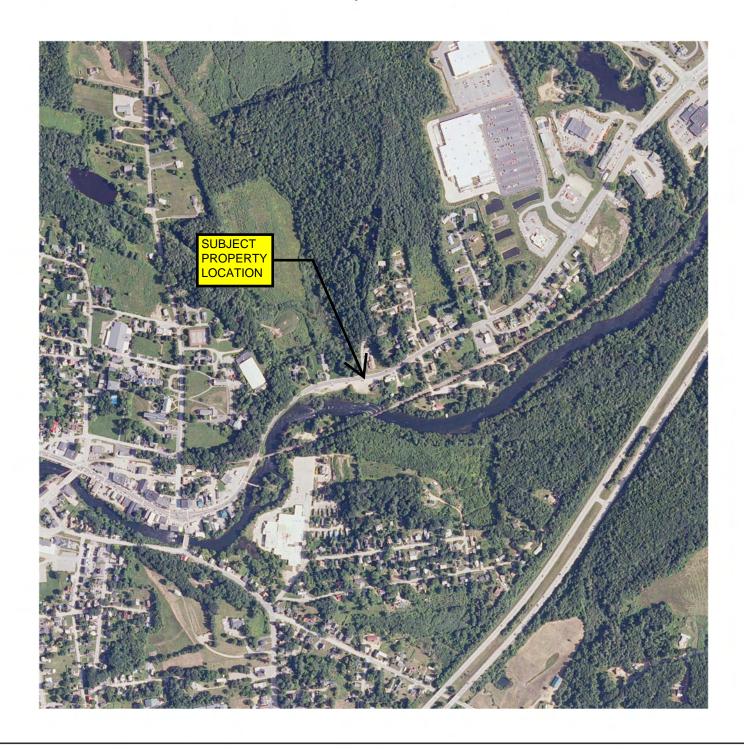


Job Number: 10001087 Target Site: (Latitude: 43.445209, Longitude: -71.583102)



Historical Aerial Photo 1998



180 EAST MAIN ST, TILTON NH 03276

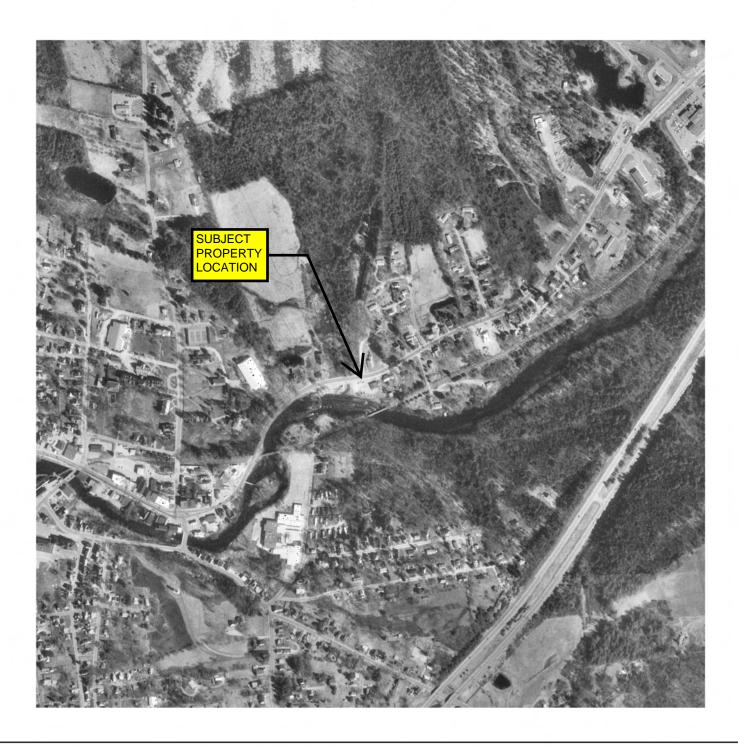


Job Number: 10001087 Target Site: (Latitude: 43.445209, Longitude: -71.583102)



Historical Aerial Photo 1985



180 EAST MAIN ST, TILTON NH 03276

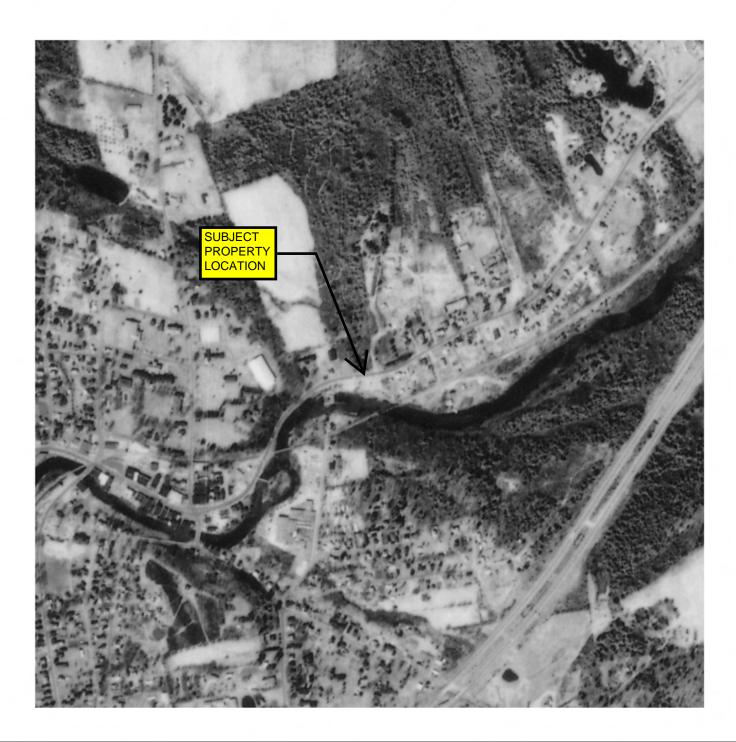

Job Number: 10001087 Target Site: (Latitude: 43.445209, Longitude: -71.583102)



Historical Aerial Photo 1956



180 EAST MAIN ST, TILTON NH 03276




Job Number: 10001087 Target Site: (Latitude: 43.445209, Longitude: -71.583102)

Historical Aerial Photo 1951



180 EAST MAIN ST, TILTON NH 03276

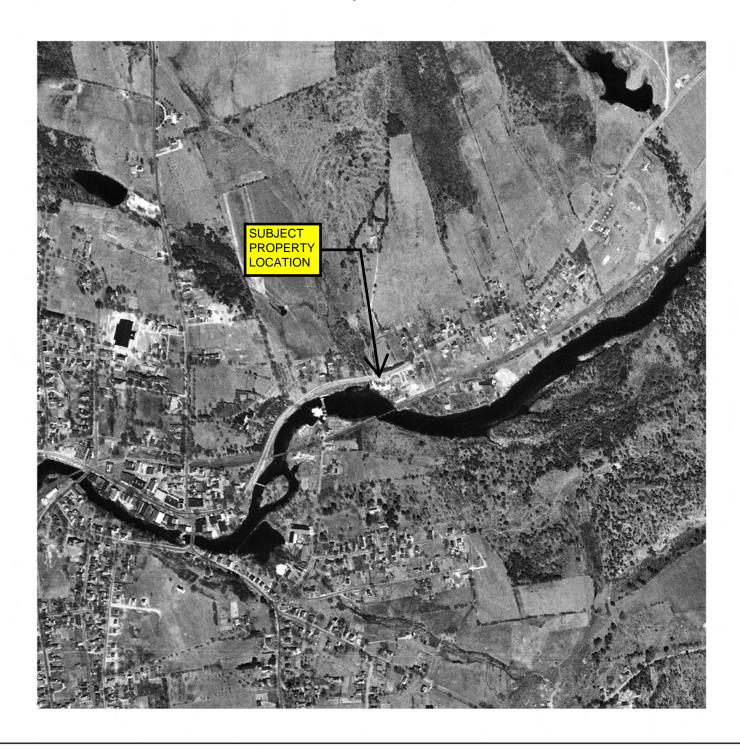

Job Number: 10001087 Target Site: (Latitude: 43.445209, Longitude: -71.583102)



CITY DIRECTORY REVIEW

Report Date: September 6, 2010

Client Job Number: 10001087 FirstSearch Index Number: 240538

Site Address(es): 180 East Main Street

Tilton, NH 03276

A search was conducted for the subject area noted above to identify any Historical City Directory coverage/tenant information maintained at national repositories, local city/town libraries and/or various public sources.

The following information is the result of the search:

YEAR /	CLOSEST LOWER		CLOSEST UPPER
SOURCE	ADDRESS LISTINGS	SUBJECT ADDRESS (ES)	ADDRESS LISTINGS
2010/Polk	169 East Main Street	Not Listed	193 East Main Street
Directory	Residential Listing		Residential Listing
	170 East Main Street		Northfield Tilton Cngrgtnl Chr
	No Current Listing		churches
	174 East Main Street		199 East Main Street
	Multiple Residential Listings		Residential Listing
	175 East Main Street		East Main Street Intersects
	Pauli's Bakery & Restaurant		Railroad Crosses
	restaurants		Center Street Intersects
			Park Street Intersects
			Prospect Street Intersects
			Park Street Intersects
			Railroad Crosses
			235 Main Street
			Cumberland Farms convenience
			stores
			K&J Pizza Express pizza
			One Million Dragon Restaurant
			restaurants
			243 Main Street
			Residential Listing
			Tilton Medical Assoc physicians
			& surgeons
2006/Polk	169-170 East Main Street	Not Listed	193 East Main Street
Directory	No Current Listing (2 hses)		Residential Listing
	174 East Main Street		Northfield Tilton Cngrgtnl Chr
	Multiple Residential Listings		churches
	176 East Main Street		Main Street Intersects
	Store Front schools		199 East Main Street
	179 East Main Street		Residential Listing
	Tilton Police Dept police		Railroad Crosses
	departments		217 Main Street
	Tilton Police Station police		Residential Listing
	departments		2220 Main Street
			Residential Listing

Continued on next page

CONTINUED

CONTINUED		1	
2004/Polk			
	174 East Main Street Multiple Residential Listings 175 East Main Street Pauli's Bakery & Restaurant restaurants 178 East Main Street Residential Listing 179 East Main Street Earl's Barber Shop barbers Tilton Police Dept police departments Tilton Police Station police departments	Ernie's Used Cars Sales & Svc auto dlrs-used cars	193 East Main Street Northfield Tilton Cngrgtnl Chr churches 198 East Main Street Store Front schools Main Street Begins Railroad Crosses East Main Street Intersects Mechanic Street Begins Bridge Street Intersects School Street Intersects Center Street Intersects Park Street Intersects Prospect Street Intersects Railroad Crosses 235 Main Street Cumberland Farms Food Store grocers-retail Million Dragon Restaurant restaurants
			Shamrock Brothers Pizza & Pub restaurants 243 Main Street Residential Listing Tilton Medical Assoc physicians & surgeons
2000/Cole Directory	174 East Main Street Multiple Residential Listings 175 East Main Street Paulis Bakery & Restaurant 178 East Main Street Residential Listing 179 East Main Street Earls Barber Shop	Not Listed	182 East Main Street Bryant & Lawrence Incorporated Hdwr 193 East Main Street Northfield Tilton Congregational Church 198 East Main Street Store Front The 199 East Main Street Falardeau & Franks
1995/Cole Directory	121 East Main Street Lee Garden 123 East Main Street Boynton Laurie Psychothrpst Krueger-Andes Margaret Psychologst Mears Gail 124 East Main Street Multiple Residential Listings 126 East Main Street Residential Listing	Not Listed	No Higher Listings
1992/Cole Directory	109 East Main Street Residential Listing 121 East Main Street Lee Garden 124 East Main Street Residential Listing 126 East Main Street Residential Listing	Not Listed	No Higher Listings

Continued on next page

CONTINUED

1966/Manning	174-176 Main Street	Vacant	181 Main Street
Directory	Tilton Five & Ten Cent Store		Vacant
•	177 Main Street		182 Main Street
	Anthony's House of Pizza		Bryant & Lawrence Inc hdwe
	178 Main Street		183 Main Street
	Residential Listing		Multiple Business Listings
	179 Main Street		(Available Upon Request)
	Earl's Barber Shop		184 Main Street
	_		Norma's Beauty Shop
			Residential Listing
1961/Manning	174-176 Main Street	Chretien's gros	181 Main Street
Directory	Tilton Five & Ten Cent Store		Tilton Theatre
	177 Main Street		182 Main Street
	Shepherd Furniture Store		Bryant & Lawrence Inc hdwe
	178 Main Street		183 Main Street
	Residential Listing		Multiple Business Listings
	179 Main Street		(Available Upon Request)
	Earl's Barber Shop		184 Main Street
			Norma's Beauty Shop
			Residential Listing

Notes: East Main Street listed as Main Street between 1966 and 1961 No further coverage available

GLOSSARY OF TERMS

- "No Listing/Not Listed" address not listed in the directory
- "Vacant" or "No Current Listing" status of address in directory
- "Residential Listing" one residential listing located at address
- "Multiple Residential Listings" more than one residential listing located at address
- "Multiple Retail Listings" more than one retail facility located at address
- "Multiple Business Listings" more than one business listing at address
- "Multiple Government Offices" more than one federal listing at an address
- "Multiple Municipal Listings" more than one municipal listing at an address
- "Multiple Military Listings" more than one military listing at an address
- "Street Not Listed" street not listed in directory

When multiple tenants/facilities are observed for one address, the information may be summarized as shown in the following examples:

- An apartment building will be represented by "Multiple Residential Listings"
- A retail shopping center will be represented by "Multiple Retail Listings" followed by a separate listing of sites, if present, which may contain the use of regulated/chemical/hazardous materials such as dry cleaners, photo finishers, hair salons, auto repair shops, etc.
- An office building consisting of attorneys, insurance, firms, or other facilities which do not indicate the use of regulated/chemical/hazardous materials will be represented by "Multiple Business Listings"

Residential addresses, including individual houses and apartment buildings, are listed as residential. Names of tenants can be provided if needed.

Unless otherwise noted, the subject address(es) plus four adjacent addresses up from the subject property and four addresses down from the subject property are included in the report, if available.

Although great care has been taken by FirstSearch Technology Corporation in compiling and verifying the information contained in this report to insure that it is accurate, FirstSearch Technology Corporation disclaims any and all liability for any errors, omissions, or inaccuracies in such information and data.



FIRE INSURANCE MAP ABSTRACT RESEARCH RESULTS

8/30/2010

10001087


180 EAST MAIN ST TILTON, NH 03276


Listed below, please find the results of our search for historic fire insurance maps, performed in conjunction with your Environmental FirstSearch® report.


State	City	Date	Volume	Sheet Number(s)
New Hampshire	Tilton & Northfield	1948	none	6
New Hampshire	Tilton	1937	none	6
New Hampshire	Tilton	1929	none	6
New Hampshire	Tilton	1923	none	6
New Hampshire	Tilton	1912	none	6
New Hampshire	Tilton	1904	none	4
New Hampshire	Tilton	1899	none	1
New Hampshire	Tilton	1894	none	2
New Hampshire	Tilton	1889	none	2


This abstract is the result of a visual inspection of various Sanborn® Map collections. Supporting documentation follows in the Appendix. Use of this material is meant for research purposes only.


Certain Sanborn® Fire Insurance Maps are copyrighted material and may not be reproduced without the expressed permission of the Sanborn Map Company or other authorized third party distributors. Any reproduction of this material is covered under the copyright law of the United States (Title 17 U.S. Code) for which customer assumes all liability for the making of photocopies or other reproductions of copyrighted material. FirstSearch Technology Corporation warrants that it will employ its best efforts to maintain and deliver its information in an efficient and timely manner. Customer acknowledges that it understands that FirstSearch Technology Corporation obtains the above information from sources FirstSearch Technology Corporation considers reliable. However, THE WARRANTIES EXPRESSED HEREIN ARE IN LIEU OF ALL OTHER WARRANTIES, either expressed or implied, including without limitation any implied warranty of merchantability or fitness or suitability for a particular purpose (whether or not FirstSearch Technology Corporation may know, have reason to know, or have been advised of such purpose), whether arising by law or by reason of industry custom or usage. ALL SUCH OTHER WARRANTIES ARE HEREBY EXPRESSLY DISCLAIMED.

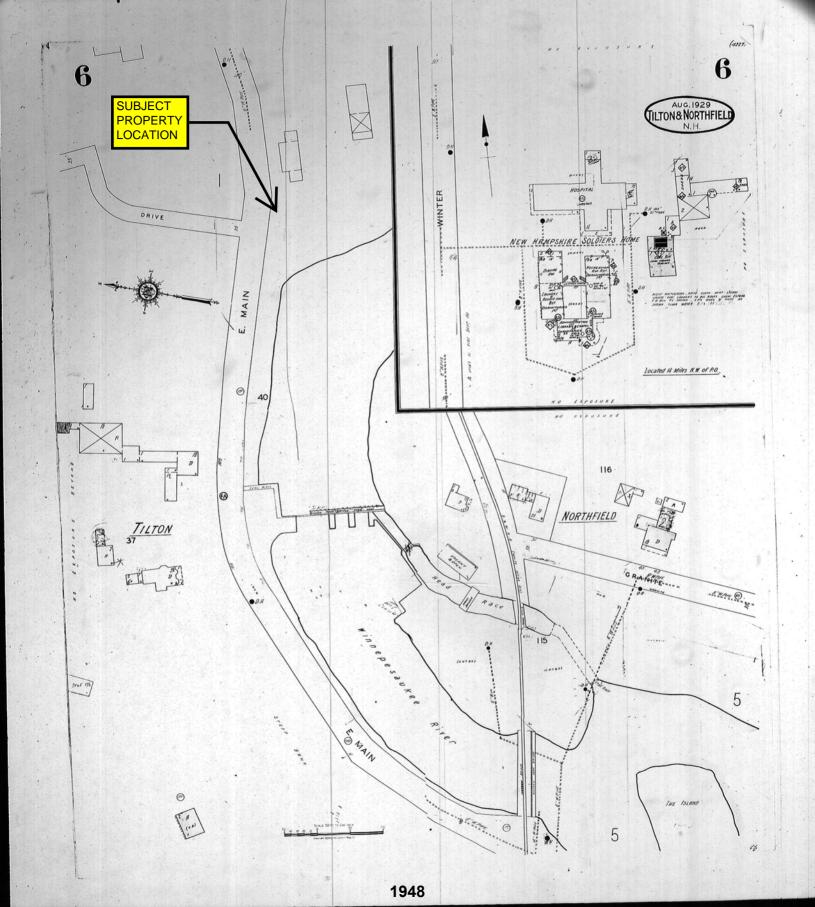


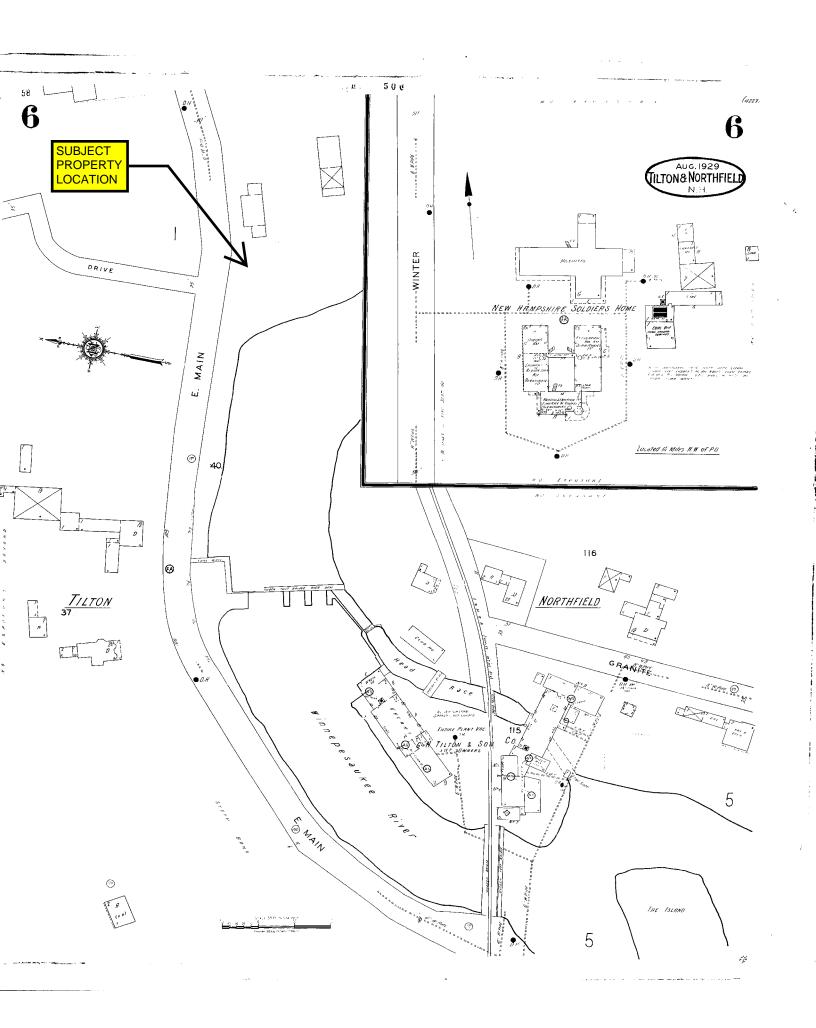


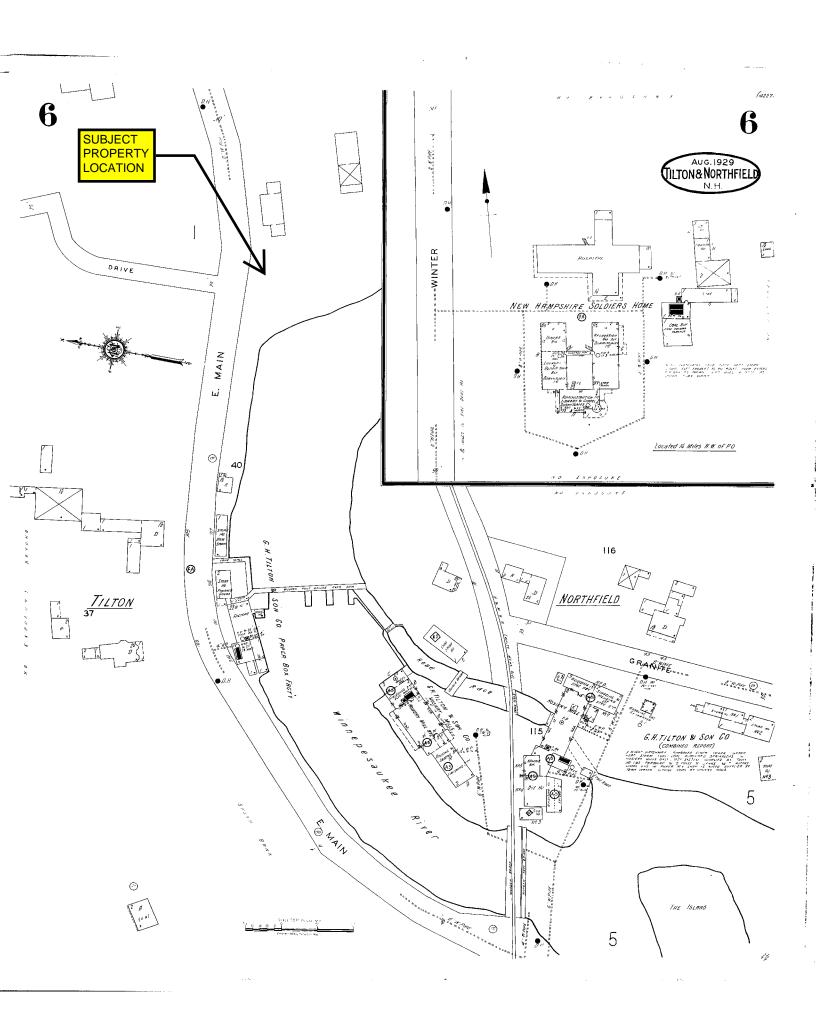


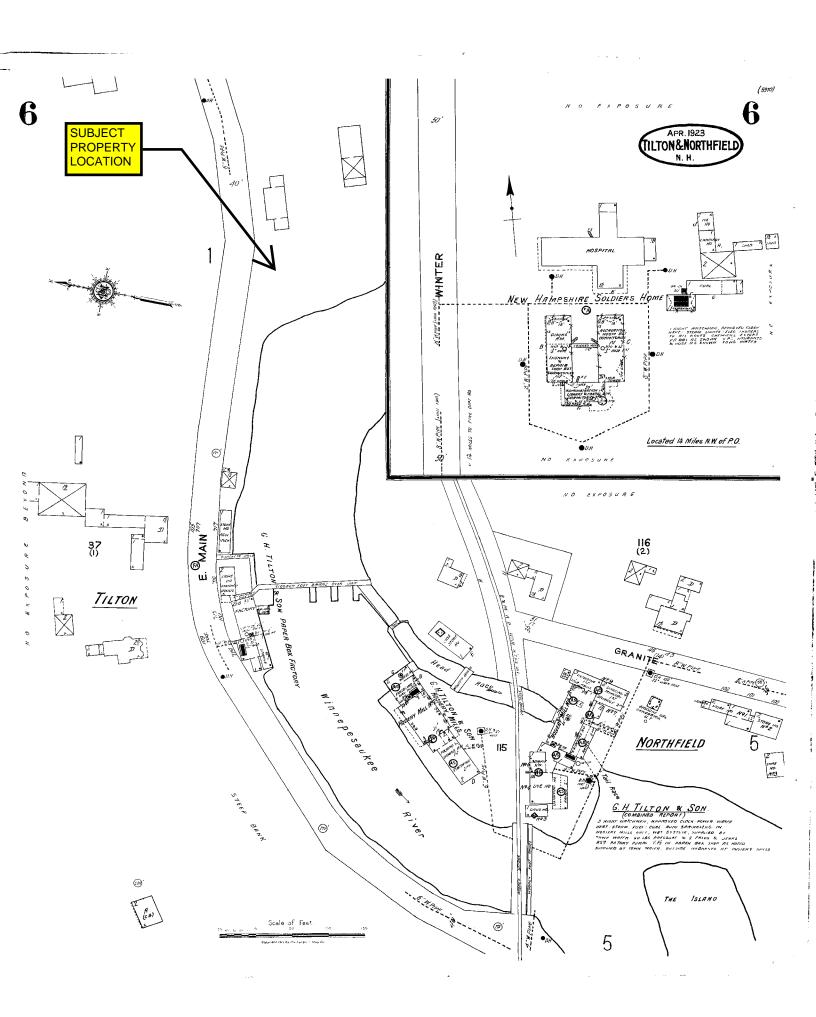


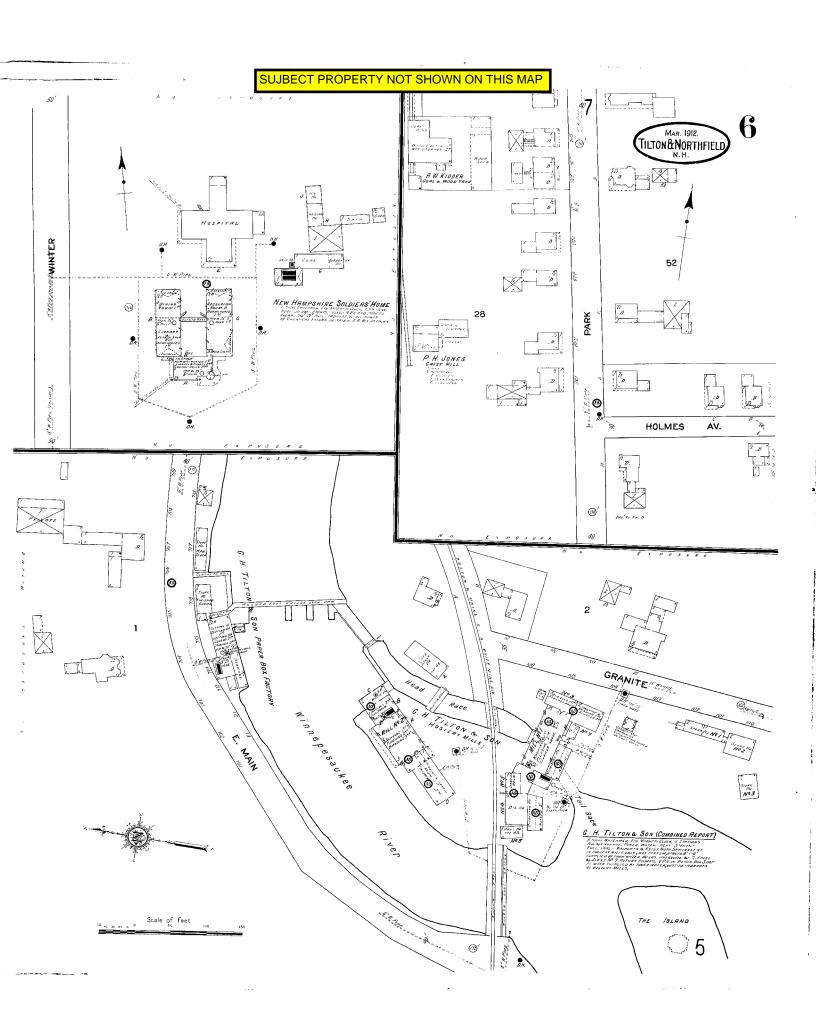

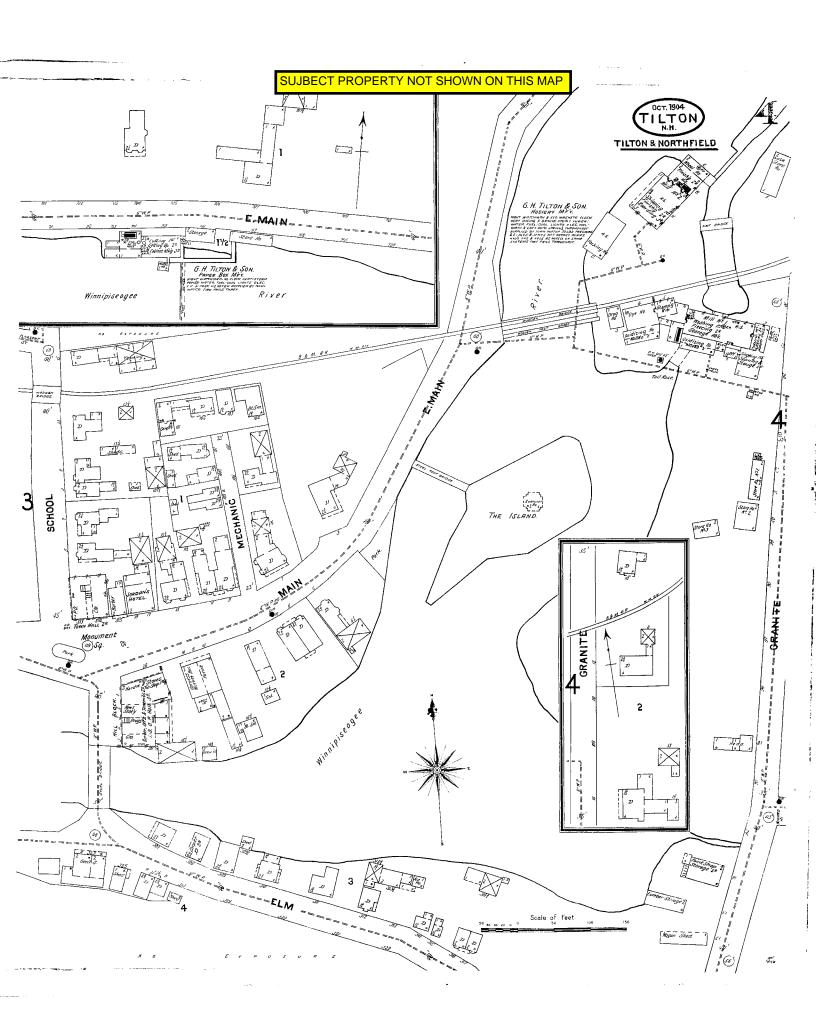

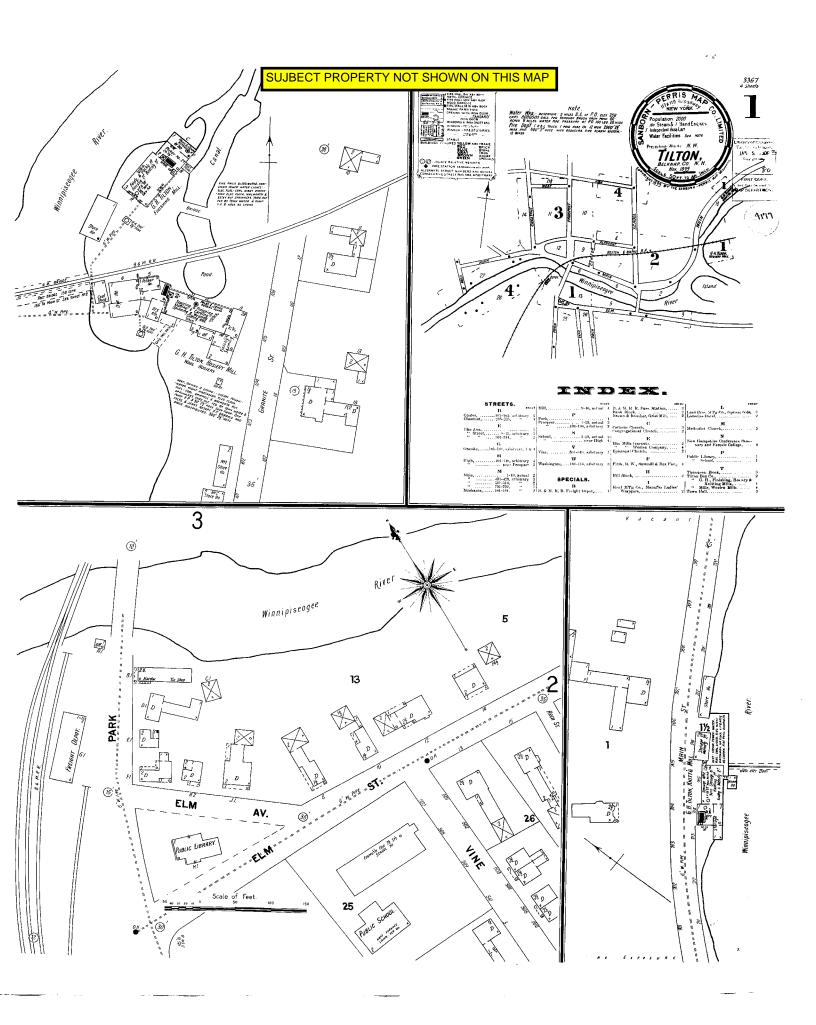

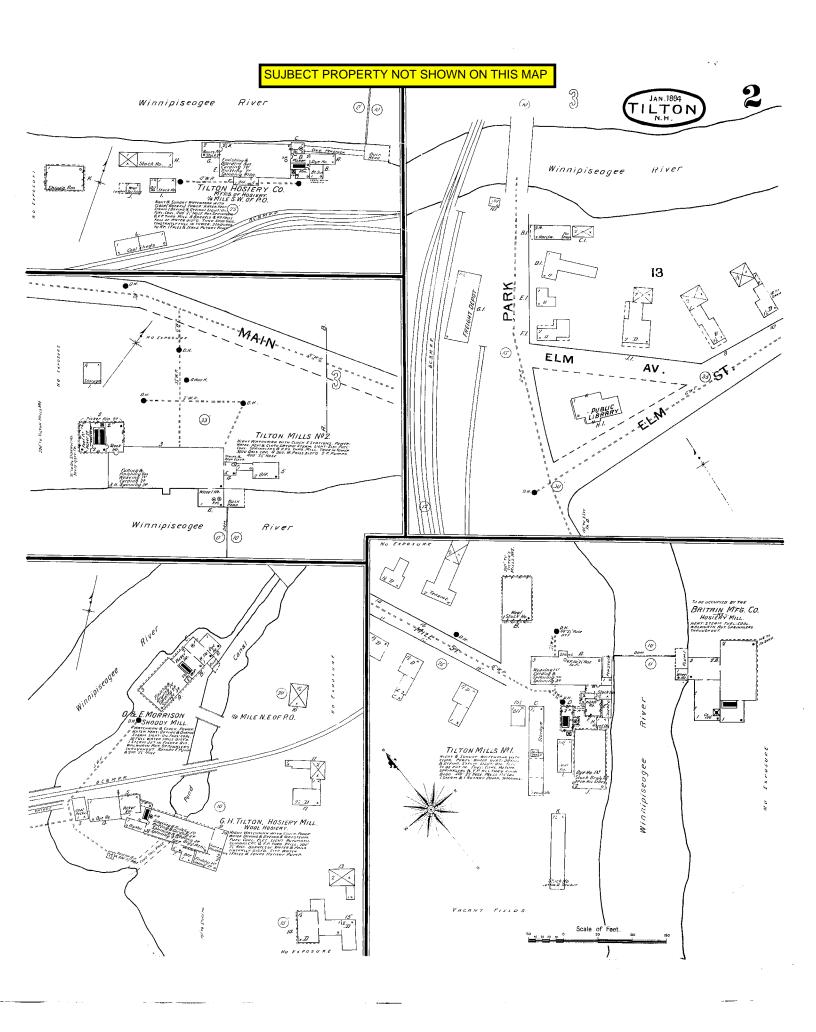


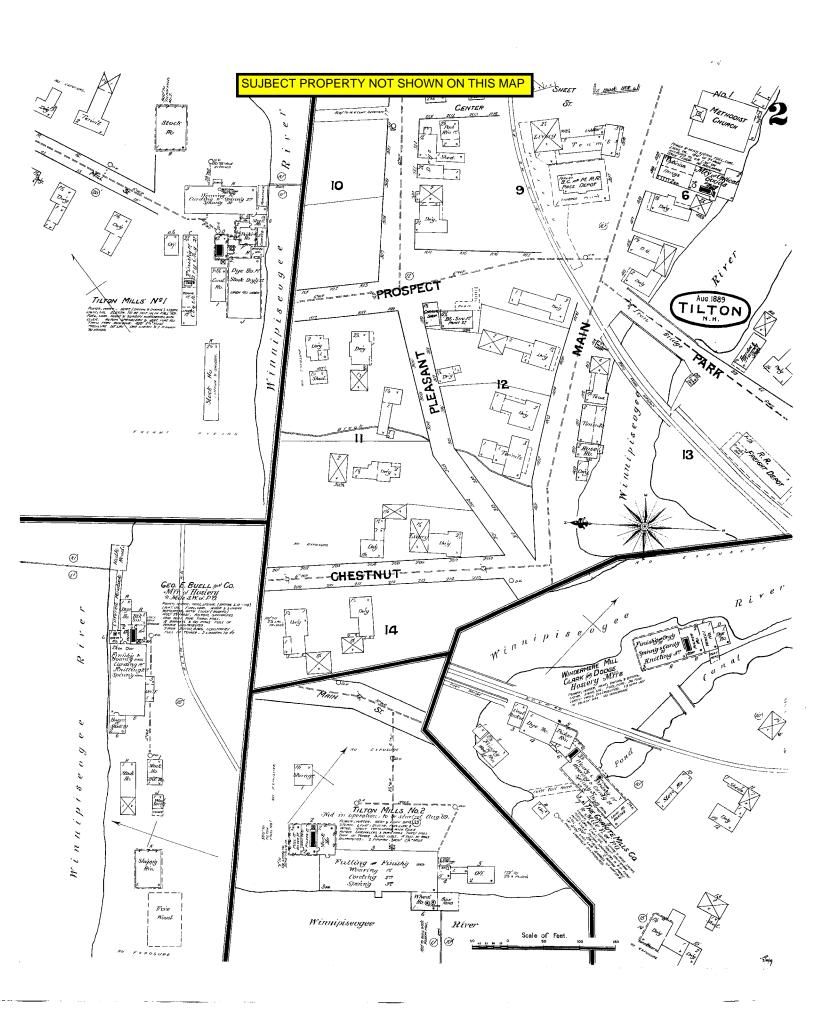

APPENDIX F UST DOCUMENTATION

(comp)

_Date of Closure

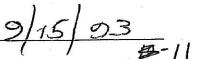

Mailed \$\\\30\05\\
Initial \\Subseteq \\\

New Hampshire Department of Environmental Services (603) 271-3644

TANK CLOSURE REPORT FORM

1. Telephone Message	DILLIS		Initial 50N	×	19 right tot
	VINIFALLS 1		Telephone: 224	-4182	traffic light (1)
	D PH		Fax#260	7	
2. Facility Registration	n Number: 🔘 ~	114478			
Name ERNIE		SALES	Street ERS	TZ MIAM TE	
3. Owner Name A T Name HELLEN B Street 9 PLEASAN	CLA)R	City	TON 210 03276	Telephone 286-9	3597
4. Tank Removal Inform		*** Indicate suspe		Telephone	3377
Tank#/ Size	Tank # Z Size 3 00 0 ?, Product CRS will tank be replaced? Yes (No)	Tank #	Tank#	Tank # Size Product will tank be replaced? Yes No	
6. Local Fire Dept. Notif		Do			
7. Inspector Mande 8. Field Screening Method Mi Loo Hip — POKAY PER Blaise H 9. Sample Information	nods (tank and pipin 30 - 165 pp 1> limit sample ske character:	sbecause a	wested. to be more	Most Dill ulls removed on present. U ved 2/16/63. unt, will spill	Contamination
tank #	tank# L	tank# 7	tank# 4	tank #fle hole	back fill
Soil Water	Soil Water	Chave	Soil Water	Soil Water	nma
Taken By: Wobis 10.Tank Condition:	ninkhoman - c	ISTS TO BE			43
tank# qroud M. Dillis-holes Po Alloholicate tank and sa	holes	holes	holes w	tank #	
12 Include photographs 13 Estimated cubic ya	of the excavation a	and tank(s) condition	on if avaliable.	30 cubic ya	rds
observation techniques to	determine regulated su	including the entire expostance contamination	cavation area. I am knowl n in soils and groundwater. excavated tank(s) and four	There is no evidence of	of ge.
Name:	Signature:		- PA MONTH AND A STATE OF THE S	Date:	
	1			; 12-Mar	-93

New Hampshire Dept. of Environmental Services

6 Hazen Drive

P. O. Box 95

Concord, New Hampshire 03301

Note: 16 1993

Concord, New Hampshire 03301

Concord, New Hampshire 03301

Concord, New Hampshire 03301

: J . 31



Notification for Underground	Storage Tank Systems	
. Type of Notification	State Use Only	
	ID NUMBER 0114478	
A. New Facility B. Amended C. Clo		
	A. Date entered to Computer 8/17/93	
INSTRUCTIONS	B. Data Entry Clerk Initials Std	
Please type or print in ink all items except "signature" in Section		
must be completed for each location containing underground s		
If more than four (4) are owned at this location, photocopy the	ACTIVE 4	
sheets, and staple contination sheets to this form. Also, provide a site plan and facility layout. (may be an a		
hand sketch).	INACTIVE	
I. OWNERSHIP OF TANK(S)	II. LOCATION OF TANK(S)	
Owner Name ESTAte OF Anthony Turch		
GO Helen Belair (Admx)	ERNIES USED CAR'S	
Street Address	Street Address (DO NOT USE POST OFFICE BOX)	
9 Pleasant St	Route 3 - EAST MAIN St	
City State Zip Code	City State Zip Code	
-1/m nill 03276	Tilton N.H. 03275	
11/FOR 161		
Phone Number (include area code)	County RelKNAP	
III. TYPE OF OWNER	IV. MAPPING INFORMATION	
	If known please provide:	
Federal Gov't. Commercial	The Geologic Location of the tanks by degree, minutes and	
State Gov't. Private	seconds: (Example Lat 42. 36, 12 N Long, 95. 24. 17 W) Latitude: Longitude:	
State GOV L.		
Local Gov't.	Tax Map #0004 Lot #: 007)	
V. TYPE O	FACILITY	
Gas StationLocal	GovernmentContractor	
	GovernmentTrucking/ Transportation	
	al – Non – Military Utilities al – Military Farm or Residential	
Aircraft OwnerFeder		
Railroad Indus		
	YPAR'S ASD	
VI. CONTACT PERSON IN	CHARGE OF TANKS	
Name Job Title Address	Phone Number (Include Area Code)	
RFd #1	Tillon nell 603-286-8597	
Dennis Belair Box 3760	Tilton NH. 603-286-8391	
VII. CERTIF		
I certify under penalty of law that I have personally examined	and am familiar with the information submitted in this and all	
	dividuales immediately responsible for obtaining the information. I	
believe that the submitted information is true, accurate and co	npiete.	
Name and title of owner Signature	Date Signed	
Helen RelaiR ADMINISTRATRIX	elen Belair 8-11-93	
I STETEN ISOLAR ADMINISTRATRIX		

CLOSURE REPORT	REVIEW	•
UST# 0-1194	78	
Town: TILTO.		<u> </u>
Closure Date	15/93	
Date report received:	10/5/93	
Reviewer:		
Field Screening:	N	·
Analytical Results:	M N	
Release Indicated:	W N	 ;
Contaminated Soil Stockpiled:	N 30	± Yos
Release Action: Compliance Report		
Referred to E.R.	MN Picic	BERRY
Non-Release Letter:	Y N	
Date: (5/(4/93		8
DES#		
NOTES: WASTE C	Dic-FPH-8	old NOT do METALS
	4	

VIII. DESCRIPTION OF UNDERGROUND STORAGE TA	NKS (Complet			on.)
Tank Identification Number 1.Status of Tank	Tank No/_	Tank No. 2	Tank No. 3	Tank No. 4
(Mark Only One) Currently in Us	e			
Temporarily Out of Us	e			
Permanently Out of Us	e		(
Newly Installe				
Amendment of Information				
2. Date of Installation	<u>" </u>	 		
3. Estimate Total Capacity (gallons)	111	Known		
4. Material of Construction				
(Mark all that Apply) Asphalt Coated or Bare Ste	el 🗀			
Cathodically Protected Ste				
Lined Interio				
Epoxy Coated Ste				
Composit (steel with Fiberglas				
Fiberglass Reinforced Plast				
Double Walle				
Fiberglass Reinforced Plast Double Walle Polyethylene Tank Jack				
Concre			- -	
Excavation Lin	<u> </u>	1		
Unknov	<u> </u>			
Other, Please Speci	fy L			
Has Tank been Repaired	?			
5. Piping Material			,	*
(Mark all that Apply) Bare Ste	el -			
Galvanized Ste	.			
Fiberglass Reinforced Plasi				
Cathodically Protected Ste				
Double Walle			Jair III.	
Copp				
Secondary Containme				
Unknov				
Other, Please Speci	ry Line			
6. Piping Type				
6. Piping Type (Mark all that Apply) Suction: No Valve at Tar				
Suction: No valve at Tai				
10/0				
Pressu				
Has piping been repaired	I? .			

Part Commence

Tank Identification Number	Tank No/_	Tank No. 2	Tank No. 3	Tank No. <u> </u>
7. Substance Currently or Last Stored in Greatest Quantity by Volume Gasoline Diesel Gasohol Kerosene Heating Oil Used Oil Other, Please Specify				
Hazardous Substance CERCLA name and / or CAS number				
Mixture of Substances Please Specify				
Tank Currently Empty	7es	Yes	Yes	Yes
IX. TANKS PERMANENTLY O				
Programme and the programme and the state of	Tank No. /	Tank No. 2	Tank No. 3	Tank No.
Closing of Tank A. Estimate date last used (month / day / year)	1960	1960	1960	1960 1960
B. Estimate date tank closed (month/day/year)				
C. Tank was removed from ground D. Tank was closed in ground E. Tank filled with inert material F. Change in service				
Site Assessment Completed Estimate date of action (month / day / year)				
Evidence of a leak detected Page 3 of 4				

X. CERTIFICATION OF COMPLIANCE (COMPLETE FOR ALL N	IEW AND UPG	RADED TANKS	AT THIS LOCA	ATION)
Tank Identification Number	Tank No			Tank No
Installation A. Installer certified by tank and piping manufacturers				
B. Installer certified or licensed by the implementing agency				
C. Installation inspected by a registered engineer				
D. Installation inspected and approved by implementing agency				
E. Manufacturer's installation checklists have been completed				
8,000 State \$1000 totals (1000 totals)			<u> </u>	, ———
F. Another method allowed by State agency. Please specify 2. Release Detection (Mark all that apply)				
A. Manual tank guaging				
B. Tank tightness testing				
C. Monthly inventory controls				
D. Automatic tank gauging				
E. Vapor monitoring				
F. Groundwater monitoring				
G. interstitial monitoring / double walled tank				:
H. Interstitial monitoring / secondary containment				
I. Automatic line leak detectors				
J. Line tightness testing	· - - - - - - - - - -			
K. Other methods allowed by implementing agency				
3.Spill And Overfill Protection		**		
A. Overfill device installed				
B. Spill device installed				
XI. FINANCIAL RESPONSI	BILITY			
		. [
I have met the financial responsibilit in accordance with NH Code of Adn		ts	5.	
Rules Env-Ws 411.10	illingti auve			

Check All That Apply:	* *			
Self insurance			Letter of Cred	
Risk Retention Group			State Funds	s
Guarantee			Trust Fund	
Surety Bond			Other Mertod	
		Spe	ecify	
OATH: I certify that the information concerning the inst belief and knowledge.	allation provi	ded in Section	X is true to th	e best of my
Installer			2 .	
Name	-	Signature		Date
Position		Company		

TANK 01/ > 35 ppm, 160ppm

Main St

APPENDIX G HISTORICAL DOCUMENTATION

State of New Campshire

WATER RESOURCES BOARD

STATE HOUSE ANNEX CONCORD 03301

August 23, 1967

Board of Selectmen Tilton New Hampshire 03276

RE: Dumping Fill in Winnipesaukee River

Gentlemen:

This letter will acknowledge your correspondence of August 10, 1967 regarding the dumping of fill into the Winnipesaukee River in Tilton, New Hampshire.

On August 15, 1967, an inspection was made at the site and it was found that the owners of the Gulf Station on East Main Street, Melvin Roberts, Jr., George Raffaelly and Robert Jordan had dumped fill into a swamp area adjoining the Winnipesaukee River and a portion of this fill did extent into the bed of the river. This fill extends along their shore approximately 100 feet.

The State does not claim any ownership of the bed of this river and it is assumed that the land owners abutting the river own to the center of the stream.

This fill is located immediately downstream of the B.& M. RR Bridge and at this point the river is 100 - 150 feet wide. The flow at the time of the inspection was approximately 1200 cfs or about one-third the maximum flow recorded on this river. In our opinion, this fill does not appear to restrict the flow at this point in the river. Mr. Roberts was told that he should not place any more fill out into the river and perhaps would have to protect what is there from erosion.

Our concern in this regard is the possibility that a filling in of the channel to the extent that during times of high flow the fill could act as a dam. At this site the railroad bridge does pond the water upstream to some degree. The wide river below this bridge allows a drop in the water surface near this fill indicating that the flow has not been retarded in this case.

We appreciate your prompt action in reporting this case to us. In the future, we hope for better control of this type situation by proper legislation.

Very truly yours,

Secret Mc Lee Sr. George M. McGee, Sr.

gmcg:c

cc: Mr. Shapiro, Asst.Attorney General

DITTEL DIVIDE	BTLA	STATE-]
---------------	------	--------	---

Townskixy_Tilto	on		
State New Hamps	shire		
No Earlier Than			
No Later Than	(unless dec	ision rece	eived from municipality)

TAXPAYER'S RSA 76:16-a APPEAL TO THE BOARD OF TAX AND LAND APPEALS

Use only for tax year 1992

File this with board after filing with municipality; deadline stated in instructions. Read and follow instructions.

INSTRUCTIONS

- Complete the appeal form by typing or legibly printing.
- 2. File this appeal form with the board of tax and land appeals within the RSA 76:16-a deadlines (see below), and after applying for abatement in writing with the municipality.

<u>Deadlines:</u> ("Notice of tax" means the last date the municipality mails the final tax bill (as determined by the board of tax and land appeals). If your municipality bills twice annually, you must appeal after the second bill and not before.

Step One Taxpayer must file the abatement application with the municipality within two months after notice of tax.

Municipality has until six months after notice of tax

to grant or deny the application.

Step Three Taxpayer must file appeal to the board of tax and land appeals (RSA 76:16-a) or the superior court (RSA 76:17) but not to both:

- 1) no earlier than: a) receiving the municipality's decision on the abatement application; or b) six months after notice of tax, even if the municipality has not responded; and
- 2) no later than eight months from notice of the tax.

NOTE: For municipalities with 9,000 or more parcels, add 2 months to step two and three for the year of the municipal-wide revaluation.

- Section A. Until otherwise informed in writing by the appealing party, all orders, notices and communications shall be made to: a) the party's listed address and phone number; or b) the representative's address and phone number.
- Section C. List only the properties you are appealing and for which an abatement application was filed with your municipality. A party may use the same form to appeal more than one property, provided the properties are all in common ownership. For example, if John and Jane Smith jointly own 2 properties, they only need to file one appeal. But, if they own 1 property jointly and Jane owns 1 property herself, a separate appeal must be filed for each property.
- Section E. State with specificity all of the reasons you intend to rely on in presenting your appeal.
- Section F. The Taxpayer has the burden of proof to show the assessment is incorrect. To carry this burden, the Taxpayer must show what the property was worth on April 1 of the year appealed. This value and the assessment will then be compared to other assessments in the municipality. Therefore, comparable properties are an essential part of most appeals.
- 7. Make a copy of the appeal form for your file.

RSA 76:16-a APPEAL TO BOARD OF TAX AND LAND APPEALS

The state of the s

	Name: Helen Belair, Administratrix of the Estate of Anthony Turc
	Mailing address: 9 Pleasant Street, Tilton, NH 03276
	Telephone number (work) N/A (home) 286-4467
= c= T 0 1	
ECLION	B. Representative if other than owner/ taxpayer (must also complete Section A)
	Name: R. Peter Shapiro, Esq.
	Mailing address: 41 Centre Street, Concord, NH 03301
	Telephone number (work) 225-6627 (home)
	rerephone number (work) (nome)
でつのてへい	C Property appealed
FCTION	C. Property appealed.
	ty appealed and include a brief description and the assessment. Street address Description Assessment
	A DOTOCO GARTODO DODOTTOCTON TUDOODOMONO
See Attac	hed
See Attac	hed
See Attac	hed
2-2-	applicable box:
	applicable box: Single-family
	applicable box: Single-family
heck the (applicable box: Single-family
heck the (applicable box: Single-family
heck the a	applicable box: Single-family
heck the a	Single-family [X] Commercial/Industrial Residential Condominium [] Vacant, unimproved land Residential Multi-unit [] Other: Mobile Home (Park/Site) unit D. Other Property ist other property in municipality owned by appealing person or ayer even if the properties have not been appealed.
heck the	applicable box: [Single-family

Section C

Tax map, lot	Street Address	<u>Description</u>	Assessment
OR2, L3	Rt 3	Land & Buildings	\$21,700.00
OR2, L4	Rt 3		40,500.00
OR2, L5	Rt 3		138,600.00
OR2, L7	Rt 3		64,400.00
OR2, L10	Rt 3		237,600.00
OU04, L71	Rt 3		79,500.00

SECTION E. Reasons for appeal

The Taxpayer has the burden to prove disproportionality. Therefore, state with specificity, the reasons supporting your appeal. Statements such as "taxes too high", "disproportionately assessed" or "assessment exceeds market value" are insufficient. Generally, specificity requires the Taxpayer to present material on the following (all may not apply): 1) physical data incorrect description or measurement of property; 2) market data the property's value on the April 1 assessment
date, supported by comparable sales or a professional opinion of value; and/or 3) assessment data the property's assessment exceeds the general level of assessment shown by comparing the property's assessment with assessments on other properties in the municipality. Attach additional sheets if needed.
The property substantially comprises a salvage yard which has been subject to
litigation for several years regarding allegations by the State of potential
pollution problems. Same rendered the property substantially valueless.
The property was assessed above the fair market value.
A portion of the property was destroyed by fire.
SECTION F. Comparable Properties
List the properties you are relying upon to show overassessment of your property.
Tax map, lot Street address Description Assessment No comparables are available at this time. If same are necessary and become
available, they will be submitted in due course.

SECTION G. Certification by appealing party

By signing below, the appealing party certifies and swears under the penalties of RSA Ch. 641 (check off box to ensure compliance):

- [X] an abatement application was timely filed with the municipality and the application included the appealed property(s);
- 2) [x] an inventory form was timely filed (if required by the municipality;
- 3) [x] the municipality has responded to my abatement application or six months has passed since the notice of tax;
- 4) [X] the appeal has a good faith basis, and the facts stated are true to the best of my/our knowledge, ESTATE OF ANTHONY TURCHIN

Date: 5-21-93

By: Welin Belan

Helen Belair, Administratrix

(Signature)

SECTION H. <u>Certification and Appearance by</u> <u>Representative (if other than</u> <u>owner/taxpayer)</u>

By signing below the appealing party's representative certifies and swears under penalties of RSA 641:

- 1) all (certifications) in Section G are true;
 - 2) the appealing party has authorized this representation; and

3) a copy of this form was sent to the client.

Date:

5-21-93

R. Peter Shapiro, Esq.

FILING INSTRUCTIONS

File completed appeal form along with a <u>nonrefundable</u> \$65.00 check (payable to "Treasurer, State of New Hampshire") at:

Board of Tax and Land Appeals
State Office Park South, Johnson Hall
107 Pleasant Street
Concord, NH 03301

NOTE: Date of filing is the date this form is either hand delivered to the board, postmarked by the post office or receipted by an overnight delivery service.

CASE MOVE STRUCTURE WAS