

rier earch,	new nampshire
TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 1	USGS QUAD: Gilmanton
COMMON NAME: Hartshorn House	FUNCTIONAL TYPE: house
HISTORIC NAME: Daniel Bunker House	PRESENT USE: house
LOCATION: Hartshorn Road	ARCHITECT/BUILDER:
OWNER: George and Bertha Hartshorn ADDRESS: RFD 1 Barnstead N.H. 03218	CONDITION: Exc. Good $_{ m X}$ Fair Poor Ruins INTEGRITY: Original Site $_{ m X}$ Moved
MAP & PARCEL NO: map 3, 1ot 53  DATE: 1790's  SOURCE: George Hartshorn  STYLE: Federal	Major Alterations & Date: asphalt shingles on rear-c.1950 exterior chimney-c.1955; new rear window c.1960; porch-1970's LEVEL/SIGNIFICANCE: Natl. State Local x
BOUNDARY AND ACREAGE DESCRIPTION: bounde	d on southwest by Hartshorn Road, on
southeast by Christian Yegen, on	northeast by Suncook River, on northwest
by Kenneth and Dorothy Carr	149 acres
PHOTO:	MAP:

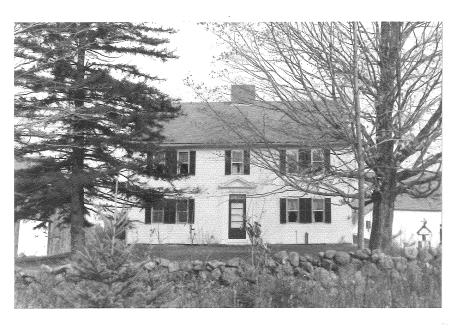

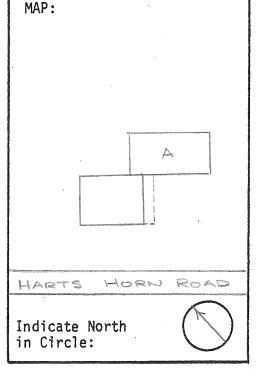

COMMENTS:	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	<del></del>			· · · · · · · · · · · · · · · · · · ·		
SURVEYOR:	David	Ruell	· · · · · · · · · · · · · · · · · · ·		_DATE:	1986	
PHOTOGRAPHER		David	Ruell	······································		·	•


A	. AR	CHITECTURAL DESCRIPTION
	٦.	STYLE: Federal BUILDING TYPE: house
	2.	
	3.	
	5.	
		Ornamentation sillboards, cornerboards
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/CupolasDetails
	7.	CHIMNEYS: # 2 Location center ridge/ NE Materials brick/concrete block
	8.	EAVES TREATMENT: Lateral box cornice with mouldings and frieze
	*	Gable End close verges with simple returns
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 2/1
		Surrounds moulded frames, louvred shutters
	10.	boot o paner
		Surround: Flanked pilasters Topped transom window
		Framed classical triangular pediment, granite step
		OTHERS: # 1 Location side bay, SE gable end Surrounds plain frame
	11.	vertified blied 1001
		Location(s) SE gable end Supports posts w/simple bases & capitals
		Other Features concrete floor, close eaves, boarded half-gable
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape
		Description
	12	FUS/MINCS. # 1 letter stories A 1 D C 2
	13.	ELLS/WINGS: # 1 letter Stories A 1 B C D Bays AasyB C D
		bescription(s) noverty stating-Sw (front) & SE gable end, tarpaper-NE
		asphalt shingles-NW gable end, cornerboards, close eaves & verges, gable roof, attached shed-garage
В.	SITE	DESCRIPTION/SURROUNDING ENVIRONMENT
-		RELATED STRUCTURES: # 1 Type large barn with attached sheds
•		Description stone foundation, board walls, close eaves & verges, gable roo
	15.	LANDSCAPE FEATURES: Built flagpole, wellhouse, stone walls on road
		Natural lawn with trees and shrubs, large field to rear
С.	SIGN	IFICANCE
	16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A fine Federal style house, notable
		for its excellent pedimented entry.
	17.	SITE INTEGRITY: A fine example of an early farmstead.
		HISTORIC ASSOCIATIONS: Built for Capt. Daniel Bunker (1773-1842).
		RENCES.
	our • And §	interview, George Hartshorn
	МАР Г	Stuart Merrill <u>History &amp; Genealogy of Barnstead's Early Families</u> OATA 1859 county map 1892 atlas
	_	1014 actas

### Lakes Region Planning Commission Meredith, New Hampshire

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 2	USGS QUAD: Gilmanton
COMMON NAME: Lake House	FUNCTIONAL TYPE: house
HISTORIC NAME: Lougee House	PRESENT USE: house
LOCATION: Coles Ledge Road	ARCHITECT/BUILDER:
OWNER: Marlyne Lake Estate	CONDITION: Exc. Goodx Fair Poor Ruins
ADDRESS: Barnstead, N.H. 03218	INTEGRITY: Original Site x Moved Date
MAP & PARCEL NO: map 5, lot 13	Major Alterations & Date:
DATE: late 18th century	A added- prob. 2oth century eastern ell (C) windows- c.1975
SOURCE: David Lake	
STYLE: Federal	LEVEL/SIGNIFICANCE: Nat1StateLoca1 $_{ imes}$
BOUNDARY AND ACREAGE DESCRIPTION: bounded	on south by Coles Ledge Road, on west
by Parkey Road, on northwest by E	ugene Langley, on northeast by J. Ronald
Meikle, Carle Zimmerman, Lois Hil	1sgrove 104 acres

### PHOTO:




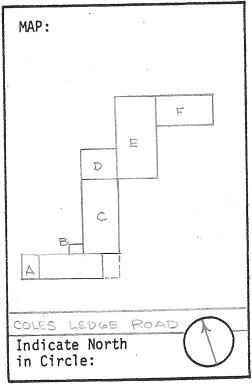


COMMENTS:			
SURVEYOR:	David Ruell	DATE: 1986	<del>and the second of the second </del>
PHOTOGRAPHER:	David Ruell		

Α.	ARC	HITECTURAL DESCRIPTION
	1.	STYLE: Federal BUILDING TYPE: house
	2.	# STORIES: $2\frac{1}{2}$ DIMENSIONS: $40 \times 16$ BAYS: $5 \times 1$ FORM: house
	3.	FOUNDATION: cut granite block 4. STRUCTURE: wooden frame
	5.	WALLS: Sheathing clapboards
		Ornamentation sillboards, paneled corner pilasters
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/CupolasDetails
	7.	CHIMNEYS: # 1 Location center, ridge Materials brick
	8.	EAVES TREATMENT: Lateral box cornice with mouldings and frieze
	, , , , , , , , , , , , , , , , , , ,	Gable End box cornice with mouldings, frieze and returns
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 1st-9/6
		Surrounds moulded frames, louvred shutters 2nd-6/6
	10.	ENTRIES-MAIN: Location center, S (street) facade Door 6 panel
		Surround: Flanked moulded frame, half sidelights Topped shallow cornice
		Framed semielliptical louvred fan, pilasters and entablature, granite
		OTHERS: #LocationSurrounds
	11.	PORCHES/HOODS: # 1 Style/Roof Type veranda, hip roof
		Location(s) east gable end Supports double & triple posts w/ bases &
	•	Other Features cornice with frieze, beaded board ceiling capitals
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape
		Description
		letter
	13.	ELLS/WINGS: # 5 letter Stories A1B1C1D1E2%F12 Bays A3x3B1x-C7x1D2x2E3xasym
		Description(s) A-sunroom; B-bathroom addition; C-long ell; B-2nd ell loxi
	•	E- large barn; F-shed (in disrepair); gable roofs-A,C,E; shed roofs-
_		B,D; clapboards-A,B,C,D,E; boarding-A,E,F; E has large ventilator on roof
		DESCRIPTION/SURROUNDING ENVIRONMENT
:	14.	RELATED STRUCTURES: #Type
	3 =	Description
	15.	LANDSCAPE FEATURES: Built stone walls, wire fences, wellhouse
C	CICNI	Natural lawns with trees and shrubs, small pond to rear, view of Lougee Pd.
		ARCHITECTURAL IMPORTANCE/INTECRITY: A C: II 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	10.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A fine Federal style house, noteworthy for its impressive entry and its, presumably later, corner pilasters.
	17	SITE INTEGRITY: A landmark on Coles Ledge Road.
	17.	HISTORIC ASSOCIATIONS: Built for Simeon Lougee (1767-1855). Home of
	10.	Robert St. John, journalist and author.
	REFE	RENCES: interview, David Lake, Helen Merrill
	Stua	art Merrill, History & Geneaology of Barnstead's Early Families
	MAP I	DATA 1859 county map 1892 atlas

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 3	USGS QUAD: Gilmanton
COMMON NAME: Sellin House	FUNCTIONAL TYPE: house
HISTORIC NAME:	PRESENT USE: house
LOCATION: Beauty Hill Road	ARCHITECT/BUILDER: possibly Asa Hurd
OWNER: Thorsten Sellin	CONDITION: Exc. Good xFair Poor Ruins
ADDRESS: Gilmanton, N.H. 03237	INTEGRITY: Original Site x Moved
MAP & PARCEL NO: map 9, lot 3	Major Alterations & Date:
DATE: early 19th century	shed converted into rear porch
SOURCE: Thorsten Sellin	and extended, new rear windows-1932-3
STYLE: Federal	LEVEL/SIGNIFICANCE: Natl. State Local $_{ imes}$
BOUNDARY AND ACREAGE DESCRIPTION: bounded	on southwest by Beauty Hill Road, on
northwest by Gilmanton town line, o	on southeast by Mary Maxwell, on northeast
by John and Muriel Warburton	76 acres

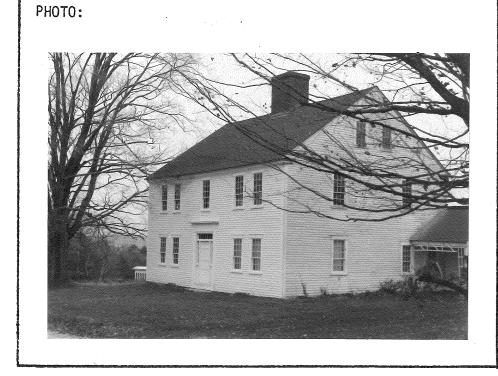


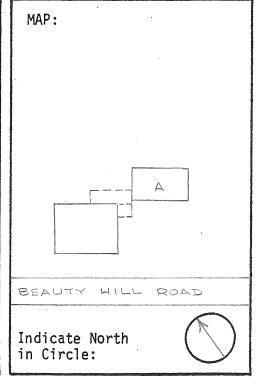


COMMENTS: I	he dates:	of 1808	and 1	<u>818 h</u>	ave	both	been	attri	buted	to	the	house.
SURVEYOR:		David	Ruell	SES, I Sever	<del></del>		<del></del>	DATE:	1980	6	n,	pug-2000-0
PHOTOGRAPHE	R:		D	avid	Rue1	.1		<del>-</del>				

Α.	ARC	HITECTURAL DESCRIPTION
	1.	STYLE: Federal BUILDING TYPE: house
	2.	# STORIES: 2½ DIMENSIONS: 40 x 32 BAYS: 5 x 2 FORM: house
	3.	FOUNDATION: cut granite block 4. STRUCTURE: post and beam
	5.	WALLS: Sheathing clapboards
		Ornamentation cornerboards
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/CupolasDetails
	7.	CHIMNEYS: #1 Location center, ridge Materials brick
	8.	EAVES TREATMENT: Lateral box cornice with mouldings and frieze
	. "	Gable End shallow cornices with friezes and returns of lateral cornices
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 9/6 (6/6-so
		Surrounds plain frames (rear- 3 double windows) rear&gables
	10.	ENTRIES-MAIN: Locationcenter , SW (street) facade Door 6 panel
		Surround: Flanked half sidelights Topped transom window
		Framed pseudo-pilasters and entablature, granite step
		OTHERS: # 3 Location 1-SE gable end, 2-NE facadeSurrounds plain frames
	11.	PORCHES/HOODS: # 2 Style/Roof Type side entry porch, gable/ veranda, shed
		Location(s) E corner/ NE facade Supports both-square posts
		Other Features both- close eaves and verges, clapboarded gables; both
		share a common wall, shingled on the rear (NE). boarded on the front (
		Description
		ELLS/WINGS: # letter Stories A 1 B C D Bays A3x1B C D
		Description(s) shed, clapboarded front(SW), wooden shingled gable ends,
		vertical boarding, rear(NE); cornerboards, plain window and door trim
		close eaves and verges, gable roof
В.	SITE	DESCRIPTION/SURROUNDING ENVIRONMENT
	14.	RELATED STRUCTURES: # 3 Type barn, study, gazebo(former waiting room)
1		Description barn & study-gable roofs, gazebo-ranks of arched windows w/
	15.	LANDSCAPE FEATURES: Built stone walls pilasters
		Natural lawns with trees & shrubs, fields to rear, fine mountain view
C.	SIGN	IFICANCE
	16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A well preserved attractive Federal .
		style house, with good proportions, and simple but effective ornament.
	17.	SITE INTEGRITY: Part of a small cluster of attractive early houses.
	18.	HISTORIC ASSOCIATIONS:
	RFFF	RENCES:
	I Shot ho	RENCES: interview, Thorsten Sellin
	МДР	DATA 1859 county map 1892 atlas
		Dain 2007 Cours) Inst 2002 Cours

USGS QUAD: Gilmanton
FUNCTIONAL TYPE: house
PRESENT USE: house
ARCHITECT/BUILDER:
CONDITION: Exc. Goodx Fair Poor Ruins
INTEGRITY: Original Site x Moved
Major Alterations & Date:
basement vestibule-1960's; rear porch
1960's; entry porch-1970's; new entry c.1980; exterior chimney-1984
LEVEL/SIGNIFICANCE: Natl. State Local x
on east by Maple Street, on north by
the Gosses, on west by Edward & Ilse
lden & Belle Rollins 1.5 acres

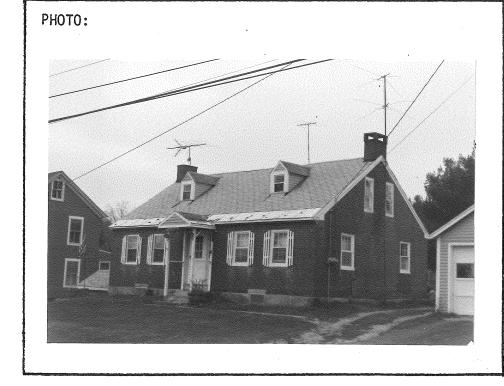


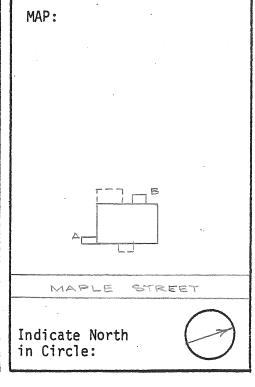


COMMENTS:	One of	f the	brick	s at	the	northwes	st. c	orner	of	ṭhe	hous	e is	signed	1
"John D.	Clark"	and	dated	"1832	2" (	although	the	last	num	eral	is	unc1	ear".	
SURVEYOR:			Dav	id Ru	e11			[	DATE:	19	986			
PHOTOGRAPH	HER:					David Rue	11							

A. A	RCHITECTURAL DESCRIPTION
1	. STYLE: vernacular BUILDING TYPE: house
2	
3	
5	
	Ornamentation
6.	ROOF: Type gable
	Sheathing asphalt shingles
	Dormers/Cupolas 2 gabled dormers, E slope Details antenna
7.	CHIMNEYS: # 3 Location2-ridge ends/exteridaterialsbrick/concrete
8.	EAVES TREATMENT: Lateral wooden box cornice above sawtooth brick course
	Gable End close wooden verges with simple returns
9.	- Symmetrical Siape rectangular Sasil 0/0 (gable-
	Surrounds plain wooden frames, flat brick heads 4/4)
10.	bot patieted w/willdow
	Surround: Flanked half sidelights above panels Toppedflat brick head
	Framed porch (which see)
* 4	OTHERS: #LocationSurrounds
11.	" 2 of is, not if entry porch, gable, encrosed porch, gable
	Location(s) main entry, E/W facade Supports simple posts/clapboarded walls
7.0	Other Features clapboarded gable / ranks of modern windows, open eaves
12.	
	Description
13	ELLS/WINGS: # 2 on map Stories A 1 B 1 C D Bays Alx-Blx-C D  Description(s) A-basement westibule alarbased as a large and a large alarbased as a large a
	Description(s) A becomes to restrict 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	Description(s) A-basement vestibule, clapboards, cornerboards, close verges, open lateral eaves w/fascia boards, gable roof; B-small storage
	shed, board walls, corrugated plastic shed roof
B. SITE	DESCRIPTION/SURROUNDING ENVIRONMENT
14.	
1	Description 1 story; garage-clapboards, shed-metal; summerhouse-screened
15.	LANDSCAPE FEATURES: Built dam & foundations of old mill, stone walls
	Natural lawn with trees & shrubs, brook behind house
C. SIGN	NIFICANCE
16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: An interesting brick cape. The only
1	brick house in Barnstead.
17.	one in the village.
18.	HISTORIC ASSOCIATIONS: May have been built for either Oliver P.H. Young or
REFE	John H. Collins.  RENCES: interview, Arthur and Mary Gosse
	Correspondence, Helen Merrill
MAP	DATA 1859 county map 1892 atlas

10WN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 5	USGS QUAD: Alton
COMMON NAME: Labonte House	FUNCTIONAL TYPE: house
HISTORIC NAME: Welch House	PRESENT USE: house
LOCATION: Route 126 and Welch Road	ARCHITECT/BUILDER:
OWNER: Flora Labonte ADDRESS: RFD 2 Center Barnstead, N.  03225  MAP & PARCEL NO: map 8, lot 31  DATE: mid 19th century  SOURCE: architectural style	CONDITION: Exc. Good xFair Poor Ruins  H'INTEGRITY: Original Site x Moved Date  Major Alterations & Date:  porch, new ell windows, and 2nd ell(B added c. 1970
STYLE:mid 19th century vernacular	LEVEL/SIGNIFICANCE: NatlStateLocal_x_
BOUNDARY AND ACREAGE DESCRIPTION: bounded	on south by Route 126, on west by Welch
Road, on north by Edward and Mary	O'Malley, on east by Garrick Stockman
3.5 acres	
,	

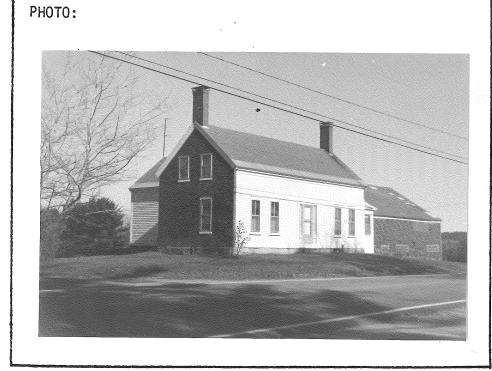

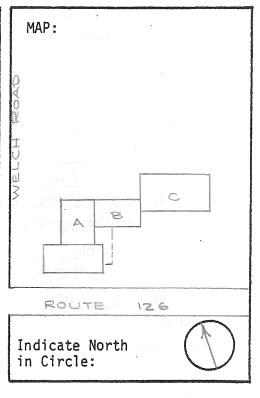

COMMENTS:							
				•			
SURVEYOR:	David	Ruell			DATE:	1986	
PHOTOGRAPHER:	. }	David	Ruell				The light agreed to the last of the last
						•	

Α.	ARC	CHITECTURAL DESCRIPTION
	٦.	STYLE: mid 19th century vernacular BUILDING TYPE: house
	2.	# STORIES: 12 DIMENSIONS: 38 x 18 BAYS: 5 x 2 FORM: cape
	3.	
	5.	WALLS: Sheathing clapboards - N&S brick, irregular bond-E&W frame
		Ornamentation cornerboards - N&S
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/CupolasDetails
	7.	CHIMNEYS: # 2 Location ridge, ends Materials brick
	8.	EAVES TREATMENT: Lateral shallow box cornices with mouldings and friezes
		Gable End close wooden verges
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 2/2 (gable-
		Surrounds S-moulded lintels; other facades- plain frames 1/1)
	10.	ENTRIES-MAIN: Location center, S (street) facade Door 5 panel
		Surround: Flanked 5/6 sidelights Topped lintel w/ corne
		Framed plain frame with cornerblocks, concrete steps block
		OTHERS: #Surrounds
	11.	
		Location(s)Supports
•		Other Features
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape
		Description
	3.0	FILE WITHOUT II O letter Commission And D. C.
	13.	ELLS/WINGS: # 3 letter Stories Alignment Bays Align
		Description(s) A,B-ells; C-large barn; all gable roofs, cornerboards &
		close verges; A,B-clapboards; A-shallow box cornices with friezes;
·B.	CITE	B-cornices with sloping soffits; C-asphalt & wooden shingles, close eaves DESCRIPTION/SURROUNDING ENVIRONMENT
υ.	14.	,
:	17.	RELATED STRUCTURES: # Type Description
	15.	LANDSCAPE FEATURES: Built stone wall on Welch Road
		Natural lawn with some trees & shrubs, large field to rear, trees on road
C.	SIGN	IFICANCE .
		ARCHITECTURAL IMPORTANCE/INTEGRITY: A good example of a rare building .
-		Type. Perhaps the only brick-ended cape in the Lakes Region.
		SITE INTEGRITY: Dominates the intersection of Route 126 and Welch Road.
	18.	HISTORIC ASSOCIATIONS: Built by the Howe family , with bricks made on the property.
		RENCES: correspondence, Helen Merrill
	1 \ tm (	interview, Flora Labonte
	MAP I	DATA 1859 county map 1892 atlas
		TODY COUNTY MAY TOTA ACTAS

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 6	
COMMON NAME: Danis House	FUNCTIONAL TYPE: house
HISTORIC NAME: Foss House	PRESENT USE: house
LOCATION: North Barnstead Road	
OWNER: Hnery J. Danis	CONDITION: Exc. Goodx Fair Poor Ruins
ADDRESS: RFD 1 Center Barnstead, No. 03225	CONDITION: Exc. Goodx Fair Poor Ruins  H. INTEGRITY: Original Site x Moved
MAP & PARCEL NO: map 15, lot 21	- Major Alterations & Date
DATE: mid 19th century	<del>-</del>
SOURCE: architectural style	<del></del>
STYLE: mid 19th century vernacular	LEVEL/SIGNIFICANCE: NatlStateLocal_X
BOUNDARY AND ACREAGE DESCRIPTION: boun	ded on southwest by North Barnstead Road
Union Telephone Co., Ethel Mielke,	on northwest by Ethel Mielke, Edwin Raut:
southeast by North Barnstead Congr	egational Church, Henry Danis & Joan Saw
on northeast by James Locke, and W	illiam D. Noyes 50 acres
PHOTO:	MAP:  C  B  Indicate North in Circle:
COMMENTS:	N BARNSTEAD ROAD
SURVEYOR: David Ruell	DATE: 1986
DUOTOCRAPHED: David Ruell	Will be a second description of the second d

Α.	. AR	CHITECTURAL DESCRIPTION
	1.	STYLE: mid 19th century vernacular BUILDING TYPE: house
	2.	# STORIES: 1½ DIMENSIONS: 36 x 26 BAYS: 5 x 2 FORM: cape
	3.	FOUNDATION: cut granite block 4. STRUCTURE: post and beam
	5.	WALLS: Sheathing clapboards
		Ornamentation sillboards, cornerboards, cast metal eagle
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/Cupolas Details antennas, skylight
	7.	CHIMNEYS: # 2 Location slope, NE (rear) Materials brick
	8.	EAVES TREATMENT: Lateral box cornice with mouldings and frieze
	3	Gable End close verges with returns of the lateral cornices
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 6/6
		Surrounds moulded frames, louvred shutters
	10.	
		Surround: Flanked two-thirds sidelights above panelsTopped paneled lintel
		Framed paneled frame with cornerblocks, granite step
		OTHERS: # 1 Location side bay ,NE (rear) facade Surrounds plain frame
	11.	
		Location(s) SE gable end Supports square post, 1 wooden column
		Other Features box cornice with mouldings & frieze, board floor
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape
		Description
	10	FILE WITHER # 2 letter c A.11 D. O. C. 1 D. D
	13.	ELLS/WINGS: # 3 letter Stories A 1½ B 2 C 1 D Bays Aasy B 3x1C-x-D
		Description(s) clapboards-A, NW of B&C wooden shingles-other sidesof B,
		SE of C; boards-NE of C; all-cornerboards, close verges; close eaves-A,B
·B.	SITE	A-long ell, cross gable roof; B-barn,gable roof; C-shed-open lateral  DESCRIPTION/SURROUNDING ENVIRONMENT  eaves
υ.		RELATED STRUCTURES: # 3 Type large barn, garage, shed
:	0 7 4	Description clapboards-barn & shed, wooden shingles, barn & garage
	15.	LANDSCAPE FEATURES: Built stone steps, board fence with granite posts
		Natural lawn with trees & shrubs, fields to rear, fine view
C.	SIGN	IFICANCE
	16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: Attractive mid 19th century cape, showing
S		influence of Greek Revival style. Typical of many high fronted Barnstead
	17.	SITE INTEGRITY: Contributes to historic character of North Barnstead.
	18.	HISTORIC ASSOCIATIONS:
		RENCES:
	VELE	interview, Henry Danis
	МΔР	
	MAP	DATA 1859 county map 1892 atlas

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 7	USGS QUAD: Alton
COMMON NAME: Sawyer House	FUNCTIONAL TYPE: house
HISTORIC NAME: Dow House	PRESENT USE: house
LOCATION: North Barnstead Road	
OWNER: Henry J. Danis and Joan S.Saw	yerCONDITION: Exc. Good xFair Poor Ruins
ADDRESS: RFD 1, Center Barnstead, N.H 03225	· INTEGRITY: Original Site x Moved
MAP & PARCEL NO: map 15, 1ot 25	Major Alterations & Date:
DATE: mid 19th century	garage doors on ell c.1970
SOURCE: architectural style	porch enclosed c.1975 brick steps added
STYLE: Greek Revival	brick steps added LEVEL/SIGNIFICANCE: NatlState_Local $_{ m X}$
BOUNDARY AND ACREAGE DESCRIPTION: bound	ed on southwest by North Barnstead Road
William & Nicole Smith, on northwest	by North Barnstead Congregational Churc
Henry Danis, James Locke, on northeas	t by Alton town line, on southeast by
Gary & Debra Calderone 63.5 ac	res
PHOTO:	MAP:
·	
	N. BARNSTEAD RD.  Indicate North in Circle:
COMMENTS:	
	1.004
SURVEYOR: David Ruell	DATE: 1986 Ruell
PHOTOGRAPHER. David	NUC II

A.	. ARC	HITECTURAL DESCRIPTION		
	1.	STYLE: Greek Revival BUILDING TYPE: house		
	2.	# STORIES: $1\frac{1}{2}$ DIMENSIONS: $32 \times 26$ BAYS: $5 \times 2$ FORM: cross gable cap		
	3.	FOUNDATION: cut granite block 4. STRUCTURE: wooden frame		
	5. WALLS: Sheathing clapboards			
		Ornamentation wide paneled corner pilasters		
	6.	ROOF: Type gable, with cross gable on front (SW) slope		
		Sheathing asphalt shingles		
		Dormers/Cupolas Details lightning rods		
	7.	CHIMNEYS: # 2 Location main ridge, ends Materials brick		
	8.	EAVES TREATMENT: Lateral wide box cornice with mouldings and deep frieze		
	, ,	Gable End same box cornice, pedimented on cross gable, w/returns on gable		
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 6/6 ends		
		Surrounds "peaked" moulded lintels, louvred shutters (SW gable-triple window		
	10.	ENTRIES-MAIN: Location center, SW (street) facade Door4 panel Gothic arch		
		Surround: Flanked full sidelights Topped transom window		
		Framed recessed entry, paneled sidewalls & ceiling, outer frame of		
		pilasters and peaked moulded lintel, modern brick & stone steps		
	11.	PORCHES/HOODS: # 1 Style/Roof Type enclosed inset porch covered by ell roof		
		Location(s) SE side of ell Supports grooved pillars		
		Other Features now enclosed with windows above low clapboarded walls		
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape		
		Description		
		lattan		
	13.	ELLS/WINGS: # 1 letter Stories A 1 B C D Bays AasynB C D		
		bescription(s) tong ett, clapboarded sides, wooden sningled gable end,		
	•	cornerboards, close verges, wide lateral box cornices with mouldings		
		and deep friezes, gable roof, "peaked" lintels on older windows& doors		
В.		DESCRIPTION/SURROUNDING ENVIRONMENT		
	14.	RELATED STRUCTURES: # 2 Type large barn, shed		
		Description both-gable roofs; barn-boarding, wooden shingles; shed-asphalt		
	15.	LANDSCAPE FEATURES: Built board fence shingles		
		Natural lawns with trees & shrubs, fields to rear, fine view		
C.		FICANCE		
		ARCHITECTURAL IMPORTANCE/INTEGRITY: An attractive house, notable for its		
	uncor	mmon cross gable roof, Greek Revial trim, and Gothic arched triple window.		
	17.	SITE INTEGRITY: Strong contributor to historic character of North Barn-		
	18.	HISTORIC ASSOCIATIONS:		
	REFER	ENCES: interview, Henry Danis		
	MAP [	ATA 1859 county map 1892 atlas		

TOWN: Barnstead COUNTY: Belk	nap
SURVEY NUMBER: 8	USGS QUAD: Alton
COMMON NAME: North Barnstead Co	ngregationFUNCTIONAL TYPE: church
HISTORIC NAME North Meetinghous	Church PRESENT USE: church
LOCATION: North Barnstead Road	· · · · · · · · · · · · · · · · · · ·
OWNER: North Barnstead Congreg	ational CONDITION: Exc. Goodx Fair Poor Ruins
ADDRESS: Church, Center Barnst 03225	<u> </u>
MAP & PARCEL NO: map 15, lot	Date Date
DATE: 1827	repaired, remodeled- 1853
SOURCE: Manual of the Congrega	cional Church belfry added c.1970
STYLE: vernacular Barnstead	LEVEL/SIGNIFICANCE: Natl. State Local x
BOUNDARY AND ACREAGE DESCRIPTION:	bounded on southwest by North Barnstead Road
on northwest and northeast	by Henry Danis, on southeast by Henry Danis 8
Joan Sawyer 1 acr	5
	·
РНОТО:	MAP:
•	
THE WAY	A
	N. BARNSTEAD ROAD
Man water	
	Indicate North
	in Circle:
COMMENTS: Dedicated October	31, 1827.
SURVEYOR:	David Ruell DATE: 1986
PHOTOGRAPHER:	David Ruell

A.	. AK	HITECTURAL DESCRIPTION
	٦.	STYLE: vernacular BUILDING TYPE: church
		# STORIES: 25 DIMENSIONS: 36 x 52 BAYS: 3 x 4 FORM: rectangular
	3.	
	5.	WALLS: Sheathing clapboards
		Ornamentation sillboards, cornerboards, church sign
	6.	
		Sheathing asphalt shingles
		Dormers/Cupolas belfry (which see) Details lightning rods
	7.	CHIMNEYS: # 1 Location exterior, NE (rear) Materials brick
		EAVES TREATMENT: Lateral box cornice with mouldings and frieze
		Gable End SW (front)-wide simple box cornice: NE(rear)-close verges
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 12/8-sides
		Surrounds plain frames, louvred shutters 8/8-front
	10.	ENTRIES-MAIN: Location center, SW(street) gable end Door double 4-paneled
		Surround: Flanked full sidelights, louvred shutters Topped plain lintel
		Framed recessed entry, paneled walls & ceiling, outer moulded frame with
		Cornerblocks, board floor and steps
	11.	PORCHES/HOODS: #Style/Roof Type
		Location(s)Supports
		Other Features
	12.	BAY WINDOWS/TOWERS: # 1 Location ridge, SW end Stories 2 Shape square
		Description flush boarded; base-shallow cornice; belfry-corner pilaster arched openings, box cornice w/ frieze; pyramidal roof w/ flared eave
	13.	ELLS/WINGS: # 1 on map Stories A 1 B C D Bays A1x1B C D
		Description(s) attached privy, clapboards, cornerboards, shallow simple
		box cornice, shed roof, plain window & door trim
В.	SITE	DESCRIPTION/SURROUNDING ENVIRONMENT
	14.	RELATED STRUCTURES: # Type
:		Description
	15.	LANDSCAPE FEATURES: Built stone walls
		Natural lawn with trees and shrubs.
C.	SIGN	IFICANCE
	16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A simple but attractive vernacular .
-		church, notable for its recessed entry.
	17.	
	18.	HISTORIC ASSOCIATIONS: Built for North Barnstead Congregational Society,
	REFER	organized in 1820. In continuous use as a church since construction.  RENCES:150th Anniversary of the N.Barnstead Congregational Church  Manuals of the Congregational Churches at Barnstead Parade and
	***** 1 be 1	Manuals of the Congregational Churches at Barnstead Parade and
	мар г	North Barnstead; John Wheeler "Barnstead, an Historical Address" Grani  OATA 1859 county map 1892 atlas Monthly, 1897
	1.	interviews, Carolyn Johnson  Helen Merrill

# Lakes Region Planning Commission Meredith, New Hampshire


TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 9 USGS QUAD:	Gilmanton
	PE: church
HISTORIC NAME: Centre Meetinghouse Church PRESENT USE:	church
LOCATION: Route 126 Center Barnstead ARCHITECT/BUI	ILDER:
OWNER: Center Barnstead Christian ChurchCONDITION: Examples Center Barnstead, N.H. 03225 INTEGRITY: On	ccGood <sub>x_</sub> FairPoorRuins riginal SitexMoved
MAP & PARCEL NO: map 20, lot 27  DATE: c.1839  SOURCE: John Wheeler Barnstead Address additions additions and the second seco	Date tions & Date:  nt & portico's floor, on of A & B- c.1978  [CANCE: NatlState_xLocal
by Shackford Corner Road, on northwest by Town o	f Barnstead, on northeast
by Andrew and Paula Houle · .27 acre	
PHOTO:	MAP:  ROUTE 126  Indicate North in Circle:
COMMENTS: Interesting interior with pressed metal	walls and ceiling.
Dedicated Sept. 12, 1839.	
SURVEYOR: David Ruell	DATE: 1986

PHOTOGRAPHER: David Ruell

A. AF	CHITECTURAL DESCRIPTION
7.	STYLE: Greek Revival BUILDING TYPE: church
2.	
3.	·
5.	
	Ornamentation sillboards, cornerboards, louver and cross in SW gable
6.	ROOF: Type gable
	Sheathing asphalt shingles
	Dormers/Cupolas tower (which see) Details
7.	CHIMNEYS: #LocationMaterials
8.	EAVES TREATMENT: Lateral box cornice with mouldings and frieze
. •	Gable EndSW-pedimented box cornice w/mouldings&frieze NE-close verges
9.	
	Surrounds paneled frame with cornerblocks: louvred shutters
10.	ENTRIES-MAIN: Location 2- side bays, SW gable end Door 5 panel
	Surround: Flankedtwo-thirds sidelights above panels Topped lintel w/corner
	Framed outer frame with cornerblocks blocks
	OTHERS: #LocationSurrounds
77.	·
	Location(s) SW (street) gable end Supports four wooden columns
	Other Features concrete floor, deep frieze with church sign, beaded boar
12.	The state of the s
	Description box cornices w/mouldings&frieze base-clapboards, cornerboards
b	elfry-flush boards, pilasters, louvers, crenelated parapet, pinnacles
13.	ELLS/WINGS: # $\frac{1}{2}$ letter Stories A $\frac{1}{1}$ B $\frac{1}{1}$ C D Bays A $\frac{1}{1}$ B $\frac{1}{1}$ C D
	Description(s) both-vinyl"clapboards" & "cornerboards"; A-basement
	vestibule, gable roof, close vinyl eaves & verges; B-rear addition,
	vinyl clad box cornice, shed roof, side entry similar to front entries
. SIT	E DESCRIPTION/SURROUNDING ENVIRONMENT
14.	RELATED STRUCTURES: # Type
	Description
15.	LANDSCAPE FEATURES: Built paved walk, Barnstead Soldiers Monument
	Natural lawn with trees .
. SIG	VIFICANCE
	ARCHITECTURAL IMPORTANCE/INTEGRITY: An attractive temple style Greek Revive
ch	urch, notable for its portico, entries, and belfry (the lastwith Gothic
17.	SITE INTEGRITY: Center Barnstead's most prominent public building. detail
	HISTORIC ASSOCIATIONS: Served as Congregational Church until 1963, when
REF	it became an independent church.
-	GRENCES: interviews, Rev & Mrs. Gordon Fleming, Mr. & Mrs. Gordon Treadwell John Wheeler "Barnstead, An Historical Address" Granite Monthly, 1897
	DATA 1859 county map 1892 atlas

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 10	USGS QUAD: Gilmanton
COMMON NAME: Barnstead Town Hall	FUNCTIONAL TYPE: town hall
HISTORIC NAME: Barnstead Town House	PRESENT USE: meeting place/town offices
LOCATION: Route 126, Center Barnstead	ARCHITECT/BUILDER:
OWNER: Town of Barnstead	CONDITION: Exc. Good X Fair Poor Ruins
ADDRESS: Center Barnstead, N.H. 03225	INTEGRITY: Original Site x Moved
MAP & PARCEL NO: map 20, lot 26-1  DATE: 1847	Major Alterations & Date: side doors, added c.1970 rear addition(A) c. 1978
SOURCE: Jewett History of Barnstead	front door, both hoods 1985
STYLE: vernacular	LEVEL/SIGNIFICANCE: NatlState_Local_x
BOUNDARY AND ACREAGE DESCRIPTION: bounded	d on southwest by Route 126, on
southeast by Center Barnstead Chri	istian Church, on northeast by Andrew
and Paula Houle, on northwest by (	Center Barnstead Fire Department
.51 acre	



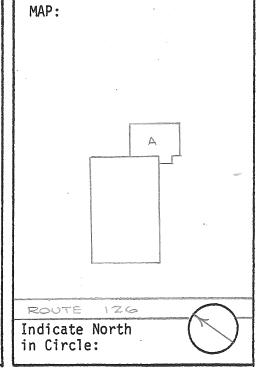


COMMENTS:			
SURVEYOR:	David Ruell	DATE:	1986
PHOTOGRAPHER:	David Ruell		


А	. ARO	CHITECTURAL DESCRIPTION
	1.	STYLE: vernacular BUILDING TYPE: town hall
	2.	# STORIES: 1½ DIMENSIONS: 41 x 66 BAYS: 3 x 5 FORM: rectangular pla
	3.	
	5.	WALLS: Sheathing clapboards
		Ornamentation sillboards, cornerboards, wall sign, bulletin board
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/CupolasDetails
	7.	CHIMNEYS: # 2 Location NW slope/exterior Materials brick
	8.	EAVES TREATMENT: Lateral box cornices with mouldings and friezes
	, · · · · · · · · · · · · · · · · · · ·	Gable End close verges
	9.	
		Surrounds plain frames
	10.	editer: bw(brrece) gabre end - 1000ern prath (1001
		Surround: Flanked plain trim Topped lintel w/ central
		Framed wooden step, hood (which see) & corner blocks
		OTHERS: # 2 Location NW, SE side facades Surrounds transom window PORCHES/HOODS: # 1 Style/Roof Type gabled hood
	11.	
		Location(s) main entry, SW Supports simple braces
•		Other Features exposed rafters, open eaves w/fascia boards, board gable
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape
		Description
		lattar
	13.	ELLS/WINGS: # 1 letter Stories A 1 B C D Bays A 3xasym C D
		Description(s) town office addition, clapboards, cornerboards, sillboards,
	٠	close verges, simple lateral box cornices, gable roof, shed roofed
_		hood over entry
В.		DESCRIPTION/SURROUNDING ENVIRONMENT
	14.	RELATED STRUCTURES: #Type
		Description
	15.	LANDSCAPE FEATURES: Built flagpole, parking lot
		Natural small lawn with trees and shrubs
C.		IFICANCE
	16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: Simple, relatively well preserved,
	3.5	vernacular town hall, typical of its period.
		SHE INTEGRITY: A prominent building in Center Barnstead.
		HISTORIC ASSOCIATIONS: Town meetings held here through 1972. Still used for elections.
	REFE	RENCES: interviews, town office staff, Helen Merrill Jeremiah P. Jewett History of Barnstead
		Jeremiah P. Jewett History of Barnstead
	MAP I	DATA 1859 county map 1892 atlas

Lakes Region Planning Commission Meredith, New Hampshire

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 11	USGS QUAD: Gilmanton
COMMON NAME: Barnstead Parade Church	FUNCTIONAL TYPE: church
HISTORIC NAME: Parade Meetinghouse	PRESENT USE: church
LOCATION: 01d Route 28, Barnstead Parade	ARCHITECT/BUILDER: Richard Sinclair
OWNER: Barnstead Parade Church ADDRESS: Center Barnstead, N.H. 03225	CONDITION: Exc. Goodx Fair Poor Ruins
MAP & PARCEL NO: map 18. lot 48  DATE: 1796-1799  SOURCE: Manual of the Congregational Character Style: Victorianized Vernacular  BOUNDARY AND ACREAGE DESCRIPTION: bounded of the Congregational Character Soundary And Acreage Description: bounded of the Congregational Character Style: Victorianized Vernacular Soundary And Acreage Description: bounded of the Congregational Character Style: Victorianized Vernacular Soundary And Acreage Description: bounded of the Congregational Character Style: Victorianized Vernacular Soundary And Acreage Description: bounded of the Congregational Character Style: Victorianized Vernacular Soundary And Acreage Description: bounded of the Congregational Character Style: Victorianized Vernacular Style: Victorianized Vernacular Soundary And Acreage Description: bounded of the Congregational Character Style: Victorianized Vernacular Style: Victorianized V	LEVEL/SIGNIFICANCE: NatlState_Local_x on northwest by Old Route 28, on northeast

РНОТО:

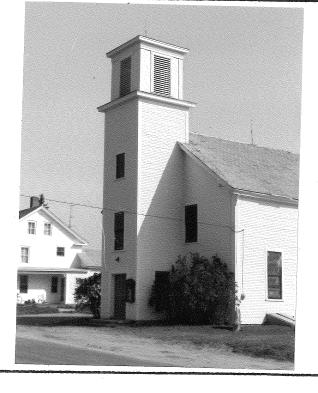

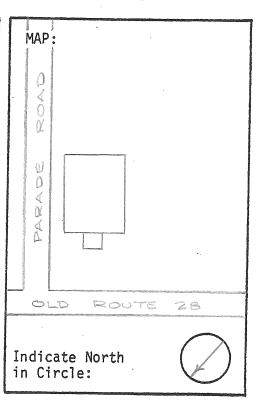

COMMENTS:	Dedicated Sept.	16, 1799.	Built on	Barnstead	Parade, donated
	to Town by Eli	Bunker in	1796, for	meetinghou	ise and a parade.
SURVEYOR:	David Ruell			DATE:	1986
PHOTOGRAPHER:	David Ruel	1		the state of the s	·
		Marie and and a second			

Α.	ARCHITECTURAL DESCRIPTION
	1. STYLE: Victorianized vernacular BUILDING TYPE: church
	2. # STORIES: 1½ DIMENSIONS: 37 x 49 BAYS: 3 x 3 FORM rectangular plan
	3. FOUNDATION: cut granite block 4. STRUCTURE: wooden frame
	5. WALLS: Sheathing clapboards
	Ornamentation sillboards, cornerboards
4	5. ROOF: Type gable
	Sheathingslate
	Dormers/Cupolas Detailslightning rods
	7. CHIMNEYS: # 2 LocationNE slope/exteriorNWMaterialsbrick/concrete
8	B. EAVES TREATMENT: Lateral box cornice with mouldings, frieze, corner brackets
. •	Gable End box cornice with mouldings and frieze
9	. WINDOWS: Placement symmetrical Shape rectangular Sash stained glass
	Surrounds plain frames (arched-SE)  NW-diamond paned
10	. ENTRIES-MAIN: Location NW (street), in tower Door double 4-paneled
	Surround: Flanked plain trim Topped plain lintel
	Framed granite and concrete steps
	OTHERS: #LocationSurrounds
11	. PORCHES/HOODS: #Style/Roof Type
	Location(s)Supports
	Other Features
12	BAY WINDOWS/TOWERS: # 1 Location center, NW Stories 4 Shape square
	Description 3 lower stories- clapboards, cornerboards, box cornice w/
	mouldings & frieze, diamond paned windows w/ plain frames; belfry-
<b>李</b> 章。	Thish boarded, cornerboards, box cornice with mouldings & frieze,
	Description(s) large, plain framed louvers, very low pitched pyramidal
	roof with lightning rod
B. SIT	E DESCRIPTION/SURROUNDING ENVIRONMENT
14.	RELATED STRUCTURES: #Type
•	Description
15.	LANDSCAPE FEATURES: Built_
	Natural foundation shrubs; adjoins Barnstead Parade, a wide flat common
C. SIG	NIFICANCE
16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: An interesting 19th century adaption
	of an 18th century meetinghouse, notable for its tower & windows.
17.	
18.	HISTORIC ASSOCIATIONS: Built as the town meetinghouse used for early
RFF	
* * tas. 0 .	ERENCES: J.P. Jewett History of Barnstead  Manual of the Congregational Church at Barnstead Parade, 1896  Entennial Exercise of Building of AA. Meetinghouse at Barnstead Parade 1897
MAP	entennial Exercies of Building of Meetinghouse at Barnstead Parade, 1897  DATA 1859 county map 1892 atlas

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 12	USGS QUAD: Alton
COMMON NAME: S. Barnstead Congregational	FUNCTIONAL TYPE: church
HISTORIC NAME: Clark Meeting House Church	PRESENT USE: church
LOCATION: Route 126, South Barnstead	ARCHITECT/BUILDER:
OWNER: South Barnstead Congregational	CONDITION: Exc. Goodx Fair Poor Ruins
ADDRESS: Church, Center Barnstead, N.H.	INIEGRITI. Original Site x Moved
00220	Date
MAP & PARCEL NO: map 8, lot 15	Major Alterations & Date:
DATE: early 19th century (see below)	tower and entry porches added 1912
SOURCE: see below	
STYLE: Victorianized vernacular	LEVEL/SIGNIFICANCE: NatlState_Local $_{\times}$
BOUNDARY AND ACREAGE DESCRIPTION: bounded	on southwest by Route 126, on
northwest by Neil & Elizabeth Adams	on northeast by Ann C. Morrell
on southeast by Robert & Susan Dres	cher 1.4 acres

- W// = \$ \			
	Wall trit		

•.
26
torque medit tradition au me por les conditions différende from menor tradition de la partie de parties de l'a


COMMENTS: The da	ate has been	given as b	etween 1814	and 1819	(Manual	of Cong.	Churc
No.Barnstead),	1821(Manual	of Cong.Ch	urch,Barnste	ead Parade	) before	1822 (An	
SURVEYOR:	David	Ruell		DATE:	1986 <sup>I</sup>	nterestin	g Ev.
PHOTOGRAPHER:		David Rue	11			Lauryand - Canth Charles - Was Care Care	


Α	. AR	CHITECTURAL DESCRIPTION
	1.	STYLE: Victorianized vernacular BUILDING TYPE: church
	2.	
	3.	FOUNDATION: brick 4. STRUCTURE: wooden frame plan
	5.	
		Ornamentation sillboards, cornerboards, shallow cornice across gables
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/CupolasDetails
	7.	CHIMNEYS: # 1 Location ridge, NE end Materials brick
	8.	EAVES TREATMENT: Lateral box cornice with mouldings and frieze
	· .	Gable EndSW-box cornice w/mouldings, frieze, returns; NE-close verges
	9.	WINDOWS: Placement symmetrical Shape rectangular Sash 12/12
		Surrounds plain frame, louvred shutters
	10.	ENTRIES-MAIN: Location 2 - side bays, SW(street) facade Door 4 panel
		Surround: Flanked full sidelights Topped plain lintel
		Framed plain frame with cornerblocks
		OTHERS: # LocationSurrounds
	11.	
		Location(s) both main entries, SW Supports pillars w/bases & capitals
•	•	Other Features box cornice w/mouldings & frieze, granite steps w/metal
	12.	BAY WINDOWS/TOWERS: # 1 Location center, SW Stories 3 Shape square 1 square
		Description lower stories-clapboards, sillboards, corner pilasters,
	~ .	shallow cornice with dentils and frieze; 1st-4 panel door w/transom
	A.T.	window, 2nd diamond paned windows beneath wooden elock faces; belfry-
		Description(s) posts with oversized braces, balustrades with turned
	•	balusters, shallow cornice, pyramidal roof with flared eaves and
_		weathervane
ъ.		DESCRIPTION/SURROUNDING ENVIRONMENT
:	14.	RELATED STRUCTURES: # Type
	1.5	Description
	15.	LANDSCAPE FEATURES: Built cemetery around church, w/stone walls, pipe fence
C	CTCH	Natural trees and shrubs in cemetery
<b>C.</b>		IFICANCE  ARCHITECTURAL IMPORTANCE (INTEGRATY A. 1
	10.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A plain vernacular building, transformed into an attractive Victorian church by the addition of a tower & porches
	17	
		SITE INTEGRITY: South Barnstead's most important building.
,		HISTORIC ASSOCIATIONS: Built as a Free Will Baptist church; became an Adventist church in the mid 19th century and a Congregational Church
	REFEI Mai	RENCES: in the 1890's. nuals of the Congregational Churches in North Barnstead & Branstead Parac
	''An	Interesting Event, Celebration & Dedication' Granite Monthly, Feb.
	MAP [	DATA 1859 county map 1892 atlas 1913

TOUN . TO COUNTY	'a D 11	•	
TOWN: Barnstead COUNTY SURVEY NUMBER: 13		HSCS OHAD: C:1	
•		USGS QUAD: Gilmant FUNCTIONAL TYPE: ra	
COMMON NAME: Avery House HISTORIC NAME: Barnstead H			
LOCATION: Hartshorn Road		ARCHITECT/BUILDER:	
			X Fair Poor Ruins
OWNER: Nolan and Naomi ADDRESS: RFD 1 Barnstead	1 77 17 00010		Site x Moved
MAP & PARCEL NO: map 2, 10	. га		Date
DATE: 1889	<u> </u>	Major Alterations & E wooden deck a	
SOURCE: Hutchins, The B1	leherry Express		aded e 1700
STYLE: vernacula			latl. State xLocal
BOUNDARY AND ACREAGE DESCRI			Approximate statement to the statement of the statement o
by State of New Hamps			
by Kenneth and Doroth	ny Carr	4.64 acres	
PHOTO:		MAP:	
y x			
E Property Comments of the Com		GI T	
A CONTRACTOR OF THE PARTY OF TH	RAFINSTFÁIT		
			• .
		Indica	te North
		in Cir	
		Lancario de la composição	
COMMENTS:			
CLIDVEVAD.	avid Ruell	DATE:	1986
SURVEYOR: Da		Ruell	1700
1 Gent att 1 (m) 1 0	David		

A. AK	CHITECTURAL DESCRIPTION
1.	STYLE: vernacular BUILDING TYPE: railroad station
	# STORIES: 1 DIMENSIONS: 24 x 20 BAYS: 3 x 4 FORM: rectangular p1
3.	FOUNDATION: concrete 4. STRUCTURE: balloon frame
5.	WALLS: Sheathing clapboards
	Ornamentation sillboards, cornerboards, vertical boards defining bays
6.	ROOF: Type hip
	Sheathing asphalt shingles
	Dormers/Cupolas Detailsantenna
7.	CHIMNEYS: # 1 Location east slope Materials brick
	EAVES TREATMENT: Lateral very wide overhanging eaves (7 ft. deep), supported
	by chamfered & sawn braces, moulded cornice, beaded board soffit
9.	WINDOWS: Placement regular Shape rectangular Sash 9/1
	Surrounds plain frames
10.	ENTRIES-MAIN: Location south facade Door 6 panel
	Surround: Flanked plain trim Topped transom panel
	Framed wooden steps
	OTHERS: # 3 Location south, north, east facades Surrounds plain frames
11.	PORCHES/HOODS: # 1 Style/Roof Type wooden deck, beneath overhang of main
	Location(s) north & east facades Supports wooden posts roof
	Other Features wide board steps, railings with capped posts
12	BAY WINDOWS/TOWERS: #LocationStoriesShape
14.	•
	Description
12	ELLS/WINGS: # 1 on map Stories A 1 B C D Bays A1x2B C D
13.	·
	Description(s) small ticket office projection, same wall and window
	treatment as main block, double windows on south and west, sheltered
CITE	by overhang of the main roof
	DESCRIPTION/SURROUNDING ENVIRONMENT
14.	RELATED STRUCTURES: # 2 Type shed, boathouse
_	Description both 1 story; shed-gambrel roof, matches railroad station
15.	LANDSCAPE FEATURES: Built railroad crossing gate
	Natural lawns with trees and shrubs, banks of Suncook River
	IFICANCE
16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A well preserved and attractive late
	19th century vernacular railroad station.
17.	SITE INTEGRITY: An excellent reminder of the railroad era.
	HISTORIC ASSOCIATIONS: Built to serve Barnstead Parade when Suncook Valley
•	R.R. extended to Barnstead in 1889, in use until service abandoned in
NEFE	interview, Nolan and Naomi Avery  1943.
МЛО	John C.Hutchins ed. The Blueberry Express DATA 1892 atlas
1.74/2	UNIA 1072 actas

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 14	USGS QUAD: Gilmanton
COMMON NAME Oscar Foss Memorial Library	FUNCTIONAL TYPE: library/town offices
HISTORIC NAME: Oscar Foss Memorial Build	.PRESENT USE: library
LOCATION: Route 126, Center Barnstead	ARCHITECT/BUILDER: William M. Butterfield
OWNER: Town of Barnstead	CONDITION: Exc. Good x Fair Poor Ruins
ADDRESS: Center Barnstead 03225	INTEGRITY: Original Site x Moved
MAP & PARCEL NO: map 20, lot 4	Major Alterations & Date:
DATE: 1916-1917	old steps replaced by present
SOURCE: contemporary newspapers	steps & landing-1979 rear vestibule- 1981-82
STYLE: Classical	LEVEL/SIGNIFICANCE: Natl. Statex Local
BOUNDARY AND ACREAGE DESCRIPTION: bounded or	n northeast by Route 126, on northwest
by R. Kenneth Collins, on south	east and southwest by William & Marilyn
Stevens .17 acre	
•	

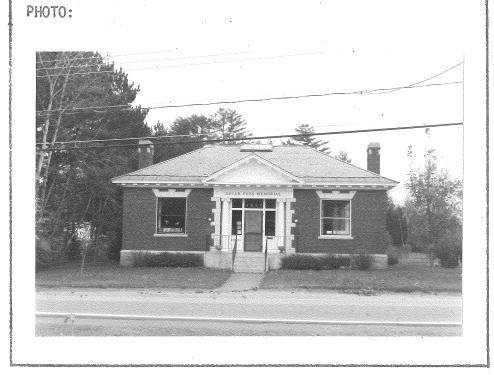


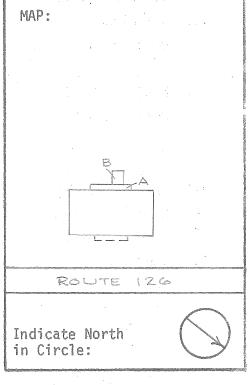


COMMENTS: Bu	uilder-	Leon F.	Bato	helder	of	Sunc	cook	. Const	ruction	begar	n 2nd
week of Ma	ay, 1916	. Dedic	ated	Oct.27,	19	17.	0n	National	Registe	r of	Historia
SURVEYOR:	David	Ruell						DATE	1986		Places.
PHOTOGRAPHE	R:	Da	vid F	Ruell							

Α.	ARC	HITECTURAL DESCRIPTION
	1.	STYLE: Classical BUILDING TYPE: library
	2.	# STORIES: 1 DIMENSIONS: 28 x 46 BAYS: 3 x 2 FORM: rectangular plan
		FOUNDATION:granite block w/watertable4. STRUCTURE: brick
	5.	WALLS: Sheathing brick, common bond, flemish variation
		Ornamentation
	6.	ROOF: Type hip, with small gable over pedimented entry
		Sheathing slate
		Dormers/Cupolas Details_skylight_knobs_acroterions
	7.	CHIMNEYS: # 2 Location center, NW, SE ends Materials brick w/granite found.
	8.	EAVES TREATMENT: Lateral wooden box cornice with mouldings, modillions, frieze
		Gable End same box cornice, pedimented, w/ cartouche & foliage in tympanum
	9.	WINDOWS: Placementsymmetrical Shape rectangular Sash 24/1
		Surrounds granite sills, flat granite arch w/keystone, radiating end blocks
	10.	ENTRIES-MAIN: Location center, NE (street) facade Doorglass w/wooden frame
		Surround: Flanked two-thirds sidelights Topped transom window
		Framed wide, shallow recessed entry, two Corinthian columns, pedimented
		entablature with end brackets, granite quoins,
	7.	PORCHES/HOODS: # 1 Style/Roof Type landing
		Location(s) main entry, NE Supports concrete platform
		Other Features concrete steps, wrought iron railings
	12.	BAY WINDOWS/TOWERS: #LocationStoriesShape
		Description
		letter
	13.	ELLS/WINGS: # 2 letter Stories A 1 B 1 C D Bays A Blx- C D
		Description(s) A-shallow rear projection, same brick walls, granite
		foundation, similar cornice, as main block, B- rear vestibule, vinyl
.5	A 7	"clapboards", "cornerboards", close eaves & verges, gable roof
ъ.		DESCRIPTION/SURROUNDING ENVIRONMENT
ţ.	14.	RELATED STRUCTURES: # Type
	3.5	Description
	15.	
C.	STON	Naturallawn with trees and shrubs
V.		
	10.	ARCHITECTURAL IMPORTANCE/INTEGRITY: A good example of the Classical style, one of the Region's best small public library buildings.
	17.	SITE INTEGRITY: A landmark in Center Barnstead.
	•	HISTORIC ASSOCIATIONS: Gift of Sarah U. Foss in memory of her husband. Housed town offices from 1917 to 1979.
	REFE	RENCES: Oscar Foss Memorial Library National Register nomination
	MAP [	DATA

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 15	USGS QUAD: Gilmanton
COMMON NAME: St. Paul's Catholic Church	FUNCTIONAL TYPE: church
HISTORIC NAME: St. Paul's Church	PRESENT USE: church
LOCATION: Maple Street, Center Barnstead	ARCHITECT/BUILDER: Andrew Daudelin
OWNER: St. Paul's Catholic Church	CONDITION: Exc. Good X Fair Poor Ruins
ADDRESS: Center Barnstead, N.H. 03225	INTEGRITY: Original SiteMoved_x
MAP & PARCEL NO: map 21, lot 6	Date 1950's Major Alterations & Date:
DATE: early 1930's	That is the second of the seco
SOURCE: Bailey, A Guide toNorthwood	
STYLE: vernacular Italianate	LEVEL/SIGNIFICANCE: NatlStateLocalx_
BOUNDARY AND ACREAGE DESCRIPTION: bounded of	on east by Maple Street, on northwest
by Route 28, on south and west by Wil	
•	

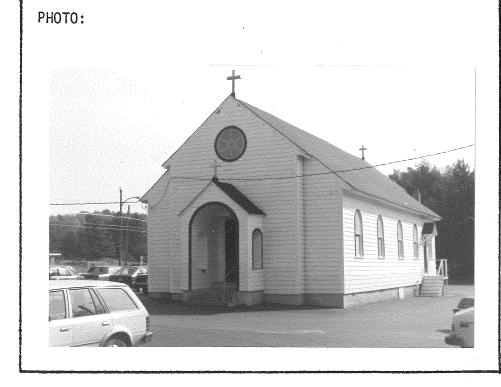

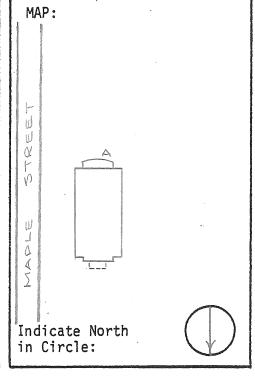

COMMENTS:				
SURVEYOR:	David Ruell	DATE:	1986	
PHOTOGRAPHER:	David Ruell			

Α.	ARC	HITECTURAL DESCRIPTION
	1.	STYLE: vernacular Italianate BUILDING TYPE: church
	2.	
	3.	FOUNDATION: concrete block 4. STRUCTURE: wooden frame
	5.	WALLS: Sheathing wooden shingles
		Ornamentation cornerboards
	6.	
		Sheathing asphalt shingles
		Dormers/Cupolas Details_crosses at ridge ends
	7.	CHIMNEYS: # 1 Location exterior, S Materials brick
	8.	EAVES TREATMENT: Lateral cornice with mouldings, sloping soffit & frieze
		Gable Endclose verges
	9.	WINDOWS: Placement symmetrical Shape semicircular archSash stained glass
		Surrounds plain arched frames (N gable- round window)
	10.	ENTRIES-MAIN: Location center, N gable end Door large 6 panel
		Surround: Flanked plain frame Toppedplain lintel
		Framed in arched recessed entry, shared with porch, shingled walls
		OTHERS: # 2 Location towards rear, E & W sides Surrounds plain frames
	11.	PORCHES/HOODS: #1/2 Style/Roof Type gable roofed entry porch/ gabled hoods
		Location(s) main entry, N/side entri&upports shingled walls/simple braces
•		Other Features semicircular arched entry, segmental arched side openings,
		close moulded eaves & verges, shingled inner walls, beaded board arched
		Description ceiling/ exposed rafters, close moulded eaves & verges,
		shelter board steps & landings with simple railings
	13.	ELLS/WINGS: # 1 on map Stories A 1 B C D Bays A 1x-B C D
		bescription(s) shallow apse with bowed south wall, shingled walls,
		cornerboards, simple box cornice, hipped roof, one high semicircular arched stained glass window
.5	^ T = P	
В.		DESCRIPTION/SURROUNDING ENVIRONMENT
,	14.	RELATED STRUCTURES: #Type
	15.	Description 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	15.	LANDSCAPE FEATURES: Built parking lot around church, church sign  Natural lawn to north .
C.	STONI	[FICANCE
<b>.</b>		ARCHITECTURAL IMPORTANCE/INTEGRITY: A simple but attractive chapel, a
	10.	shingled version of the ItalianateClassical churches popular in early
	17.	SITE INTEGRITY: Marks the north end of Center Barnstead village.
	3.0	MICTORIC ACCOCIATIONS B :11 Could live here live Earth Newthere d. After
	n	ew Northwood church built, cut in half and trucked to Barnstead.
	REFE	
	140-	of Northwood, N.H. interviews, Howard Rath, Helen Merrill
	MAP [	DATA

TOWN: Barnstead COUNTY: Belknap	
SURVEY NUMBER: 16	USGS QUAD: Alton
COMMON NAME:	
	nou & BESENT USE: vacant
LOCATION: Route 126. South Barnstead	
OWNER: Concord Pathologist Prof. Asson ADDRESS: Retirement Trust Fund Canterbury Rd., Chichester, N.H. 03263 MAP & PARCEL NO: map 8 lot 55  DATE: mid 19th century  SOURCE: architectural style  STYLE: vernacular  BOUNDARY AND ACREAGE DESCRIPTION: Bound	INTEGRITY: Original Site _xMoved
on northwest, southwest and south	neast by Harold Smith .25 acre
PHOTO:	MAP:
	ROUTE 126  Indicate North in Circle:
COMMENTS:	
SURVEYOR: David Ruell	DATE: 1986
PHOTOGRAPHER: David Ruell	

Α		CHITECTURAL DESCRIPTION
		STYLE: vernacular BUILDING TYPE: schoolhouse
	2.	# STORIES: 1 DIMENSIONS: 26 x 34 BAYS: 1 x asym FORM: rectangular
	3.	
	5.	WALLS: Sheathing clapboards
		Ornamentation sillboards, corner pilasters (rear-cornerboards)
	6.	ROOF: Type gable
		Sheathing asphalt shingles
		Dormers/Cupolas belfry (which see) Details ventilators
	7.	CHIMNEYS: # 1 Location ridge, SW end Materials brick
	8.	EAVES TREATMENT: Lateralbox cornice with mouldings and deep frieze
	3	Gable End box cornice with mouldings, deep frieze& returns (rear-close verges
	9.	WINDOWS: Placement regular Shape rectangular Sash 6/6 verges
		Surrounds plain frames
	10.	ENTRIES-MAIN: Location center, NE (street) gable end Doorpaneled w/ window
		Surround: Flanked plain trim Topped plain lintel
		Framed granite step
		OTHERS: #LocationSurrounds
	77.	PORCHES/HOODS: #Style/Roof Type
		Location(s)Supports
	,	Other Features
	12.	BAY WINDOWS/TOWERS: # 1 Location ridge, NE end Stories 1 Shapesquare
		Descriptionbelfry; base-clapboards, cornerboards, shallow cornice; open
	be	lfry-ornate cornerposts, shaped openings, box cornice; 2 tier pyramidal
	13.	ELLS/WINGS: # letter Stories A 1 B C D Bays Alx1 B C D roof
		Description(s) shed-clapboards, cornerboards, cornice with mouldings,
	•	sloping soffit and frieze, gable roof, plain frames, double board
		door in SE facade
В.		DESCRIPTION/SURROUNDING ENVIRONMENT
	14.	RELATED STRUCTURES: #Type
		Description
	15.	LANDSCAPE FEATURES: Built
		Natural lawn, apple tree .
С.	SIGN	IFICANCE
	16.	ARCHITECTURAL IMPORTANCE/INTEGRITY: An attractive 19th century vernacular
•		schoolhouse, embellished with an ornate Victorian belfry.
	17.	SITE INTEGRITY: A landmark in South Barnstead.
		HISTORIC ASSOCIATIONS: <u>Used as a one-room schoolhouse until the spring</u> of 1944.
	REFE	RENCES: interviews, Mrs. Soriano, Ann Carr and Carolyn Johnson
	MAP	DATA 1859 county map ? 1892 atlas